Health Science Associates

TECHNICAL AND ADVISORY SERVICES • ENVIRONMENTAL HEALTH AND SAFETY

LEAD-BASED PAINT (LBP) TESTING

at

IMPERIAL COURTS HOUSING PROJECT
LOS ANGELES, CALIFORNIA
HSA Project No. 93LA1103

MAY 10 - JUNE 29, 1993

Prepared for:

Mr. Bruce Rosky
Housing Authority of the City of Los Angeles
1533 Wilshire Boulevard, Suite 100
Los Angeles, California 90017

Prepared by:

Jan Marie Bailey
Project Manager

Reviewed by:

Howard B. Spielman
PE, CIH, CSP, REHS

10771 Noel St., Los Alamitos, CA 90720 714/220-3922 FAX 714/220-2081

TABLE OF CONTENTS

Page

1.0 EXECUTIVE SUMMARY 1

2.0 CLIENT & FACILITY 2

3.0 FEDERAL GUIDELINES & REGULATIONS 3

4.0 LOCAL COUNTY LBP-CODES 4

5.0 FIELD TESTING PROTOCOL 4

6.0 XRF DATA ANALYSIS 5

7.0 LBP REPORTS INTERPRETATION 6

8.0 CONCLUSIONS 8

9.0 TABLES I - V 9

APPENDICES

A - LABORATORY RESULTS
B - SAMPLE XRF TESTING FORMS

1.0 EXECUTIVE SUMMARY

1.1 Health Science Associates (HSA) was contracted to conduct modified Lead-Based Paint (LBP) testing under the direction of the Housing Authority of the City of Los Angeles (HACLA) at the Imperial Courts Housing Project located at 11541 Croesus Street, in Los Angeles California. The purpose of this project was to provide support for the on-going modernization at individual units/buildings.

1.2 LBP testing was performed using the Scitec X-Ray Fluorescent (XRF) Spectrum Analyzers by qualified technicians in accordance with HUD: 1) Lead-Based Paint: Interim Guidelines for Hazard Identification and Abatement in Public and Indian Housing, September 1990; and 2) 24 CFR 886.113.

1.3 Field data were electronically downloaded into portable computers, analyzed, QC checked, and reported with HSA's proprietary software. Five (5) standard reports are provided for each testing project. These include a statistical summary of positive, negative, and inconclusive building components for the entire project and more detailed/definitive listings.

1.4 Pursuant to HACLA's direction, HSA tested one hundred forty two (142) units at the Imperial Courts Housing Project from May 10 - June 29, 1993. Anthony Davis, Industrial Hygiene Associate, and Robin Levinson, Industrial Hygienist, were the field XRF operators. Jan Marie Bailey was the project manager.

1.5 The results of the XRF testing indicate the following:

1.5.1 General: The components tested at Imperial Courts Housing Project (applying HUD definitions) are essentially free of LBP. Table I, Statistical Analysis shows that ninety nine percent (99%) of the three thousand ninety four (3094) tests were negative. There were thirteen (13) inconclusive building components (0% by category), which tested negative more than eleven percent (11%) of the time. There were fourteen (14) positive XRF test results (0% by category), which tested negative more than eleven percent (11%) of the time.

1.5.2 Interiors: The majority of the interior building components tested negative. Paint chip samples were collected from the components with inconclusive results by the XRF and submitted for laboratory analysis.

The laboratory analysis confirmed the presence of LBP in the kitchen cabinet shelf of unit 11412.

The laboratory analysis of the paint chip samples collected from: the stairway baseboard (skirt) in units 2062, 2072, and 2077; the kitchen end

panels in units 11420, 11428, 11512, 2045, and 2049; the bannister in units 2014 and 2012; and the walls in units 2144 and 2048, confirmed the absence of LBP on these components.

1.6 The findings of this report are limited to the areas tested and the LBP conditions encountered on the day(s) of the inspection.

2.0 CLIENT & FACILITY

2.1 Client: Housing Authority of the City of Los Angeles, 313 Columbia Avenue, Los Angeles, California 90017

2.2 Property: Imperial Courts Housing Project, 11541 Croesus Street, Los Angeles, CA.

2.3 Manager: The Imperial Courts Manager is Larry Green. The manager's telephone number is (213) 249-7762.

2.4 Facility: The units tested at the Imperial Courts Housing Project were located in 2-story buildings. The construction of the project appears to be concrete block. Interior walls were painted plaster and the floors covered with sheet goods or wood. The size and distribution of the units HSA was authorized to test are as follows:

Unit Size (Bdrms)	Total Units	No. Tested
Studio (0)	0	0
One (1)	51	0
Two (2)	318	128
Three (3)	70	1
Four (4)	56	13
	---	--
Total(s)	495	142

2.5 Testing: HUD LBP Guidelines were applied to the XRF testing process, data analysis and interpretation. However, 24 CFR 886.113 limits testing to "chewable surfaces" and reduces the number of units which must be selected for random LBP testing. These regulations were applied to apartment, exterior and common area selections.

2.6 HSA Staff: Anthony Davis, Industrial Hygiene Associate
Robin Levinson, Industrial Hygienist
Jan Marie Bailey, Project Manager

2.7 Dates: May 10 - June 29, 1993

2.8 Units: Test apartments (apartment numbers) were: 2081, 2082, 2083, 2084, 2086, 2088, 2090, 2092, 2094, 2096, 2098, 2100, 2101, 2102, 2103, 2104, 2105, 2106, 2107, 2108, 2109, 2110, 2111, 2112, 2113, 2114, 2115, 2116, 2118, 2119, 2120, 2122, 2123, 2124, 2126, 2128, 2130, 2131, 2132, 2133, 2134, 2135, 2137, 2138, 2139, 2140, 2141, 2142, 2143, 2144, 2145, 2146, 2147, 2148, 2149, 2150, 2151, 2152, 2153, 2012, 2016, 2020, 2022, 2026, 2028, 2030, 2031, 2032, 2033, 2034, 2036, 2037, 2038, 2039, 2040, 2041, 2042, 2043, 2044, 2045, 2046, 2047, 2048, 2049, 2050, 2051, 2052, 2054, 2056, 2058, 2060, 2061, 2062, 2063, 2064, 2065, 2066, 2067, 2068, 2069, 2070, 2071, 2072, 2073, 2074, 2075, 2076, 2078, 2079, 2080, 11404, 11406, 11408, 11410, 11412, 11414, 11420, 11422, 11424, 11426, 11428, 11430, 11510, 11512, 11514, 11516, 11518, 11520, 11521, 11522, 11523, 11524, 11525, 11526, 11527, 11531, 11532, 11533, 11534, 11535, 11536, and 11537.

3.0 FEDERAL GUIDELINES & REGULATIONS

3.1 Many of the basic LBP testing protocols have been established by the Department of Housing and Urban Development (HUD) in the Lead-Based Paint: Interim Guidelines for Hazard Identification and Abatement in Public and Indian Housing, September 1990. The HUD Guidelines stipulate the number of randomly selected units to be tested as a function of project size (Table 4.1) and provide guidance on the surfaces to be tested in each room/area (Table 4.2).

3.2 Special HUD requirements for LBP testing are contained in 24 CFR 886.113. These define "lead-based paint", "defective paint", "chewable surfaces" and other terms which are somewhat unique to these HUD regulations. For example, LBP testing is limited to a much smaller number of apartments, exteriors and common areas than stipulated in the HUD LBP Guidelines (Section 3.1). The regulations state that "Ten units shall be tested in projects with twenty or more units, and six units shall be tested in projects with fewer than twenty units, together with a sample of common areas and exterior applicable surfaces."

3.3 The HUD definition of an LBP contaminated surface is test-dependent:

3.3.1 XRF Spectrum Analyzer - 1.0 milligrams per square centimeter (mg/cm^2)

3.3.2 Laboratory Analysis - 0.5 percent (%) by weight for paint chips

3.4 HUD guidelines for interpretation/definition of the XRF Spectrum Analyzer results in large (multi-unit) housing projects (Section 4.1.5) are, as follows:

3.4.1 Positive - Values 1.3 mg/cm^2 or greater.

3.4.2 Inconclusive - Values between (and including) 0.8 and 1.2 mg/cm^2.

3.4.3 Negative - Values less than 0.8 mg/cm^2.

4.0 LOCAL COUNTY LBP-CODES

4.1 Dr. Amy Whol, Epidemiologist, Environmental Health Administration, LA County at (213) 744-3235 on August 3, 1992 indicated that the County ordinance mandated LBP abatement if a child living in the unit is found to have an Elevated Blood Lead (EBL) level. Reportedly, the EBL level is 15 micrograms per deciliter.

4.2 Ms. Janet Comey, Lead Program, Department of Health Services was subsequently contacted at (213) 881-4116 on the same day. She indicated that the LA County Ordinance is contained in the Los Angeles County Code, Title II, Health and Safety, Chapter 11.28, Lead Hazards. A copy of the code was faxed to HSA's office and is retained on file. Basically, the Ordinance requires abatement if the child has an EBL (the Ordinance actually cites 30 micrograms per deciliter) and there are "dangerous levels of lead-bearing substances". The latter are defined as "in excess of seven-tenths (0.7) of one milligram per square centimeter, when measured by a lead-detecting instrument approved by the director..." Copies of the Ordinance are available by telephone request.

5.0 FIELD TESTING PROTOCOL

Field testing protocol is best described by referring directly to HSA's "ON-SITE LEAD-BASED PAINT (LBP) TEST, MAP (XRF) SPECTRUM ANALYZER RECORD" (Form no. MAP-01). This form was designed by HSA and it drives the testing process in the field. Key sections of the form are:

5.1 Basic Identifiers: Requires the entry of the basic identifiers such as the client, the apartment/house tested, date, tester, etc. The beginning of the legal record on the testing process.

5.2 **Spectrum Analyzer:** Records the HSA and Scitec equipment and serial numbers of the MAP system employed for testing. Also records the serial number of the sample LBP coupon supplied by the factory for instrument operating calibration checks. Factory-supplied, system-specific "K" and "L" shell results are recorded on a separate Calibration Check form.

5.3 **Calibration Checks:** Calibration checks are required by HSA at the beginning and end of each day of testing as the first of many steps in our quality control/quality assurance procedures.

The procedure involves the entry of a specific calibration identification number, which denotes the test series as a calibration check, identifies the XRF Spectrum Analyzer used, and indicates the date (month.day.year.1 for AM or .2 for PM). Five (5) separate "Tests" are run, the results are averaged, and compared to the result to the "Reference Sample Average". Failure to achieve an acceptable result (+/- 0.7 mg/cm^2) is reason to re-check the calibration and/or to stop testing.

5.4 **General Testing Procedures:** This section is one of the most critical in the entire testing protocol. It outlines the process for orientation in the unit and numbering (always clockwise) of walls, bedrooms and bathrooms. It reminds the tester to circle the appropriate testing mode and record the "K" shell results on the subsequent pages of the form.

5.5 **Data Coding Guide:** Each building component tested must be reviewed by the tester. The location, substrate and the condition of the paint classified by circling the appropriate letter on the form. Test mode must be identified by the operator to facilitate field decisions on re-testing the specific building component.

5.6 **Quality Control:** This section (LBP Inspector) is completed by the inspector after he/she has reviewed the data collected in the field and the afternoon calibration checks confirm the system's measurement precision. Signing and dating of the HSA Reviewer section occurs only after an independent review/audit of the MAP printout, and field data sheets. A final set of initials and date are entered on the field data sheets after entry and QC of the data into the computerized database has been completed.

The remainder of the form is designed to guide the field LBP tester through the testing sequence in a very prescribed manner. Each potential building component is identified in every area. The form accommodates an unlimited number of rooms or areas, per HUD definitions. Two (2) tests per building component can be made. This allows the immediate retest of a item to more demanding precision levels, as necessary.

6.0 XRF DATA ANALYSIS - Leadtrak™

6.1 HSA has developed **Leadtrak™**, a customized, highly-integrated computerized system, to handle the massive volumes of data that are generated in a LBP testing project. The keys to the system are structured data collection, automated data entry, rigid quality control/quality assurance standards and programming flexibility. The results are high quality, reliable reports which facilitate the abatement planning/decision-making process.

6.2 All the computerized LBP test reports such as the Statistical Summary by Building Component and the Lists of Positive and Negative Building Components are produced from the **Leadtrak™** database, which is created by the initial dump from the XRF Spectrum Analyzer's microprocessor memory system. The database is supplemented with field data sheet information such as the room and component codes, wall location, substrate material and paint condition. The need to electronically rehandle data, and thus introduce errors, is virtually eliminated once the database has been created for a unit or a project.

6.3 The reports for this project strictly follow the HUD Guidelines for the interpretation of data for XRF Spectrum Analyzer testing. There are five (5) **Leadtrak™** computerized reports. These are listed below and are described in the sections that follow:

* Statistical Summary by Building Component
* List of Positive Building Components
* List of Building Components Requiring Laboratory Testing
* List of Negative Building Components
* Detailed XRF Test Results

7.0 LBP REPORTS INTERPRETATION

7.1 Table I, Statistical Summary by Building Component:

This report is required by the HUD Guidelines (Section 4.1.5) and is used to interpret/extrapolate LBP test results to the entire housing project. HSA's report, however, is designed to save the client time because it provides not only the number of positive, negatives and inconclusive, but it also calculates the percentages. It is the percentage relationships that drive HUD's mandatory interpretations of the statistical summary (Section 4.1.6).

7.2 Table II, List of Positive Building Components:

7.2.1 This report follows the decision logic established for the interpretation of XRF Spectrum Analyzer results (Figure 4.2, Flowchart of Decision Rules for Multi-Unit Testing with a Spectrum Analyzer). The referenced flowchart requires that if more than eleven percent (11%) of the XRF Spectrum Analyzer results for a given "component are positive, lead is present, and either all such components should be abated, or all should be tested to determine which require abatement and which do not. If the testing option is chosen, all inconclusive results must be confirmed".

7.2.2 This table provides the list of positive building components which meet the specified percentage positive criteria. This approach expedites the decision-making process, greatly reduces the number of inconclusive which will require further laboratory testing, and facilitates the development of the LBP abatement plan.

7.2.3 Should a client wish to conduct a modified analysis of the XRF test results. For example, by selecting fifty percent (50%) as the cut-off point for positive building components, the list of positive would shorten and the list of inconclusive (laboratory re-testing candidates) would lengthen. This may be an appropriate exercise to analyze the cost alternatives of abatement versus laboratory testing. HSA is able to conduct these analyses upon request.

7.3 Table III, List of Building Components Requiring Laboratory Testing:

7.3.1 The title of this report is self-explanatory. It identifies building components, which must be re-tested by laboratory analysis, by apartment, room and XRF sample I.D. number. This information provides a straight-forward and direct summary of the location of these building components. Table III also provides a succinct analysis of the total positive, negatives, and inconclusive for each building component identified.

7.3.2 The listing is provided by HSA to assist in the identification of which building components should be selected for confirming laboratory tests. The length of this list is directly related to the percentage cut-off (11%) used to identify positive building components. Although HUD provides the "Flowchart of Decision Rules for Multi-Unit Testing with a Spectrum Analyzer" (Figure 4.2), the actual decision-making and selection is the responsibility of the client.

7.3.3 Other considerations such as existing modernization plans for the project may affect the ultimate selection of building components subject to laboratory testing. For example, the client may already have planned to remove and replace a particular building component; hence the need to re-test would be an unnecessary expense.

7.4 Table IV, List of Negative Building Components:

This is the report of negative building components. These components require no abatement and no further testing. It contains only those building components which had no Spectrum Analyzer test results greater than 1.0 mg/cm^2. The length of this list is unaffected by the percentage selection criteria used to develop the list of positive (Table II) or the list of inconclusive (Table III).

7.5 Table V, Detailed XRF Testing Results

This report contains the complete record of the XRF Spectrum Analyzer tests for each unit. It is sorted by ascending apartment/unit/address number and organized by room/area and building component. Each record identifies the background substrate, paint condition, apartment/unit number, sample and assay number, MAP reading (mg/cm^2, K-Shell values), and the test category (positive, negative or inconclusive). This report consolidates the information contained on the Field Data Sheets and the XRF Spectrum Analyzer Printout, which are retained on file by HSA and available to the client upon timely request.

8.0 CONCLUSIONS

8.1 General: The components tested at Imperial Courts Housing Project (applying HUD definitions) are essentially free of LBP. Table I, Statistical Analysis shows that ninety nine percent (99%) of the three thousand ninety four (3094) tests were negative. There were thirteen (13) inconclusive building components (0% by category), which tested negative more than eleven percent (11%) of the time. There were fourteen (14) positive XRF test results (0% by category), which tested negative more than eleven percent (11%) of the time.

8.1.1 Interiors: The majority of the interior building components tested negative. Paint chip samples were collected from the components with inconclusive results by the XRF and submitted for laboratory analysis.

The laboratory analysis confirmed the presence of LBP in the kitchen cabinet shelf of unit 11412.

The laboratory analysis of the paint chip samples collected from: the

stairway baseboard (skirt) in units 2062, 2072, and 2077; the kitchen end panels in units 11420, 11428, 11512, 2045, and 2049; the bannister in units 2014 and 2012; and the walls in units 2144 and 2048, confirmed the absence of LBP in these components.

8.2 The findings of this report are limited to the areas tested and the LBP conditions encountered on the day(s) of the inspection.

9.0

TABLES I - V

TABLE I

STATISTICAL SUMMARY

TABLE I

STATISTICAL SUMMARY BY BUILDING COMPONENT OF LBP TESTING WITH XRF SPECTRUM ANALYZER

BUILDING COMPONENT NO.	DESCRIPTION	TOTAL TESTED	* XRF TEST RESULT CATEGORIES POSITIVE NO.	POSITIVE PERCENT	NEGATIVE NO.	NEGATIVE PERCENT	INCONCLUSIVE NO.	INCONCLUSIVE PERCENT
LIVING ROOM								
4	Wall (upper)	174	0	0%	174	100%	0	0%
11	Ceiling	174	0	0%	174	100%	0	0%
15	Cab door	1	0	0%	1	100%	0	0%
19	Cab End Panel	1	0	0%	1	100%	0	0%
HALLWAY								
4	Wall (upper)	174	0	0%	174	100%	0	0%
11	Ceiling	173	0	0%	173	100%	0	0%
30	Tread	145	0	0%	145	100%	0	0%
32	Baseboard	151	12	8%	136	90%	3	2%
33	Banister rail	147	0	0%	144	98%	3	2%
KITCHEN								
4	Wall (upper)	174	0	0%	174	100%	0	0%
11	Ceiling	176	0	0%	176	100%	0	0%
15	Cab door	174	0	0%	174	100%	0	0%
18	Cab Shelf	175	0	0%	174	99%	1	1%
19	Cab End Panel	169	1	1%	163	96%	5	3%
BEDROOM #1								
4	Wall (upper)	174	0	0%	174	100%	0	0%
11	Ceiling	172	0	0%	172	100%	0	0%
BEDROOM #2								
4	Wall (upper)	172	1	1%	170	99%	1	1%
11	Ceiling	172	0	0%	172	100%	0	0%
BEDROOM #3								
4	Wall (upper)	14	0	0%	14	100%	0	0%
11	Ceiling	14	0	0%	14	100%	0	0%
BEDROOM #4								
4	Wall (upper)	13	0	0%	13	100%	0	0%
11	Ceiling	13	0	0%	13	100%	0	0%
BATHROOM #1								
0		1	0	0%	1	100%	0	0%
1	Door trim	1	0	0%	1	100%	0	0%
4	Wall (upper)	171	0	0%	171	100%	0	0%
11	Ceiling	168	0	0%	168	100%	0	0%

TABLE I

STATISTICAL SUMMARY BY BUILDING COMPONENT OF LBP TESTING WITH XRF SPECTRUM ANALYZER

BUILDING COMPONENT NO.	DESCRIPTION	TOTAL TESTED	* XRF TEST RESULT CATEGORIES POSITIVE NO.	POSITIVE PERCENT	NEGATIVE NO.	NEGATIVE PERCENT	INCONCLUSIVE NO.	INCONCLUSIVE PERCENT
Totals by Category		3094	14	0%	3067	99%	13	0%

XRF TEST RESULTS CATEGORY

POSITIVE - Values 1.3 mg/cm^2

NEGATIVE - Values Less than 0.8 mg/cm^2

INCONCLUSIVE - Values between and including 0.8 and 1.2 mg/cm^2

TABLE II

POSITIVE BUILDING COMPONENTS

TABLE II

LIST OF POSITIVE BUILDING COMPONENTS
(COMPONENTS WITH GREATER THAN ELEVEN (11%) POSITIVE RESULTS)*

NONE

*POSITIVE COMPONENTS - XRF Spectrum Analyzer Tests $\geq$ 1.3 mg/cm^2

TABLE III

LIST OF INCONCLUSIVE

TABLE III

LIST OF BUILDING COMPONENTS REQUIRING LABORATORY TESTING (COMPONENTS WITH RESULTS LESS THAN ELEVEN (11%) POSITIVES, AND NOT NEGATIVE)*

AREA	COMPONENT	APARTMENT	SAMPLE ID	ASSAY NO.	XRF VALUE	RESULTS

NONE

*Criteria - XRF Spectrum Analyzer Tests $\geq$ 1.0 mg/cm^2 and neither Positive or Negative Building Components

TABLE IV

NEGATIVE BUILDING COMPONENTS

TABLE IV

LIST OF NEGATIVE BUILDING COMPONENTS (COMPONENTS WITH 100% NEGATIVE RESULTS)*

LIVING ROOM

Wall (upper)
Ceiling
Cab door
Cab End Panel

HALLWAY

Wall (upper)
Ceiling
Tread
Banister rail

KITCHEN

Wall (upper)
Ceiling
Cab door
Cab Shelf

BEDROOM #1

Wall (upper)
Ceiling

BEDROOM #2

Ceiling

TABLE IV

LIST OF NEGATIVE BUILDING COMPONENTS (COMPONENTS WITH 100% NEGATIVE RESULTS)*

BEDROOM #3

Wall (upper)
Ceiling

BEDROOM #4

Wall (upper)
Ceiling

BATHROOM #1

unknown component
Door trim
Wall (upper)
Ceiling

* NEGATIVE COMPONENTS - ALL XRF Spectrum Analyzer Tests $\leq$ 1.0 mg/cm^2

TABLE V

DETAILED XRF TESTS

TABLE V
DETAILED XRF TESTING RESULTS

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
APT #11404							
LIVING ROOM							
	Wall (upper)	Plaster	Good	11404.053.052193	1	0.000	Negative
	Ceiling	Concrete/Block		Good 11404.053.052193	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	11404.053.052193	8	0.000	Negative
	Ceiling	Plaster	Good	11404.053.052193	9	0.000	Negative
	Tread	Wood	Good	11404.053.052193	16	0.000	Negative
	Baseboard	Wood	Good	11404.053.052193	18	0.000	Negative
	Banister rail	Wood	Good	11404.053.052193	19	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	11404.053.052193	3	0.000	Negative
	Ceiling	Concrete/Block		Good 11404.053.052193	4	0.000	Negative
	Cab door	Wood	Good	11404.053.052193	5	0.000	Negative
	Cab Shelf	Wood	Fair	11404.053.052193	6	0.000	Negative
	Cab End Panel	Wood	Fair	11404.053.052193	7	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	11404.053.052193	10	0.000	Negative
	Ceiling	Plaster	Good	11404.053.052193	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	11404.053.052193	12	0.000	Negative
	Ceiling	Plaster	Good	11404.053.052193	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	11404.053.052193	14	0.000	Negative
	Ceiling	Plaster	Good	11404.053.052193	15	0.073	Negative
APT #11406							
LIVING ROOM							
	Wall (upper)	Plaster	Good	11406.053.052193	1	0.000	Negative
	Ceiling	Concrete/Block		Good 11406.053.052193	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	11406.053.052193	9	0.000	Negative
	Ceiling	Plaster	Good	11406.053.052193	10	0.000	Negative
	Tread	Wood	Fair	11406.053.052193	17	0.000	Negative
	Baseboard	Wood	Fair	11406.053.052193	18	0.000	Negative
	Banister rail	Wood	Fair	11406.053.052193	19	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	11406.053.052193	3	0.000	Negative
	Ceiling	Concrete/Block		Good 11406.053.052193	4	0.000	Negative
	Cab door	Wood	Good	11406.053.052193	6	0.040	Negative
	Cab Shelf	Wood	Fair	11406.053.052193	7	0.201	Negative
	Cab End Panel	Wood	Fair	11406.053.052193	8	0.077	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	11406.053.052193	11	0.000	Negative
	Ceiling	Plaster	Good	11406.053.052193	12	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
BEDROOM #2							
	Wall (upper)	Plaster	Good	11406.053.052193	13	0.000	Negative
	Ceiling	Plaster	Good	11406.053.052193	14	0.120	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	11406.053.052193	15	0.000	Negative
	Ceiling	Plaster	Good	11406.053.052193	16	0.054	Negative
APT #11408							
LIVING ROOM							
	Wall (upper)	Plaster	Good	11408.053.052193	1	0.000	Negative
	Ceiling	Concrete/Block	Good	11408.053.052193	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	11408.053.052193	9	0.000	Negative
	Ceiling	Plaster	Good	11408.053.052193	10	0.000	Negative
	Tread	Wood	Fair	11408.053.052193	17	0.000	Negative
	Baseboard	Wood	Fair	11408.053.052193	18	0.000	Negative
	Banister rail	Wood	Fair	11408.053.052193	20	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	11408.053.052193	3	0.000	Negative
	Ceiling	Concrete/Block	Good	11408.053.052193	4	0.000	Negative
	Cab door	Wood	Good	11408.053.052193	5	0.000	Negative
	Cab Shelf	Wood	Fair	11408.053.052193	7	0.148	Negative
	Cab End Panel	Wood	Good	11408.053.052193	8	0.273	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	11408.053.052193	11	0.000	Negative
	Ceiling	Concrete/Block	Good	11408.053.052193	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	11408.053.052193	13	0.000	Negative
	Ceiling	Plaster	Good	11408.053.052193	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	11408.053.052193	15	0.000	Negative
	Ceiling	Plaster	Good	11408.053.052193	16	0.000	Negative
APT #11410							
LIVING ROOM							
	Wall (upper)	Plaster	Good	11410.053.052193	1	0.000	Negative
	Ceiling	Concrete/Block	Good	11410.053.052193	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	11410.053.052193	8	0.000	Negative
	Ceiling	Plaster	Good	11410.053.052193	9	0.000	Negative
	Tread	Wood	Fair	11410.053.052193	16	0.000	Negative
	Baseboard	Wood	Fair	11410.053.052193	17	0.059	Negative
	Banister rail	Wood	Fair	11410.053.052193	18	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	11410.053.052193	3	0.000	Negative
	Ceiling	Concrete/Block	Good	11410.053.052193	4	0.000	Negative
	Cab door	Wood	Good	11410.053.052193	5	0.000	Negative
	Cab Shelf	Wood	Good	11410.053.052193	6	0.040	Negative
	Cab End Panel	Wood	Good	11410.053.052193	7	0.211	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
BEDROOM #1							
	Wall (upper)	Plaster	Good	11410.053.052193	10	0.000	Negative
	Ceiling	Plaster	Good	11410.053.052193	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	11410.053.052193	12	0.000	Negative
	Ceiling	Plaster	Good	11410.053.052193	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	11410.053.052193	14	0.000	Negative
	Ceiling	Plaster	Good	11410.053.052193	15	0.000	Negative
APT #11412							
LIVING ROOM							
	Wall (upper)	Plaster	Good	11412.053.052193	1	0.000	Negative
	Ceiling	Concrete/Block		Good 11412.053.052193	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	11412.053.052193	9	0.000	Negative
	Ceiling	Plaster	Good	11412.053.052193	10	0.000	Negative
	Tread	Wood	Good	11412.053.052193	17	0.000	Negative
	Baseboard	Wood	Good	11412.053.052193	18	0.289	Negative
	Banister rail	Wood	Good	11412.053.052193	19	0.000	Negative
KITCHEN							
	Cab End Panel	Wood	Good	11412.053.052193	8	0.405	Negative
	Wall (upper)	Plaster	Good	11412.053.052193	3	0.312	Negative
	Ceiling	Concrete/Block		Good 11412.053.052193	4	0.000	Negative
	Cab door	Wood	Good	11412.053.052193	5	0.000	Negative
	Cab Shelf	Wood	Good	11412.053.052193	7	0.808	Inconclusive
	Wall (upper)	Wood	Good	11412.023.062593	1	0.000	Negative
	Ceiling	Wood	Good	11412.023.062593	3	0.100	Negative
	Cab door	Wood	Good	11412.023.062593	4	0.000	Negative
	Cab Shelf	Wood	Good	11412.023.062593	5	0.000	Negative
	Wall (upper)	Wood	Good	11412.023.062593	6	0.000	Negative
	Ceiling	Wood	Good	11412.023.062593	7	0.000	Negative
	Cab door	Wood	Good	11412.023.062593	8	0.200	Negative
	Cab Shelf	Wood	Poor	11412.023.062593	10	0.700	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	11412.053.052193	11	0.000	Negative
	Ceiling	Plaster	Good	11412.053.052193	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	11412.053.052193	13	0.072	Negative
	Ceiling	Plaster	Good	11412.053.052193	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	11412.053.052193	15	0.000	Negative
	Ceiling	Plaster	Good	11412.053.052193	16	0.000	Negative
APT #11414							
LIVING ROOM							
	Wall (upper)	Plaster	Good	11414.053.052193	1	0.000	Negative
	Ceiling	Concrete/Block		Good 11414.053.052193	2	0.021	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
HALLWAY							
	Wall (upper)	Plaster	Good	11414.053.052193	8	0.000	Negative
	Ceiling	Concrete/Block		Good 11414.053.052193	9	0.000	Negative
	Baseboard	Wood	Good	11414.053.052193	17	0.153	Negative
	Banister rail	Wood	Good	11414.053.052193	18	0.440	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	11414.053.052193	3	0.000	Negative
	Ceiling	Concrete/Block		Good 11414.053.052193	4	0.000	Negative
	Cab door	Wood	Good	11414.053.052193	5	0.122	Negative
	Cab Shelf	Wood	Good	11414.053.052193	6	0.000	Negative
	Cab End Panel	Wood	Good	11414.053.052193	7	0.502	Negative
	Ceiling	Plaster	Good	11414.053.052193	16	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	11414.053.052193	11	0.000	Negative
	Ceiling	Plaster	Good	11414.053.052193	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	11414.053.052193	13	0.000	Negative
	Ceiling	Plaster	Good	11414.053.052193	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	11414.053.052193	15	0.000	Negative
APT #11420							
LIVING ROOM							
	Wall (upper)	Plaster	Good	11420.053.052093	1	0.000	Negative
	Ceiling	Concrete/Block		Good 11420.053.052093	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	11420.053.052093	8	0.000	Negative
	Ceiling	Concrete/Block		Good 11420.053.052093	9	0.000	Negative
	Tread	Wood	Good	11420.053.052093	16	0.000	Negative
	Baseboard	Wood	Fair	11420.053.052093	17	0.000	Negative
	Banister rail	Wood	Fair	11420.053.052093	18	0.000	Negative
KITCHEN							
	Cab End Panel	Wood	Fair	11420.053.052093	7	0.812	Inconclusive
	Wall (upper)	Wood	Good	11420.053.052093	3	0.000	Negative
	Ceiling	Concrete/Block		Good 11420.053.052093	4	0.000	Negative
	Cab door	Wood	Good	11420.053.052093	5	0.128	Negative
	Cab Shelf	Wood	Good	11420.053.052093	6	0.008	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	11420.053.052093	10	0.000	Negative
	Ceiling	Plaster	Good	11420.053.052093	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	11420.053.052093	12	0.000	Negative
	Ceiling	Plaster	Good	11420.053.052093	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	11420.053.052093	14	0.000	Negative
	Ceiling	Plaster	Good	11420.053.052093	15	0.000	Negative
APT #11422							
LIVING ROOM							
	Wall (upper)	Plaster	Good	11422.053.052093	1	0.000	Negative
	Ceiling	Concrete/Block		Good 11422.053.052093	2	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
HALLWAY							
	Wall (upper)	Plaster	Good	11422.053.052093	8	0.000	Negative
	Ceiling	Plaster	Good	11422.053.052093	9	0.000	Negative
	Tread	Wood	Fair	11422.053.052093	17	0.000	Negative
	Baseboard	Wood	Fair	11422.053.052093	18	0.486	Negative
	Banister rail	Wood	Fair	11422.053.052093	19	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Fair	11422.053.052093	3	0.000	Negative
	Ceiling	Concrete/Block		Good 11422.053.052093	4	0.000	Negative
	Cab door	Wood	Fair	11422.053.052093	5	0.011	Negative
	Cab Shelf	Wood	Fair	11422.053.052093	6	0.264	Negative
	Cab End Panel	Wood	Fair	11422.053.052093	7	0.674	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	11422.053.052093	10	0.000	Negative
	Ceiling	Plaster	Good	11422.053.052093	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	11422.053.052093	12	0.000	Negative
	Ceiling	Plaster	Good	11422.053.052093	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	11422.053.052093	14	0.000	Negative
	Ceiling	Plaster	Good	11422.053.052093	16	0.000	Negative
APT #11424							
LIVING ROOM							
	Wall (upper)	Plaster	Good	11424.053.05209	1	0.000	Negative
	Ceiling	Concrete/Block		Good 11424.053.05209	2	0.000	Negative
HALLWAY							
	Wall (upper)	Wood	Good	11424.053.05209	7	0.000	Negative
	Ceiling	Concrete/Block		Good 11424.053.05209	9	0.000	Negative
	Tread	Wood	Good	11424.053.05209	16	0.000	Negative
	Baseboard	Wood	Good	11424.053.05209	17	0.305	Negative
	Banister rail	Wood	Good	11424.053.05209	18	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	11424.053.05209	3	0.000	Negative
	Ceiling	Concrete/Block		Good 11424.053.05209	4	0.000	Negative
	Cab Shelf	Wood	Good	11424.053.05209	5	0.192	Negative
	Cab End Panel	Wood	Good	11424.053.05209	6	0.835	Inconclusive
	Cab door	Wood	Good	11424.053.05209	8	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Fair	11424.053.05209	10	0.091	Negative
	Ceiling	Plaster	Good	11424.053.05209	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	11424.053.05209	12	0.000	Negative
	Ceiling	Plaster	Good	11424.053.05209	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	11424.053.05209	14	0.000	Negative
	Ceiling	Plaster	Good	11424.053.05209	15	0.000	Negative
APT #11426							
LIVING ROOM							
	Wall (upper)	Plaster	Fair	11426.053.052093	1	0.000	Negative
	Ceiling	Concrete/Block		Fair 11426.053.052093	2	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
HALLWAY							
	Wall (upper)	Plaster	Good	11426.053.052093	8	0.000	Negative
	Ceiling	Concrete/Block		Good 11426.053.052093	9	0.000	Negative
	Tread	Wood	Fair	11426.053.052093	16	0.000	Negative
	Baseboard	Wood	Fair	11426.053.052093	17	0.304	Negative
	Banister rail	Wood	Fair	11426.053.052093	18	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	11426.053.052093	3	0.000	Negative
	Ceiling	Concrete/Block		Good 11426.053.052093	4	0.000	Negative
	Cab door	Wood	Fair	11426.053.052093	5	0.000	Negative
	Cab Shelf	Wood	Fair	11426.053.052093	6	0.226	Negative
	Cab End Panel	Wood	Fair	11426.053.052093	7	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Fair	11426.053.052093	10	0.000	Negative
	Ceiling	Plaster	Fair	11426.053.052093	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Fair	11426.053.052093	12	0.000	Negative
	Ceiling	Plaster	Fair	11426.053.052093	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	11426.053.052093	14	0.000	Negative
	Ceiling	Plaster	Good	11426.053.052093	15	0.053	Negative
APT #11428							
LIVING ROOM							
	Wall (upper)	Plaster	Good	11428.053.052093	1	0.000	Negative
	Ceiling	Concrete/Block		Good 11428.053.052093	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Fair	11428.053.052093	8	0.000	Negative
	Ceiling	Concrete/Block		Fair 11428.053.052093	9	0.000	Negative
	Tread	Wood	Good	11428.053.052093	16	0.000	Negative
	Baseboard	Wood	Good	11428.053.052093	17	0.173	Negative
	Banister rail	Wood	Good	11428.053.052093	18	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	11428.053.052093	3	0.000	Negative
	Ceiling	Concrete/Block		Good 11428.053.052093	4	0.000	Negative
	Cab door	Wood	Fair	11428.053.052093	5	0.129	Negative
	Cab Shelf	Wood	Fair	11428.053.052093	6	0.233	Negative
	Cab End Panel	Wood	Fair	11428.053.052093	7	0.816	Inconclusive
BEDROOM #1							
	Wall (upper)	Plaster	Fair	11428.053.052093	10	0.000	Negative
	Ceiling	Plaster	Fair	11428.053.052093	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	11428.053.052093	12	0.000	Negative
	Ceiling	Plaster	Good	11428.053.052093	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	11428.053.052093	14	0.000	Negative
	Ceiling	Plaster	Good	11428.053.052093	15	0.000	Negative
APT #11430							
LIVING ROOM							
	Wall (upper)	Plaster	Good	11430.053.052093	1	0.000	Negative
	Ceiling	Concrete/Block		Good 11430.053.052093	2	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
HALLWAY							
	Wall (upper)	Plaster	Good	11430.053.052093	8	0.000	Negative
	Ceiling	Concrete/Block		Good 11430.053.052093	9	0.000	Negative
	Baseboard	Wood	Fair	11430.053.052093	16	0.503	Negative
	Banister rail	Wood	Good	11430.053.052093	17	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	11430.053.052093	3	0.000	Negative
	Ceiling	Concrete/Block		Good 11430.053.052093	4	0.000	Negative
	Cab door	Wood	Good	11430.053.052093	5	0.159	Negative
	Cab Shelf	Wood	Good	11430.053.052093	6	0.113	Negative
	Cab End Panel	Wood	Good	11430.053.052093	7	0.322	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	11430.053.052093	10	0.000	Negative
	Ceiling	Plaster	Good	11430.053.052093	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	11430.053.052093	12	0.000	Negative
	Ceiling	Plaster	Good	11430.053.052093	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	11430.053.052093	14	0.000	Negative
	Ceiling	Plaster	Good	11430.053.052093	15	0.000	Negative
APT #11510							
LIVING ROOM							
	Wall (upper)		Good	11510.053.051993	1	0.000	Negative
	Ceiling	Concrete/Block		Good 11510.053.051993	2	0.270	Negative
HALLWAY							
	Wall (upper)		Good	11510.053.051993	8	0.000	Negative
	Ceiling	Drywall	Good	11510.053.051993	9	0.000	Negative
	Tread	Wood	Fair	11510.053.051993	16	0.000	Negative
	Baseboard	Wood	Fair	11510.053.051993	17	0.433	Negative
	Banister rail	Wood	Fair	11510.053.051993	18	0.000	Negative
KITCHEN							
	Wall (upper)		Good	11510.053.051993	3	0.082	Negative
	Ceiling	Concrete/Block		Good 11510.053.051993	4	0.000	Negative
	Cab door	Wood	Good	11510.053.051993	5	0.334	Negative
	Cab Shelf	Wood	Fair	11510.053.051993	6	0.265	Negative
	Cab End Panel	Wood	Fair	11510.053.051993	7	0.185	Negative
BEDROOM #1							
	Wall (upper)		Good	11510.053.051993	10	0.000	Negative
	Ceiling		Good	11510.053.051993	11	0.000	Negative
BEDROOM #2							
	Wall (upper)		Good	11510.053.051993	12	0.000	Negative
	Ceiling		Good	11510.053.051993	13	0.000	Negative
BATHROOM #1							
	Wall (upper)		Good	11510.053.051993	14	0.000	Negative
	Ceiling		Good	11510.053.051993	15	0.000	Negative
APT #11512							
LIVING ROOM							
	Wall (upper)		Good	11512.053.051993	1	0.000	Negative
	Ceiling	Concrete/Block		Good 11512.053.051993	2	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
HALLWAY							
	Wall (upper)		Good	11512.053.051993	8	0.000	Negative
	Ceiling		Good	11512.053.051993	9	0.000	Negative
	Baseboard	Wood	Fair	11512.053.051993	18	0.229	Negative
	Banister rail	Wood	Fair	11512.053.051993	19	0.000	Negative
KITCHEN							
	Cab End Panel	Wood	Fair	11512.053.051993	7	0.803	Inconclusive
	Wall (upper)		Good	11512.053.051993	3	0.000	Negative
	Ceiling	Concrete/Block		Good 11512.053.051993	4	0.000	Negative
	Cab door	Wood	Good	11512.053.051993	5	0.124	Negative
	Cab Shelf	Wood	Fair	11512.053.051993	6	0.097	Negative
BEDROOM #1							
	Wall (upper)		Good	11512.053.051993	10	0.000	Negative
	Ceiling		Good	11512.053.051993	12	0.000	Negative
BEDROOM #2							
	Wall (upper)		Good	11512.053.051993	13	0.000	Negative
	Ceiling		Good	11512.053.051993	14	0.000	Negative
BATHROOM #1							
	Wall (upper)		Good	11512.053.051993	16	0.000	Negative
	Ceiling		Good	11512.053.051993	17	0.000	Negative
APT #11514							
LIVING ROOM							
	Wall (upper)	Plaster	Good	11514.053.051993	1	0.000	Negative
	Ceiling	Concrete/Block		Good 11514.053.051993	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	11514.053.051993	8	0.000	Negative
	Ceiling	Plaster	Good	11514.053.051993	9	0.000	Negative
	Tread	Wood	Fair	11514.053.051993	16	0.000	Negative
	Baseboard	Wood	Fair	11514.053.051993	17	0.152	Negative
	Banister rail	Wood	Fair	11514.053.051993	18	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	11514.053.051993	3	0.000	Negative
	Ceiling	Concrete/Block		Good 11514.053.051993	4	0.000	Negative
	Cab door	Wood	Good	11514.053.051993	5	0.000	Negative
	Cab Shelf	Wood	Fair	11514.053.051993	6	0.008	Negative
	Cab End Panel	Wood	Fair	11514.053.051993	7	0.253	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	11514.053.051993	10	0.000	Negative
	Ceiling	Plaster	Good	11514.053.051993	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	11514.053.051993	12	0.000	Negative
	Ceiling	Plaster	Good	11514.053.051993	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Fair	11514.053.051993	14	0.000	Negative
	Ceiling	Plaster	Good	11514.053.051993	15	0.000	Negative
APT #11516							
LIVING ROOM							
	Wall (upper)	Plaster	Good	11516.053.051993	1	0.000	Negative
	Ceiling	Concrete/Block		Good 11516.053.051993	2	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
HALLWAY							
	Wall (upper)	Plaster	Good	11516.053.051993	8	0.000	Negative
	Ceiling	Plaster	Good	11516.053.051993	9	0.000	Negative
	Tread	Wood	Good	11516.053.051993	16	0.000	Negative
	Baseboard	Wood	Fair	11516.053.051993	17	0.000	Negative
	Banister rail	Wood	Fair	11516.053.051993	18	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	11516.053.051993	3	0.000	Negative
	Ceiling	Concrete/Block	Good	11516.053.051993	4	0.000	Negative
	Cab door	Wood	Good	11516.053.051993	5	0.073	Negative
	Cab Shelf	Wood	Fair	11516.053.051993	6	0.000	Negative
	Cab End Panel	Wood	Fair	11516.053.051993	7	0.283	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	11516.053.051993	10	0.000	Negative
	Ceiling	Plaster	Good	11516.053.051993	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	11516.053.051993	12	0.000	Negative
	Ceiling	Plaster	Good	11516.053.051993	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	11516.053.051993	14	0.000	Negative
	Ceiling	Plaster	Good	11516.053.051993	15	0.000	Negative
APT #11518							
LIVING ROOM							
	Wall (upper)	Plaster	Good	11518.053.051993	1	0.000	Negative
	Ceiling	Concrete/Block	Good	11518.053.051993	2	0.013	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	11518.053.051993	8	0.000	Negative
	Ceiling	Drywall	Good	11518.053.051993	9	0.000	Negative
	Tread	Wood	Fair	11518.053.051993	16	0.000	Negative
	Baseboard	Wood	Fair	11518.053.051993	17	0.252	Negative
	Banister rail	Wood	Fair	11518.053.051993	18	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	11518.053.051993	3	0.000	Negative
	Ceiling	Concrete/Block	Good	11518.053.051993	4	0.000	Negative
	Cab door	Wood	Good	11518.053.051993	5	0.438	Negative
	Cab Shelf	Wood	Fair	11518.053.051993	6	0.000	Negative
	Cab End Panel	Wood	Fair	11518.053.051993	7	0.318	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	11518.053.051993	10	0.000	Negative
	Ceiling	Plaster	Good	11518.053.051993	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	11518.053.051993	12	0.000	Negative
	Ceiling	Plaster	Good	11518.053.051993	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	11518.053.051993	14	0.000	Negative
	Ceiling	Plaster	Good	11518.053.051993	15	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
APT #11520							
LIVING ROOM							
	Wall (upper)	Plaster	Good	11520.053.051993	1	0.000	Negative
	Ceiling	Concrete/Block	Good	11520.053.051993	2	0.184	Negative
	Wall (upper)	Plaster	Good	11520.023.062493	1	0.000	Negative
	Ceiling	Concrete/Block	Good	11520.023.062493	3	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	11520.053.051993	8	0.000	Negative
	Ceiling	Concrete/Block	Good	11520.053.051993	9	0.000	Negative
	Tread	Wood	Good	11520.053.051993	16	0.000	Negative
	Baseboard	Wood	Good	11520.053.051993	17	0.505	Negative
	Banister rail	Wood	Good	11520.053.051993	18	0.000	Negative
	Wall (upper)	Plaster	Good	11520.023.062493	10	0.000	Negative
	Ceiling	Plaster	Good	11520.023.062493	11	0.000	Negative
	Tread	Wood	Fair	11520.023.062493	22	0.000	Negative
	Baseboard	Wood	Good	11520.023.062493	23	0.100	Negative
	Banister rail	Wood	Good	11520.023.062493	24	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	11520.053.051993	3	0.000	Negative
	Ceiling	Concrete/Block	Good	11520.053.051993	4	0.000	Negative
	Cab door	Wood	Good	11520.053.051993	5	0.262	Negative
	Cab Shelf	Wood	Good	11520.053.051993	6	0.509	Negative
	Cab End Panel	Wood	Good	11520.053.051993	7	0.175	Negative
	Ceiling	Plaster	Good	11520.053.051993	15	0.000	Negative
	Wall (upper)	Plaster	Good	11520.023.062493	4	0.000	Negative
	Ceiling	Concrete/Block	Good	11520.023.062493	5	0.000	Negative
	Cab door	Wood	Good	11520.023.062493	6	0.000	Negative
	Cab Shelf	Wood	Fair	11520.023.062493	7	0.000	Negative
	Cab End Panel	Wood	Good	11520.023.062493	9	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	11520.053.051993	10	0.245	Negative
	Ceiling	Plaster	Good	11520.053.051993	11	0.087	Negative
	Wall (upper)	Plaster	Good	11520.023.062493	12	0.000	Negative
	Ceiling	Concrete/Block	Good	11520.023.062493	13	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	11520.053.051993	12	0.000	Negative
	Ceiling	Plaster	Good	11520.053.051993	13	0.000	Negative
	Wall (upper)	Plaster	Poor	11520.023.062493	14	0.000	Negative
	Ceiling	Plaster	Good	11520.023.062493	15	0.000	Negative
BEDROOM #3							
	Wall (upper)	Plaster	Good	11520.023.062493	16	0.000	Negative
	Ceiling	Plaster	Good	11520.023.062493	17	0.000	Negative
BEDROOM #4							
	Wall (upper)	Plaster	Good	11520.023.062493	18	0.000	Negative
	Ceiling	Plaster	Good	11520.023.062493	19	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	11520.053.051993	14	0.000	Negative
	Wall (upper)	Plaster	Good	11520.023.062493	20	0.000	Negative
	Ceiling	Plaster	Good	11520.023.062493	21	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
APT #11521							
LIVING ROOM							
	Wall (upper)	Plaster	Good	11521.023.062893	1	0.000	Negative
	Ceiling	Concrete/Block		Good 11521.023.062893	2	0.200	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	11521.023.062893	8	0.000	Negative
	Ceiling	Plaster	Good	11521.023.062893	9	0.000	Negative
	Tread	Wood	Fair	11521.023.062893	16	0.000	Negative
	Baseboard	Wood	Fair	11521.023.062893	18	0.300	Negative
	Banister rail	Wood	Good	11521.023.062893	19	1.000	Inconclusive
KITCHEN							
	Wall (upper)	Plaster	Good	11521.023.062893	3	0.000	Negative
	Ceiling	Concrete/Block		Good 11521.023.062893	4	0.000	Negative
	Cab door	Wood	Good	11521.023.062893	5	0.000	Negative
	Cab Shelf	Wood	Fair	11521.023.062893	6	0.100	Negative
	Cab End Panel	Wood	Good	11521.023.062893	7	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	11521.023.062893	10	0.000	Negative
	Ceiling	Plaster	Good	11521.023.062893	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	11521.023.062893	12	0.000	Negative
	Ceiling	Plaster	Good	11521.023.062893	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	11521.023.062893	14	0.000	Negative
	Ceiling	Plaster	Good	11521.023.062893	15	0.000	Negative
APT #11522							
LIVING ROOM							
	Wall (upper)	Plaster	Good	11522.023.062593	1	0.000	Negative
	Ceiling	Concrete/Block		Good 11522.023.062593	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	11522.023.062593	8	0.000	Negative
	Ceiling	Plaster	Good	11522.023.062593	9	0.000	Negative
	Tread	Wood	Good	11522.023.062593	21	0.000	Negative
	Baseboard	Wood	Good	11522.023.062593	23	0.400	Negative
	Banister rail	Wood	Good	11522.023.062593	24	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	11522.023.062593	3	0.000	Negative
	Ceiling	Concrete/Block		Good 11522.023.062593	4	0.000	Negative
	Cab door	Wood	Good	11522.023.062593	5	0.000	Negative
	Cab Shelf	Wood	Good	11522.023.062593	6	0.000	Negative
	Cab End Panel	Wood	Good	11522.023.062593	7	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	11522.023.062593	11	0.000	Negative
	Ceiling	Plaster	Good	11522.023.062593	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	11522.023.062593	13	0.200	Negative
	Ceiling	Plaster	Good	11522.023.062593	14	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
BEDROOM #3							
	Wall (upper)	Plaster	Good	11522.023.062593	15	0.000	Negative
	Ceiling	Plaster	Good	11522.023.062593	16	0.000	Negative
BEDROOM #4							
	Wall (upper)	Plaster	Good	11522.023.062593	17	0.000	Negative
	Ceiling	Plaster	Good	11522.023.062593	18	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	11522.023.062593	19	0.000	Negative
	Ceiling	Plaster	Good	11522.023.062593	20	0.000	Negative
APT #11523							
LIVING ROOM							
	Wall (upper)	Plaster	Good	11523.023.062893	1	0.000	Negative
	Ceiling	Concrete/Block		Good 11523.023.062893	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	11523.023.062893	9	0.000	Negative
	Ceiling	Plaster	Good	11523.023.062893	10	0.000	Negative
	Tread	Wood	Fair	11523.023.062893	21	0.000	Negative
	Baseboard	Wood	Good	11523.023.062893	23	0.100	Negative
	Banister rail	Wood	Fair	11523.023.062893	24	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	11523.023.062893	3	0.100	Negative
	Ceiling	Concrete/Block		Good 11523.023.062893	4	0.000	Negative
	Cab door	Wood	Good	11523.023.062893	6	0.000	Negative
	Cab Shelf	Wood	Fair	11523.023.062893	7	0.000	Negative
	Cab End Panel	Wood	Good	11523.023.062893	8	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	11523.023.062893	11	0.000	Negative
	Ceiling	Plaster	Good	11523.023.062893	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	11523.023.062893	13	0.000	Negative
	Ceiling	Plaster	Good	11523.023.062893	14	0.000	Negative
BEDROOM #3							
	Wall (upper)	Plaster	Good	11523.023.062893	15	0.000	Negative
	Ceiling	Plaster	Good	11523.023.062893	16	0.000	Negative
BEDROOM #4							
	Wall (upper)	Plaster	Poor	11523.023.062893	17	0.000	Negative
	Ceiling	Plaster	Good	11523.023.062893	18	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	11523.023.062893	19	0.000	Negative
	Ceiling	Plaster	Good	11523.023.062893	20	0.000	Negative
APT #11524							
LIVING ROOM							
	Wall (upper)	Plaster	Good	11524.023.062593	1	0.000	Negative
	Ceiling	Concrete/Block		Good 11524.023.062593	2	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
HALLWAY							
	Wall (upper)	Plaster	Poor	11524.023.062593	8	0.000	Negative
	Ceiling	Plaster	Good	11524.023.062593	9	0.000	Negative
	Tread	Wood	Fair	11524.023.062593	20	0.000	Negative
	Baseboard	Wood	Fair	11524.023.062593	22	0.100	Negative
	Banister rail	Wood	Good	11524.023.062593	23	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	11524.023.062593	3	0.000	Negative
	Ceiling	Concrete/Block	Good	11524.023.062593	4	0.000	Negative
	Cab door	Wood	Good	11524.023.062593	5	0.000	Negative
	Cab Shelf	Wood	Fair	11524.023.062593	6	0.000	Negative
	Cab End Panel	Wood	Fair	11524.023.062593	7	0.100	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	11524.023.062593	10	0.000	Negative
	Ceiling	Plaster	Good	11524.023.062593	11	0.100	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Fair	11524.023.062593	12	0.000	Negative
	Ceiling	Plaster	Good	11524.023.062593	13	0.000	Negative
BEDROOM #3							
	Wall (upper)	Plaster	Fair	11524.023.062593	14	0.000	Negative
	Ceiling	Plaster	Good	11524.023.062593	15	0.000	Negative
BEDROOM #4							
	Wall (upper)	Plaster	Good	11524.023.062593	16	0.000	Negative
	Ceiling	Plaster	Good	11524.023.062593	17	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Fair	11524.023.062593	18	0.000	Negative
	Ceiling	Plaster	Good	11524.023.062593	19	0.000	Negative
APT #11525							
LIVING ROOM							
	Wall (upper)	Plaster	Good	11525.023.062893	1	0.000	Negative
	Ceiling	Concrete/Block	Good	11525.023.062893	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	11525.023.062893	8	0.000	Negative
	Ceiling	Plaster	Good	11525.023.062893	9	0.000	Negative
	Tread	Wood	Fair	11525.023.062893	20	0.000	Negative
	Baseboard	Wood	Good	11525.023.062893	22	0.500	Negative
	Banister rail	Wood	Fair	11525.023.062893	23	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	11525.023.062893	3	0.000	Negative
	Ceiling	Concrete/Block	Good	11525.023.062893	4	0.000	Negative
	Cab door	Wood	Good	11525.023.062893	5	0.000	Negative
	Cab Shelf	Wood	Good	11525.023.062893	6	0.100	Negative
	Cab End Panel	Wood	Good	11525.023.062893	7	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
BEDROOM #1							
	Wall (upper)	Plaster	Good	11525.023.062893	10	0.000	Negative
	Ceiling	Concrete/Block	Good	11525.023.062893	11	0.100	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	11525.023.062893	12	0.000	Negative
	Ceiling	Plaster	Good	11525.023.062893	13	0.100	Negative
BEDROOM #3							
	Wall (upper)	Plaster	Good	11525.023.062893	14	0.000	Negative
	Ceiling	Plaster	Good	11525.023.062893	15	0.000	Negative
BEDROOM #4							
	Wall (upper)	Plaster	Good	11525.023.062893	16	0.000	Negative
	Ceiling	Plaster	Good	11525.023.062893	17	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	11525.023.062893	18	0.000	Negative
	Ceiling	Plaster	Good	11525.023.062893	19	0.000	Negative
APT #11526							
LIVING ROOM							
	Wall (upper)	Plaster	Good	11526.023.062593	1	0.000	Negative
	Ceiling	Concrete/Block	Good	11526.023.062593	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	11526.023.062593	8	0.000	Negative
	Ceiling	Plaster	Good	11526.023.062593	9	0.000	Negative
	Tread	Wood	Good	11526.023.062593	20	0.000	Negative
	Baseboard	Wood	Good	11526.023.062593	21	0.200	Negative
	Banister rail	Wood	Good	11526.023.062593	22	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	11526.023.062593	3	0.000	Negative
	Ceiling	Concrete/Block	Good	11526.023.062593	4	0.000	Negative
	Cab door	Wood	Good	11526.023.062593	5	0.000	Negative
	Cab Shelf	Wood	Good	11526.023.062593	6	0.000	Negative
	Cab End Panel	Wood	Good	11526.023.062593	7	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	11526.023.062593	10	0.000	Negative
	Ceiling	Plaster	Good	11526.023.062593	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	11526.023.062593	12	0.000	Negative
	Ceiling	Plaster	Good	11526.023.062593	13	0.200	Negative
BEDROOM #3							
	Wall (upper)	Plaster	Good	11526.023.062593	14	0.100	Negative
	Ceiling	Plaster	Good	11526.023.062593	15	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
BEDROOM #4							
	Wall (upper)	Plaster	Good	11526.023.062593	16	0.000	Negative
	Ceiling	Plaster	Good	11526.023.062593	17	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	11526.023.062593	18	0.000	Negative
	Ceiling	Plaster	Good	11526.023.062593	19	0.000	Negative
APT #11527							
LIVING ROOM							
	Wall (upper)	Plaster	Good	11527.023.062593	1	0.000	Negative
	Ceiling	Concrete/Block	Good	11527.023.062593	2	0.100	Negative
HALLWAY							
	Wall (upper)	Plaster	Fair	11527.023.062593	8	0.000	Negative
	Ceiling	Plaster	Good	11527.023.062593	9	0.000	Negative
	Baseboard	Wood	Good	11527.023.062593	19	0.200	Negative
	Banister rail	Wood	Good	11527.023.062593	20	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	11527.023.062593	3	0.000	Negative
	Ceiling	Concrete/Block	Good	11527.023.062593	4	0.300	Negative
	Cab door	Wood	Good	11527.023.062593	5	0.000	Negative
	Cab Shelf	Wood	Good	11527.023.062593	6	0.200	Negative
	Cab End Panel	Wood	Good	11527.023.062593	7	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	11527.023.062593	10	0.000	Negative
	Ceiling	Plaster	Good	11527.023.062593	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Fair	11527.023.062593	12	0.000	Negative
	Ceiling	Plaster	Good	11527.023.062593	13	0.000	Negative
BEDROOM #3							
	Wall (upper)	Plaster	Fair	11527.023.062593	14	0.000	Negative
	Ceiling	Plaster	Good	11527.023.062593	15	0.000	Negative
BEDROOM #4							
	Wall (upper)	Plaster	Good	11527.023.062593	16	0.000	Negative
	Ceiling	Plaster	Good	11527.023.062593	17	0.000	Negative
APT #11531							
LIVING ROOM							
	Wall (upper)	Plaster	Good	11531.023.062993	1	0.000	Negative
	Ceiling	Concrete/Block	Good	11531.023.062993	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	11531.023.062993	8	0.000	Negative
	Ceiling	Concrete/Block	Good	11531.023.062993	9	0.000	Negative
	Tread	Wood	Fair	11531.023.062993	20	0.000	Negative
	Baseboard	Wood	Good	11531.023.062993	22	0.200	Negative
	Banister rail	Wood	Good	11531.023.062993	23	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
KITCHEN							
	Ceiling	Concrete/Block		Good 11531.023.062993	4	0.000	Negative
	Wall (upper)	Plaster	Good	11531.023.062993	3	0.000	Negative
	Cab door	Wood	Good	11531.023.062993	5	0.200	Negative
	Cab Shelf	Wood	Fair	11531.023.062993	6	0.000	Negative
	Cab End Panel	Wood	Good	11531.023.062993	7	0.200	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	11531.023.062993	10	0.000	Negative
	Ceiling	Plaster	Good	11531.023.062993	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	11531.023.062993	12	0.000	Negative
	Ceiling	Plaster	Good	11531.023.062993	13	0.000	Negative
BEDROOM #3							
	Wall (upper)	Plaster	Good	11531.023.062993	14	0.000	Negative
	Ceiling	Plaster	Good	11531.023.062993	15	0.000	Negative
BEDROOM #4							
	Wall (upper)	Plaster	Good	11531.023.062993	16	0.000	Negative
	Ceiling	Plaster	Good	11531.023.062993	17	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	11531.023.062993	18	0.000	Negative
	Ceiling	Plaster	Good	11531.023.062993	19	0.100	Negative
APT #11532							
LIVING ROOM							
	Wall (upper)	Plaster	Good	11532.023.062993	1	0.000	Negative
	Ceiling	Concrete/Block		Good 11532.023.062993	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Poor	11532.023.062993	9	0.000	Negative
	Ceiling	Plaster	Good	11532.023.062993	10	0.000	Negative
	Tread	Wood	Fair	11532.023.062993	21	0.000	Negative
	Baseboard	Wood	Fair	11532.023.062993	23	0.100	Negative
	Banister rail	Wood	Fair	11532.023.062993	24	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	11532.023.062993	3	0.000	Negative
	Ceiling	Concrete/Block		Good 11532.023.062993	4	0.000	Negative
	Cab door	Plaster	Poor	11532.023.062993	6	0.000	Negative
	Cab Shelf	Wood	Fair	11532.023.062993	7	0.000	Negative
	Cab End Panel	Wood	Good	11532.023.062993	8	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	11532.023.062993	11	0.000	Negative
	Ceiling	Plaster	Good	11532.023.062993	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	11532.023.062993	13	0.000	Negative
	Ceiling	Plaster	Good	11532.023.062993	14	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
BEDROOM #3							
	Wall (upper)	Plaster	Poor	11532.023.062993	15	0.000	Negative
	Ceiling	Plaster	Good	11532.023.062993	16	0.000	Negative
BEDROOM #4							
	Wall (upper)	Plaster	Good	11532.023.062993	17	0.000	Negative
	Ceiling	Plaster	Good	11532.023.062993	18	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	11532.023.062993	19	0.000	Negative
	Ceiling	Plaster	Good	11532.023.062993	20	0.000	Negative
APT #11533							
LIVING ROOM							
	Wall (upper)	Plaster	Good	11533.023.062993	1	0.000	Negative
	Ceiling	Concrete/Block	Good	11533.023.062993	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	11533.023.062993	8	0.000	Negative
	Ceiling	Plaster	Good	11533.023.062993	9	0.000	Negative
	Tread	Wood	Fair	11533.023.062993	20	0.000	Negative
	Baseboard	Wood	Good	11533.023.062993	21	0.000	Negative
	Banister rail	Wood	Fair	11533.023.062993	22	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	11533.023.062993	3	0.000	Negative
	Ceiling	Concrete/Block	Good	11533.023.062993	4	0.000	Negative
	Cab door	Wood	Good	11533.023.062993	5	0.000	Negative
	Cab Shelf	Wood	Fair	11533.023.062993	6	0.000	Negative
	Cab End Panel	Wood	Fair	11533.023.062993	7	0.200	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	11533.023.062993	10	0.000	Negative
	Ceiling	Plaster	Good	11533.023.062993	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	11533.023.062993	12	0.000	Negative
	Ceiling	Plaster	Good	11533.023.062993	13	0.000	Negative
BEDROOM #3							
	Wall (upper)	Plaster	Good	11533.023.062993	14	0.000	Negative
	Ceiling	Plaster	Good	11533.023.062993	15	0.000	Negative
BEDROOM #4							
	Wall (upper)	Plaster	Good	11533.023.062993	16	0.000	Negative
	Ceiling	Plaster	Good	11533.023.062993	17	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Wap Reading* mg/cm^2	XRF Results
BATHROOM #1							
	Wall (upper)	Plaster	Good	11533.023.062993	18	0.000	Negative
	Ceiling	Plaster	Good	11533.023.062993	19	0.000	Negative
APT #11534							
LIVING ROOM							
	Wall (upper)	Plaster	Good	11534.023.062993	1	0.000	Negative
	Ceiling	Concrete/Block	Good	11534.023.062993	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	11534.023.062993	9	0.000	Negative
	Ceiling	Plaster	Good	11534.023.062993	10	0.000	Negative
	Tread	Wood	Fair	11534.023.062993	21	0.000	Negative
	Baseboard	Wood	Good	11534.023.062993	22	0.000	Negative
	Banister rail	Wood	Good	11534.023.062993	23	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	11534.023.062993	3	0.000	Negative
	Ceiling	Concrete/Block	Good	11534.023.062993	5	0.000	Negative
	Cab door	Wood	Good	11534.023.062993	6	0.000	Negative
	Cab Shelf	Wood	Fair	11534.023.062993	7	0.000	Negative
	Cab End Panel	Wood	Good	11534.023.062993	8	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	11534.023.062993	11	0.000	Negative
	Ceiling	Plaster	Good	11534.023.062993	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	11534.023.062993	13	0.000	Negative
	Ceiling	Plaster	Good	11534.023.062993	14	0.000	Negative
BEDROOM #3							
	Wall (upper)	Plaster	Good	11534.023.062993	15	0.000	Negative
	Ceiling	Plaster	Good	11534.023.062993	16	0.000	Negative
BEDROOM #4							
	Wall (upper)	Plaster	Good	11534.023.062993	17	0.000	Negative
	Ceiling	Plaster	Good	11534.023.062993	18	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	11534.023.062993	19	0.000	Negative
	Ceiling	Plaster	Good	11534.023.062993	20	0.000	Negative
APT #11535							
LIVING ROOM							
	Wall (upper)	Plaster	Good	11535.023.062893	1	0.000	Negative
	Ceiling	Concrete/Block	Good	11535.023.062893	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	11535.023.062893	8	0.000	Negative
	Ceiling	Plaster	Good	11535.023.062893	9	0.000	Negative
	Tread	Wood	Fair	11535.023.062893	20	0.000	Negative
	Baseboard	Wood	Good	11535.023.062893	21	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	11535.023.062893	3	0.000	Negative
	Ceiling	Concrete/Block	Good	11535.023.062893	4	0.000	Negative
	Cab door	Wood	Good	11535.023.062893	5	0.000	Negative
	Cab Shelf	Wood	Good	11535.023.062893	6	0.200	Negative
	Cab End Panel	Wood	Good	11535.023.062893	7	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
BEDROOM #1							
	Wall (upper)	Plaster	Good	11535.023.062893	10	0.000	Negative
	Ceiling	Plaster	Good	11535.023.062893	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	11535.023.062893	12	0.000	Negative
	Ceiling	Plaster	Good	11535.023.062893	13	0.000	Negative
BEDROOM #3							
	Wall (upper)	Plaster	Good	11535.023.062893	14	0.000	Negative
	Ceiling	Plaster	Good	11535.023.062893	15	0.000	Negative
BEDROOM #4							
	Wall (upper)	Plaster	Good	11535.023.062893	16	0.000	Negative
	Ceiling	Plaster	Good	11535.023.062893	17	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	11535.023.062893	18	0.000	Negative
	Ceiling	Plaster	Good	11535.023.062893	19	0.000	Negative
APT #11536							
LIVING ROOM							
	Wall (upper)	Plaster	Good	11536.023.062993	1	0.000	Negative
	Ceiling	Concrete/Block	Good	11536.023.062993	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	11536.023.062993	9	0.000	Negative
	Ceiling	Plaster	Good	11536.023.062993	10	0.000	Negative
	Tread	Wood	Fair	11536.023.062993	19	0.000	Negative
	Baseboard	Wood	Good	11536.023.062993	20	0.100	Negative
	Banister rail	Wood	Fair	11536.023.062993	21	0.200	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	11536.023.062993	3	0.000	Negative
	Ceiling	Concrete/Block	Good	11536.023.062993	5	0.000	Negative
	Cab door	Wood	Good	11536.023.062993	6	0.000	Negative
	Cab Shelf	Wood	Fair	11536.023.062993	7	0.000	Negative
	Cab End Panel	Wood	Good	11536.023.062993	8	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	11536.023.062993	11	0.000	Negative
	Ceiling	Concrete/Block	Good	11536.023.062993	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	11536.023.062993	13	0.000	Negative
	Ceiling	Plaster	Good	11536.023.062993	14	0.000	Negative
BEDROOM #3							
	Wall (upper)	Plaster	Good	11536.023.062993	15	0.000	Negative
	Ceiling	Plaster	Good	11536.023.062993	16	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	11536.023.062993	17	0.000	Negative
	Ceiling	Plaster	Good	11536.023.062993	18	0.000	Negative
APT #11537							
LIVING ROOM							
	Wall (upper)	Plaster	Good	11537.023.062893	1	0.000	Negative
	Ceiling	Concrete/Block	Good	11537.023.062893	2	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
HALLWAY							
	Wall (upper)	Plaster	Fair	11537.023.062893	9	0.000	Negative
	Ceiling	Plaster	Good	11537.023.062893	10	0.000	Negative
	Tread	Wood	Good	11537.023.062893	21	0.000	Negative
	Baseboard	Wood	Fair	11537.023.062893	22	0.100	Negative
	Banister rail	Wood	Good	11537.023.062893	23	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	11537.023.062893	3	0.100	Negative
	Ceiling	Concrete/Block	Good	11537.023.062893	4	0.000	Negative
	Cab door	Wood	Good	11537.023.062893	5	0.000	Negative
	Cab Shelf	Wood	Good	11537.023.062893	6	0.000	Negative
	Cab End Panel	Wood	Good	11537.023.062893	8	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	11537.023.062893	11	0.000	Negative
	Ceiling	Plaster	Good	11537.023.062893	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	11537.023.062893	13	0.000	Negative
	Ceiling	Plaster	Good	11537.023.062893	14	0.000	Negative
BEDROOM #3							
	Wall (upper)	Plaster	Good	11537.023.062893	15	0.000	Negative
	Ceiling	Plaster	Good	11537.023.062893	16	0.000	Negative
BEDROOM #4							
	Wall (upper)	Plaster	Good	11537.023.062893	17	0.000	Negative
	Ceiling	Plaster	Good	11537.023.062893	18	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	11537.023.062893	19	0.000	Negative
	Ceiling	Plaster	Good	11537.023.062893	20	0.000	Negative
APT #2012							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2012.053.051893	1	0.000	Negative
	Ceiling	Concrete/Block	Good	2012.053.051893	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2012.053.051893	8	0.000	Negative
	Ceiling	Plaster	Good	2012.053.051893	9	0.000	Negative
	Tread	Wood	Poor	2012.053.051893	16	0.000	Negative
	Baseboard	Wood	Poor	2012.053.051893	17	0.294	Negative
	Banister rail	Wood	Poor	2012.053.051893	18	0.935	Inconclusive
KITCHEN							
	Wall (upper)	Plaster	Good	2012.053.051893	3	0.000	Negative
	Ceiling	Plaster	Good	2012.053.051893	4	0.000	Negative
	Cab door	Wood	Good	2012.053.051893	5	0.278	Negative
	Cab Shelf	Wood	Fair	2012.053.051893	6	0.140	Negative
	Cab End Panel	Wood	Fair	2012.053.051893	7	0.259	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2012.053.051893	10	0.000	Negative
	Ceiling	Plaster	Good	2012.053.051893	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2012.053.051893	12	0.000	Negative
	Ceiling	Plaster	Good	2012.053.051893	13	0.148	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
BATHROOM #1							
	Wall (upper)	Plaster	Fair	2012.053.051893	14	0.000	Negative
	Ceiling	Plaster	Good	2012.053.051893	15	0.000	Negative
APT #2014							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2014.053.051893	1	0.117	Negative
	Ceiling	Concrete/Block		Good 2014.053.051893	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2014.053.051893	8	0.000	Negative
	Ceiling	Plaster	Good	2014.053.051893	9	0.000	Negative
	Tread	Wood	Fair	2014.053.051893	14	0.000	Negative
	Baseboard	Wood	Fair	2014.053.051893	15	0.247	Negative
	Banister rail	Wood	Fair	2014.053.051893	16	0.804	Inconclusive
KITCHEN							
	Wall (upper)	Plaster	Good	2014.053.051893	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2014.053.051893	4	0.000	Negative
	Cab door	Wood	Good	2014.053.051893	5	0.028	Negative
	Cab Shelf	Wood	Fair	2014.053.051893	6	0.000	Negative
	Cab End Panel	Wood	Good	2014.053.051893	7	0.469	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Fair	2014.053.051893	10	0.000	Negative
	Ceiling	Plaster	Good	2014.053.051893	11	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2014.053.051893	12	0.000	Negative
	Ceiling	Plaster	Good	2014.053.051893	13	0.000	Negative
APT #2016							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2016.053.051893	1	0.008	Negative
	Ceiling	Concrete/Block		Good 2016.053.051893	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2016.053.051893	8	0.000	Negative
	Ceiling	Plaster	Fair	2016.053.051893	9	0.000	Negative
	Tread	Wood	Fair	2016.053.051893	16	0.000	Negative
	Baseboard	Wood	Fair	2016.053.051893	17	0.449	Negative
	Banister rail	Wood	Fair	2016.053.051893	18	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2016.053.051893	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2016.053.051893	4	0.000	Negative
	Cab door	Wood	Good	2016.053.051893	5	0.000	Negative
	Cab Shelf	Wood	Fair	2016.053.051893	6	0.352	Negative
	Cab End Panel	Wood	Fair	2016.053.051893	7	0.677	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Fair	2016.053.051893	10	0.053	Negative
	Ceiling	Plaster	Good	2016.053.051893	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2016.053.051893	12	0.000	Negative
	Ceiling	Plaster	Good	2016.053.051893	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2016.053.051893	14	0.000	Negative
	Ceiling	Plaster	Good	2016.053.051893	15	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
APT #2018							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2018.053.051893	1	0.000	Negative
	Ceiling	Concrete/Block	Good	2018.053.051893	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2018.053.051893	8	0.184	Negative
	Ceiling	Plaster	Good	2018.053.051893	9	0.000	Negative
	Tread	Wood	Good	2018.053.051893	16	0.000	Negative
	Baseboard	Wood	Good	2018.053.051893	17	0.376	Negative
	Banister rail	Wood	Good	2018.053.051893	18	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2018.053.051893	3	0.000	Negative
	Ceiling	Concrete/Block	Good	2018.053.051893	4	0.000	Negative
	Cab door	Wood	Good	2018.053.051893	5	0.232	Negative
	Cab Shelf	Wood	Good	2018.053.051893	6	0.043	Negative
	Cab End Panel	Wood	Good	2018.053.051893	7	0.449	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2018.053.051893	10	0.200	Negative
	Ceiling	Plaster	Good	2018.053.051893	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2018.053.051893	12	0.000	Negative
	Ceiling	Plaster	Good	2018.053.051893	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2018.053.051893	14	0.000	Negative
	Ceiling	Plaster	Good	2018.053.051893	15	0.000	Negative
APT #2020							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2020.053.051893	1	0.000	Negative
	Ceiling	Concrete/Block	Good	2020.053.051893	3	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2020.053.051893	9	0.000	Negative
	Ceiling	Plaster	Good	2020.053.051893	10	0.000	Negative
	Tread	Wood	Good	2020.053.051893	17	0.000	Negative
	Baseboard	Wood	Good	2020.053.051893	18	0.388	Negative
	Banister rail	Wood	Fair	2020.053.051893	19	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2020.053.051893	4	0.000	Negative
	Ceiling	Concrete/Block	Good	2020.053.051893	5	0.000	Negative
	Cab door	Wood	Good	2020.053.051893	6	0.000	Negative
	Cab Shelf	Wood	Fair	2020.053.051893	7	0.000	Negative
	Cab End Panel	Wood	Fair	2020.053.051893	8	0.397	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2020.053.051893	11	0.000	Negative
	Ceiling	Plaster	Good	2020.053.051893	12	0.160	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2020.053.051893	13	0.000	Negative
	Ceiling	Plaster	Good	2020.053.051893	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2020.053.051893	15	0.000	Negative
	Ceiling	Plaster	Good	2020.053.051893	16	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
APT #2022							
LIVING ROOM							
	Wall (upper)	Plaster	Fair	2022.053.051893	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2022.053.051893	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2022.053.051893	8	0.000	Negative
	Ceiling	Plaster	Good	2022.053.051893	9	0.000	Negative
	Tread	Wood	Fair	2022.053.051893	16	0.000	Negative
	Baseboard	Wood	Fair	2022.053.051893	17	0.000	Negative
	Banister rail	Wood	Fair	2022.053.051893	18	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Fair	2022.053.051893	3	0.000	Negative
	Ceiling	Concrete/Block		Fair 2022.053.051893	4	0.000	Negative
	Cab door	Wood	Fair	2022.053.051893	5	0.051	Negative
	Cab Shelf	Wood	Fair	2022.053.051893	6	0.181	Negative
	Cab End Panel	Wood	Fair	2022.053.051893	7	0.461	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2022.053.051893	10	0.000	Negative
	Ceiling	Plaster	Good	2022.053.051893	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2022.053.051893	12	0.000	Negative
	Ceiling	Plaster	Good	2022.053.051893	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2022.053.051893	14	0.000	Negative
	Ceiling	Plaster	Good	2022.053.051893	15	0.000	Negative
APT #2026							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2026.053.051893	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2026.053.051893	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2026.053.051893	8	0.000	Negative
	Ceiling	Plaster	Good	2026.053.051893	9	0.000	Negative
	Tread	Wood	Fair	2026.053.051893	16	0.000	Negative
	Baseboard	Wood	Good	2026.053.051893	17	0.214	Negative
	Banister rail	Wood	Good	2026.053.051893	18	0.000	Negative
KITCHEN							
	Cab End Panel	Wood	Fair	2026.053.051893	7	0.648	Negative
	Wall (upper)	Plaster	Good	2026.053.051893	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2026.053.051893	4	0.000	Negative
	Cab door	Wood	Good	2026.053.051893	5	0.234	Negative
	Cab Shelf	Wood	Fair	2026.053.051893	6	0.377	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2026.053.051893	10	0.000	Negative
	Ceiling	Plaster	Good	2026.053.051893	11	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
BEDROOM #2							
	Wall (upper)	Plaster	Fair	2026.053.051893	12	0.000	Negative
	Ceiling	Plaster	Good	2026.053.051893	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Fair	2026.053.051893	14	0.000	Negative
	Ceiling	Plaster	Good	2026.053.051893	15	0.000	Negative
APT #2028							
LIVING ROOM							
	Wall (upper)	Drywall	Good	2028.053.051893	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2028.053.051893	2	0.000	Negative
HALLWAY							
	Wall (upper)	Drywall	Good	2028.053.051893	8	0.000	Negative
	Ceiling	Concrete/Block		Good 2028.053.051893	9	0.000	Negative
	Tread	Wood	Poor	2028.053.051893	16	0.000	Negative
	Baseboard	Wood	Good	2028.053.051893	17	0.660	Negative
	Banister rail	Wood	Good	2028.053.051893	18	0.000	Negative
KITCHEN							
	Wall (upper)	Drywall	Good	2028.053.051893	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2028.053.051893	4	0.000	Negative
	Cab door	Wood	Good	2028.053.051893	5	0.000	Negative
	Cab Shelf	Wood	Good	2028.053.051893	6	0.165	Negative
	Cab End Panel	Wood	Fair	2028.053.051893	7	0.082	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Fair	2028.053.051893	10	0.000	Negative
	Ceiling	Concrete/Block		Good 2028.053.051893	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2028.053.051893	12	0.000	Negative
	Ceiling	Plaster	Good	2028.053.051893	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2028.053.051893	14	0.000	Negative
	Ceiling	Plaster	Good	2028.053.051893	15	0.000	Negative
APT #2030							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2030.053.051893	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2030.053.051893	2	0.000	Negative
	Wall (upper)	Plaster	Good	2030.080.060893	1	-0.500	Negative
	Ceiling	Concrete/Block		Good 2030.080.060893	2	-0.500	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
HALLWAY							
	Wall (upper)	Plaster	Good	2030.053.051893	8	0.000	Negative
	Ceiling	Plaster	Good	2030.053.051893	9	0.000	Negative
	Tread	Wood	Fair	2030.053.051893	16	0.000	Negative
	Baseboard	Wood	Good	2030.053.051893	17	0.280	Negative
	Banister rail	Wood	Good	2030.053.051893	18	0.000	Negative
	Wall (upper)	Plaster	Good	2030.080.060893	9	-0.200	Negative
	Ceiling	Concrete/Block		Good 2030.080.060893	10	-0.200	Negative
	Tread	Wood	Poor	2030.080.060893	17	-0.500	Negative
	Baseboard	Wood	Good	2030.080.060893	18	0.400	Negative
	Banister rail	Wood	Good	2030.080.060893	19	-0.200	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2030.053.051893	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2030.053.051893	4	0.000	Negative
	Cab door	Wood	Good	2030.053.051893	5	0.000	Negative
	Cab Shelf	Wood	Fair	2030.053.051893	6	0.235	Negative
	Cab End Panel	Wood	Fair	2030.053.051893	7	0.494	Negative
	Wall (upper)	Plaster	Fair	2030.080.060893	3	-0.300	Negative
	Ceiling	Concrete/Block		Good 2030.080.060893	5	-0.700	Negative
	Cab door	Wood	Good	2030.080.060893	6	0.000	Negative
	Cab Shelf	Wood	Good	2030.080.060893	7	0.200	Negative
	Cab End Panel	Wood	Good	2030.080.060893	8	0.100	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2030.053.051893	10	0.000	Negative
	Ceiling	Plaster	Good	2030.053.051893	11	0.000 -	Negative
	Wall (upper)	Plaster	Good	2030.080.060893	11	-0.200	Negative
	Ceiling	Plaster	Good	2030.080.060893	12	-0.200	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2030.053.051893	12	0.000	Negative
	Ceiling	Plaster	Good	2030.053.051893	13	0.216	Negative
	Wall (upper)	Plaster	Good	2030.080.060893	13	-0.100	Negative
	Ceiling	Plaster	Good	2030.080.060893	14	-0.300	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Fair	2030.053.051893	14	0.000	Negative
	Ceiling	Plaster	Good	2030.053.051893	15	0.000	Negative
	Wall (upper)	Plaster	Good	2030.080.060893	15	-0.300	Negative
	Ceiling	Plaster	Good	2030.080.060893	16	-0.400	Negative
APT #2031							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2031.053.061093	2	0.000	Negative
	Ceiling	Concrete/Block		Good 2031.053.061093	3	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2031.053.061093	12	0.000	Negative
	Ceiling	Plaster	Good	2031.053.061093	13	0.000	Negative
	Tread	Wood	Fair	2031.053.061093	20	0.000	Negative
	Baseboard	Wood	Fair	2031.053.061093	22	0.300	Negative
	Banister rail	Wood	Fair	2031.053.061093	23	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
KITCHEN							
	Wall (upper)	Plaster	Good	2031.053.061093	5	0.000	Negative
	Ceiling	Concrete/Block		Good 2031.053.061093	6	0.000	Negative
	Cab door	Wood	Fair	2031.053.061093	7	0.100	Negative
	Cab Shelf	Wood	Fair	2031.053.061093	9	0.100	Negative
	Cab End Panel	Wood	Fair	2031.053.061093	11	0.200	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2031.053.061093	14	0.000	Negative
	Ceiling	Plaster	Good	2031.053.061093	15	0.200	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2031.053.061093	16	0.000	Negative
	Ceiling	Plaster	Good	2031.053.061093	17	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2031.053.061093	18	0.000	Negative
	Ceiling	Plaster	Fair	2031.053.061093	19	0.000	Negative
APT #2032							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2032.053.060893	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2032.053.060893	2	0.000	Negative
	Wall (upper)	Drywall	Good	2032.053.051793	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2032.053.051793	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2032.053.060893	8	0.000	Negative
	Ceiling	Plaster	Good	2032.053.060893	9	0.000	Negative
	Tread	Wood	Good	2032.053.060893	17	0.000	Negative
	Baseboard	Wood	Good	2032.053.060893	18	0.200	Negative
	Banister rail	Wood	Good	2032.053.060893	19	0.000	Negative
	Wall (upper)	Drywall	Good	2032.053.051793	8	0.000	Negative
	Ceiling	Concrete/Block		Good 2032.053.051793	9	0.000	Negative
	Tread	Wood	Fair	2032.053.051793	16	0.000	Negative
	Baseboard	Wood	Good	2032.053.051793	17	0.199	Negative
	Banister rail	Wood	Good	2032.053.051793	18	0.233	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2032.053.060893	3	0.000	Negative
	Ceiling	Other	Good	2032.053.060893	4	0.000	Negative
	Cab door	Wood	Fair	2032.053.060893	5	0.000	Negative
	Cab Shelf	Wood	Fair	2032.053.060893	6	0.200	Negative
	Cab End Panel	Wood	Fair	2032.053.060893	7	0.100	Negative
	Wall (upper)	Drywall	Good	2032.053.051793	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2032.053.051793	4	0.000	Negative
	Cab door	Wood	Good	2032.053.051793	5	0.000	Negative
	Cab Shelf	Wood	Good	2032.053.051793	6	0.000	Negative
	Cab End Panel	Wood	Good	2032.053.051793	7	0.597	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2032.053.060893	10	0.000	Negative
	Ceiling	Plaster	Good	2032.053.060893	11	0.000	Negative
	Wall (upper)	Drywall	Good	2032.053.051793	10	0.000	Negative
	Ceiling	Drywall	Good	2032.053.051793	11	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
BEDROOM #2							
	Wall (upper)	Plaster	Good	2032.053.060893	12	0.000	Negative
	Ceiling	Plaster	Good	2032.053.060893	13	0.000	Negative
	Wall (upper)	Drywall	Good	2032.053.051793	12	0.000	Negative
	Ceiling	Drywall	Good	2032.053.051793	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2032.053.060893	14	0.000	Negative
	Ceiling	Plaster	Good	2032.053.060893	16	0.000	Negative
	Wall (upper)	Drywall	Good	2032.053.051793	14	0.000	Negative
	Ceiling	Drywall	Good	2032.053.051793	15	0.000	Negative
APT #2033							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2033.053.061093	1	0.000	Negative
	Ceiling	Concrete/Block	Good	2033.053.061093	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2033.053.061093	8	0.000	Negative
	Ceiling	Plaster	Good	2033.053.061093	9	0.000	Negative
	Tread	Wood	Poor	2033.053.061093	16	0.000	Negative
	Baseboard	Wood	Good	2033.053.061093	17	0.000	Negative
	Banister rail	Wood	Good	2033.053.061093	18	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2033.053.061093	3	0.000	Negative
	Ceiling	Concrete/Block	Good	2033.053.061093	4	0.000	Negative
	Cab door	Wood	Good	2033.053.061093	5	0.000	Negative
	Cab Shelf	Wood	Good	2033.053.061093	6	0.200	Negative
	Cab End Panel	Wood	Fair	2033.053.061093	7	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2033.053.061093	10	0.000	Negative
	Ceiling	Plaster	Good	2033.053.061093	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2033.053.061093	12	0.000	Negative
	Ceiling	Plaster	Good	2033.053.061093	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2033.053.061093	14	0.000	Negative
	Ceiling	Plaster	Good	2033.053.061093	15	0.000	Negative
APT #2034							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2034.053.060893	1	0.000	Negative
	Ceiling	Concrete/Block	Good	2034.053.060893	2	0.000	Negative
	Wall (upper)	Drywall	Good	2034.053.051793	1	0.000	Negative
	Ceiling	Concrete/Block	Good	2034.053.051793	2	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
HALLWAY							
	Wall (upper)	Plaster	Good	2034.053.060893	8	0.000	Negative
	Ceiling	Plaster	Fair	2034.053.060893	9	0.000	Negative
	Baseboard	Wood	Fair	2034.053.060893	19	0.100	Negative
	Banister rail	Wood	Fair	2034.053.060893	20	0.000	Negative
	Wall (upper)	Drywall	Good	2034.053.051793	8	0.000	Negative
	Ceiling	Drywall	Good	2034.053.051793	9	0.000	Negative
	Tread	Wood	Fair	2034.053.051793	16	0.000	Negative
	Baseboard	Wood	Good	2034.053.051793	17	0.000	Negative
	Banister rail	Wood	Good	2034.053.051793	18	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2034.053.060893	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2034.053.060893	4	0.000	Negative
	Cab door	Wood	Good	2034.053.060893	5	0.000	Negative
	Cab Shelf	Wood	Fair	2034.053.060893	6	0.000	Negative
	Cab End Panel	Wood	Fair	2034.053.060893	7	0.200	Negative
	Wall (upper)	Drywall	Good	2034.053.051793	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2034.053.051793	4	0.000	Negative
	Cab door	Wood	Fair	2034.053.051793	5	0.144	Negative
	Cab Shelf	Wood	Fair	2034.053.051793	6	0.104	Negative
	Cab End Panel	Wood	Fair	2034.053.051793	7	0.377	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2034.053.060893	11	0.000	Negative
	Ceiling	Plaster	Good	2034.053.060893	12	0.000	Negative
	Wall (upper)	Drywall	Good	2034.053.051793	10	0.000	Negative
	Ceiling	Drywall	Good	2034.053.051793	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2034.053.060893	13	0.000	Negative
	Ceiling	Plaster	Good	2034.053.060893	14	0.000	Negative
	Wall (upper)	Drywall	Good	2034.053.051793	12	0.000	Negative
	Ceiling	Drywall	Good	2034.053.051793	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2034.053.060893	16	0.000	Negative
	Ceiling	Plaster	Good	2034.053.060893	17	0.000	Negative
	Wall (upper)	Drywall	Good	2034.053.051793	14	0.000	Negative
	Ceiling	Drywall	Good	2034.053.051793	15	0.000	Negative
APT #2036							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2036.053.060993	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2036.053.060993	2	0.000	Negative
	Wall (upper)	Drywall	Good	2036.053.051793	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2036.053.051793	2	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
HALLWAY							
	Wall (upper)	Plaster	Good	2036.053.060993	9	0.000	Negative
	Ceiling	Plaster	Good	2036.053.060993	11	0.000	Negative
	Tread	Wood	Fair	2036.053.060993	18	0.000	Negative
	Baseboard	Wood	Fair	2036.053.060993	19	0.100	Negative
	Banister rail	Wood	Fair	2036.053.060993	20	0.100	Negative
	Wall (upper)	Drywall	Good	2036.053.051793	8	0.000	Negative
	Ceiling	Drywall	Good	2036.053.051793	9	0.000	Negative
	Baseboard	Wood	Fair	2036.053.051793	16	0.478	Negative
	Banister rail	Wood	Fair	2036.053.051793	17	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2036.053.060993	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2036.053.060993	5	0.000	Negative
	Cab door	Wood	Good	2036.053.060993	6	0.000	Negative
	Cab Shelf	Wood	Fair	2036.053.060993	7	0.100	Negative
	Cab End Panel	Wood	Fair	2036.053.060993	8	0.300	Negative
	Wall (upper)	Drywall	Good	2036.053.051793	3	0.140	Negative
	Ceiling	Concrete/Block		Good 2036.053.051793	4	0.000	Negative
	Cab door	Wood	Good	2036.053.051793	5	0.000	Negative
	Cab Shelf	Wood	Fair	2036.053.051793	6	0.007	Negative
	Cab End Panel	Wood	Fair	2036.053.051793	7	0.637	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2036.053.060993	12	0.000	Negative
	Ceiling	Plaster	Good	2036.053.060993	13	0.000	Negative
	Wall (upper)	Drywall	Good	2036.053.051793	10	0.000	Negative
	Ceiling	Drywall	Good	2036.053.051793	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2036.053.060993	14	0.000	Negative
	Ceiling	Plaster	Good	2036.053.060993	15	0.000	Negative
	Wall (upper)	Drywall	Good	2036.053.051793	12	0.000	Negative
	Ceiling	Drywall	Good	2036.053.051793	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2036.053.060993	16	0.000	Negative
	Ceiling	Plaster	Good	2036.053.060993	17	0.000	Negative
	Wall (upper)	Drywall	Good	2036.053.051793	14	0.000	Negative
	Ceiling	Drywall	Good	2036.053.051793	15	0.000	Negative
APT #2037							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2037.053.061093	1	0.100	Negative
	Ceiling	Concrete/Block		Good 2037.053.061093	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2037.053.061093	11	0.000	Negative
	Ceiling	Plaster	Good	2037.053.061093	12	0.000	Negative
	Tread	Wood	Fair	2037.053.061093	19	0.000	Negative
	Baseboard	Wood	Good	2037.053.061093	21	0.200	Negative
	Banister rail	Wood	Good	2037.053.061093	22	0.100	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
KITCHEN							
	Wall (upper)	Plaster	Good	2037.053.061093	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2037.053.061093	4	0.000	Negative
	Cab door	Wood	Good	2037.053.061093	6	0.500	Negative
	Cab Shelf	Wood	Fair	2037.053.061093	8	0.000	Negative
	Cab End Panel	Wood	Fair	2037.053.061093	10	0.700	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2037.053.061093	13	0.100	Negative
	Ceiling	Plaster	Good	2037.053.061093	14	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2037.053.061093	15	0.000	Negative
	Ceiling	Plaster	Good	2037.053.061093	16	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Fair	2037.053.061093	17	0.000	Negative
	Ceiling	Plaster	Good	2037.053.061093	18	0.000	Negative
APT #2038							
LIVING ROOM							
	Wall (upper)	Plaster	Poor	2038.053.060893	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2038.053.060893	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Fair	2038.053.060893	8	0.000	Negative
	Ceiling	Plaster	Good	2038.053.060893	9	0.000	Negative
	Tread	Wood	Poor	2038.053.060893	16	0.000	Negative
	Baseboard	Wood	Fair	2038.053.060893	17	0.000	Negative
	Banister rail	Wood	Fair	2038.053.060893	18	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2038.053.060893	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2038.053.060893	4	0.000	Negative
	Cab door	Wood	Fair	2038.053.060893	5	0.000	Negative
	Cab Shelf	Wood	Poor	2038.053.060893	6	0.000	Negative
	Cab End Panel	Wood	Fair	2038.053.060893	7	0.100	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2038.053.060893	10	0.000	Negative
	Ceiling	Plaster	Good	2038.053.060893	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2038.053.060893	12	0.000	Negative
	Ceiling	Plaster	Good	2038.053.060893	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2038.053.060893	14	0.000	Negative
	Ceiling	Plaster	Good	2038.053.060893	15	0.000	Negative
APT #2039							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2039.053.061093	1	0.100	Negative
	Ceiling	Concrete/Block		Good 2039.053.061093	2	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
HALLWAY							
	Wall (upper)	Plaster	Good	2039.053.061093	8	0.000	Negative
	Ceiling	Plaster	Good	2039.053.061093	9	0.000	Negative
	Tread	Wood	Fair	2039.053.061093	16	0.100	Negative
	Baseboard	Wood	Fair	2039.053.061093	17	0.000	Negative
	Banister rail	Wood	Fair	2039.053.061093	18	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2039.053.061093	3	0.000	Negative
	Ceiling	Concrete/Block	Good	2039.053.061093	4	0.000	Negative
	Cab door	Wood	Good	2039.053.061093	5	0.000	Negative
	Cab Shelf	Wood	Fair	2039.053.061093	6	0.000	Negative
	Cab End Panel	Wood	Fair	2039.053.061093	7	0.300	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2039.053.061093	10	0.000	Negative
	Ceiling	Plaster	Good	2039.053.061093	11	0.100	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2039.053.061093	12	0.000	Negative
	Ceiling	Plaster	Good	2039.053.061093	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Fair	2039.053.061093	14	0.100	Negative
	Ceiling	Plaster	Good	2039.053.061093	15	0.100	Negative
APT #2040							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2040.053.060993	1	0.000	Negative
	Ceiling	Concrete/Block	Good	2040.053.060993	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2040.053.060993	9	0.000	Negative
	Ceiling	Plaster	Good	2040.053.060993	10	0.000	Negative
	Tread	Wood	Poor	2040.053.060993	18	0.000	Negative
	Baseboard	Wood	Fair	2040.053.060993	19	0.000	Negative
	Banister rail	Wood	Poor	2040.053.060993	20	0.000	Negative
KITCHEN							
	Cab Shelf	Wood	Fair	2040.053.060993	6	0.200	Negative
	Wall (upper)	Plaster	Good	2040.053.060993	3	0.000	Negative
	Ceiling	Concrete/Block	Good	2040.053.060993	4	0.000	Negative
	Cab door	Wood	Good	2040.053.060993	5	0.000	Negative
	Cab End Panel	Wood	Good	2040.053.060993	8	0.200	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2040.053.060993	12	0.000	Negative
	Ceiling	Plaster	Good	2040.053.060993	13	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2040.053.060993	14	0.000	Negative
	Ceiling	Plaster	Good	2040.053.060993	15	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2040.053.060993	16	0.000	Negative
	Ceiling	Plaster	Good	2040.053.060993	17	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
APT #2041							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2041.053.061093	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2041.053.061093	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2041.053.061093	9	0.000	Negative
	Ceiling	Plaster	Good	2041.053.061093	10	0.000	Negative
	Tread	Wood	Fair	2041.053.061093	17	0.000	Negative
	Baseboard	Wood	Fair	2041.053.061093	19	0.500	Negative
	Banister rail	Wood	Fair	2041.053.061093	20	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2041.053.061093	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2041.053.061093	4	0.000	Negative
	Cab door	Wood	Good	2041.053.061093	5	0.000	Negative
	Cab Shelf	Wood	Good	2041.053.061093	6	0.200	Negative
	Cab End Panel	Wood	Good	2041.053.061093	8	0.300	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2041.053.061093	11	0.000	Negative
	Ceiling	Plaster	Good	2041.053.061093	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2041.053.061093	13	0.000	Negative
	Ceiling	Plaster	Good	2041.053.061093	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2041.053.061093	15	0.100	Negative
	Ceiling	Plaster	Good	2041.053.061093	16	0.000	Negative
APT #2042							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2042.053.060993	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2042.053.060993	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2042.053.060993	8	0.000	Negative
	Ceiling	Plaster	Good	2042.053.060993	9	0.000	Negative
	Tread	Wood	Poor	2042.053.060993	16	0.000	Negative
	Baseboard	Wood	Good	2042.053.060993	17	0.000	Negative
	Banister rail	Wood	Poor	2042.053.060993	18	0.200	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2042.053.060993	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2042.053.060993	4	0.000	Negative
	Cab door	Wood	Good	2042.053.060993	5	0.200	Negative
	Cab Shelf	Wood	Fair	2042.053.060993	6	0.000	Negative
	Cab End Panel	Wood	Fair	2042.053.060993	7	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Fair	2042.053.060993	10	0.200	Negative
	Ceiling	Plaster	Fair	2042.053.060993	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Fair	2042.053.060993	12	0.000	Negative
	Ceiling	Plaster	Fair	2042.053.060993	13	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
BATHROOM #1							
	Wall (upper)	Plaster	Poor	2042.053.060993	14	0.000	Negative
	Ceiling	Plaster	Good	2042.053.060993	15	0.000	Negative
APT #2043							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2043.053.061093	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2043.053.061093	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2043.053.061093	10	0.000	Negative
	Ceiling	Plaster	Good	2043.053.061093	11	0.000	Negative
	Tread	Wood	Fair	2043.053.061093	18	0.000	Negative
	Baseboard	Wood	Good	2043.053.061093	19	0.000	Negative
	Banister rail	Wood	Good	2043.053.061093	20	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2043.053.061093	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2043.053.061093	4	0.000	Negative
	Cab door	Wood	Good	2043.053.061093	6	0.300	Negative
	Cab Shelf	Wood	Good	2043.053.061093	8	0.200	Negative
	Cab End Panel	Wood	Fair	2043.053.061093	9	0.300	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2043.053.061093	12	0.000	Negative
	Ceiling	Plaster	Good	2043.053.061093	13	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Fair	2043.053.061093	14	0.000	Negative
	Ceiling	Plaster	Fair	2043.053.061093	15	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2043.053.061093	16	0.000	Negative
	Ceiling	Plaster	Good	2043.053.061093	17	0.200	Negative
APT #2044							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2044.053.060993	1	0.200	Negative
	Ceiling	Concrete/Block		Good 2044.053.060993	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Fair	2044.053.060993	8	0.200	Negative
	Ceiling	Plaster	Poor	2044.053.060993	9	0.000	Negative
	Tread	Wood	Fair	2044.053.060993	16	0.000	Negative
	Baseboard	Wood	Poor	2044.053.060993	17	0.200	Negative
	Banister rail	Wood	Good	2044.053.060993	18	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2044.053.060993	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2044.053.060993	4	0.000	Negative
	Cab door	Wood	Good	2044.053.060993	5	0.000	Negative
	Cab Shelf	Wood	Poor	2044.053.060993	6	0.100	Negative
	Cab End Panel	Wood	Fair	2044.053.060993	7	0.200	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Fair	2044.053.060993	10	0.000	Negative
	Ceiling	Plaster	Good	2044.053.060993	11	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
BEDROOM #2							
	Wall (upper)	Plaster	Good	2044.053.060993	12	0.000	Negative
	Ceiling	Plaster	Good	2044.053.060993	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2044.053.060993	14	0.000	Negative
	Ceiling	Plaster	Good	2044.053.060993	15	0.000	Negative
APT #2045							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2045.053.061193	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2045.053.061193	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2045.053.061193	9	0.000	Negative
	Ceiling	Plaster	Good	2045.053.061193	10	0.000	Negative
	Tread	Wood	Poor	2045.053.061193	17	0.000	Negative
	Baseboard	Wood	Fair	2045.053.061193	18	0.100	Negative
	Banister rail	Wood	Fair	2045.053.061193	19	0.000	Negative
KITCHEN							
	Ceiling	Concrete/Block		Good 2045.053.061193	4	0.000	Negative
	Wall (upper)	Plaster	Good	2045.053.061193	3	0.000	Negative
	Cab door	Wood	Fair	2045.053.061193	6	0.000	Negative
	Cab Shelf	Wood	Fair	2045.053.061193	7	0.100	Negative
	Cab End Panel	Wood	Fair	2045.053.061193	8	0.800	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2045.053.061193	11	0.000	Negative
	Ceiling	Plaster	Good	2045.053.061193	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2045.053.061193	13	0.000	Negative
	Ceiling	Plaster	Good	2045.053.061193	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2045.053.061193	15	0.000	Negative
	Ceiling	Plaster	Good	2045.053.061193	16	0.100	Negative
APT #2046							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2046.053.060993	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2046.053.060993	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2046.053.060993	8	0.000	Negative
	Ceiling	Plaster	Good	2046.053.060993	9	0.000	Negative
	Tread	Wood	Fair	2046.053.060993	16	0.000	Negative
	Baseboard	Wood	Good	2046.053.060993	18	0.400	Negative
	Banister rail	Wood	Good	2046.053.060993	19	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2046.053.060993	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2046.053.060993	4	0.000	Negative
	Cab door	Wood	Fair	2046.053.060993	5	0.000	Negative
	Cab Shelf	Wood	Poor	2046.053.060993	6	0.000	Negative
	Cab End Panel	Wood	Fair	2046.053.060993	7	0.700	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
BEDROOM #1							
	Wall (upper)	Plaster	Good	2046.053.060993	10	0.000	Negative
	Ceiling	Plaster	Good	2046.053.060993	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2046.053.060993	12	0.000	Negative
	Ceiling	Plaster	Good	2046.053.060993	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2046.053.060993	14	0.100	Negative
	Ceiling	Plaster	Good	2046.053.060993	15	0.000	Negative
APT #2047							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2047.053.061093	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2047.053.061093	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2047.053.061093	8	0.000	Negative
	Ceiling	Plaster	Good	2047.053.061093	9	0.000	Negative
	Tread	Wood	Fair	2047.053.061093	16	0.000	Negative
	Baseboard	Wood	Fair	2047.053.061093	18	0.100	Negative
	Banister rail	Wood	Fair	2047.053.061093	20	0.100	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2047.053.061093	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2047.053.061093	4	0.000	Negative
	Cab door	Wood	Good	2047.053.061093	5	0.000	Negative
	Cab Shelf	Wood	Fair	2047.053.061093	6	0.000	Negative
	Cab End Panel	Wood	Fair	2047.053.061093	7	0.400	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2047.053.061093	10	0.000	Negative
	Ceiling	Plaster	Good	2047.053.061093	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2047.053.061093	12	0.000	Negative
	Ceiling	Plaster	Good	2047.053.061093	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2047.053.061093	14	0.000	Negative
	Ceiling	Plaster	Good	2047.053.061093	15	0.000	Negative
APT #2048							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2048.053.060993	2	0.000	Negative
	Ceiling	Concrete/Block		Good 2048.053.060993	3	0.100	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2048.053.060993	10	0.000	Negative
	Ceiling	Plaster	Good	2048.053.060993	11	0.000	Negative
	Tread	Wood	Poor	2048.053.060993	19	0.000	Negative
	Baseboard	Wood	Fair	2048.053.060993	20	0.000	Negative
	Banister rail	Wood	Fair	2048.053.060993	21	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
KITCHEN							
	Wall (upper)	Plaster	Fair	2048.053.060993	4	0.000	Negative
	Ceiling	Concrete/Block		Good 2048.053.060993	5	0.000	Negative
	Cab door	Wood	Good	2048.053.060993	7	0.200	Negative
	Cab Shelf	Wood	Good	2048.053.060993	8	0.200	Negative
	Cab End Panel	Wood	Fair	2048.053.060993	9	0.200	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2048.053.060993	12	0.000	Negative
	Ceiling	Plaster	Good	2048.053.060993	13	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2048.053.060993	15	1.400	Positive
	Ceiling	Plaster	Good	2048.053.060993	16	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2048.053.060993	17	0.000	Negative
	Ceiling	Plaster	Good	2048.053.060993	18	0.000	Negative
APT #2049							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2049.053.061093	2	0.000	Negative
	Ceiling	Concrete/Block		Good 2049.053.061093	3	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2049.053.061093	9	0.000	Negative
	Ceiling	Plaster	Good	2049.053.061093	10	0.000	Negative
	Tread	Wood	Fair	2049.053.061093	17	0.000	Negative
	Baseboard	Wood	Fair	2049.053.061093	18	0.100	Negative
	Banister rail	Wood	Good	2049.053.061093	20	0.000	Negative
KITCHEN							
	Ceiling	Concrete/Block		Good 2049.053.061093	5	0.000	Negative
	Wall (upper)	Plaster	Good	2049.053.061093	4	0.000	Negative
	Cab door	Plaster	Fair	2049.053.061093	6	0.100	Negative
	Cab Shelf	Wood	Fair	2049.053.061093	7	0.000	Negative
	Cab End Panel	Wood	Fair	2049.053.061093	8	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2049.053.061093	11	0.000	Negative
	Ceiling	Plaster	Good	2049.053.061093	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2049.053.061093	13	0.000	Negative
	Ceiling	Plaster	Good	2049.053.061093	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2049.053.061093	15	0.000	Negative
	Ceiling	Plaster	Good	2049.053.061093	16	0.000	Negative
APT #2050							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2050.053.060993	1	0.200	Negative
	Ceiling	Concrete/Block		Good 2050.053.060993	2	0.000	Negative
	Wall (upper)	Drywall	Good	2050.053.051793	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2050.053.051793	2	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
HALLWAY							
	Wall (upper)	Plaster	Fair	2050.053.060993	9	0.000	Negative
	Ceiling	Plaster	Good	2050.053.060993	10	0.000	Negative
	Tread	Wood	Poor	2050.053.060993	17	0.000	Negative
	Baseboard	Wood	Good	2050.053.060993	18	0.000	Negative
	Banister rail	Wood	Good	2050.053.060993	19	0.000	Negative
	Wall (upper)	Drywall	Good	2050.053.051793	8	0.000	Negative
	Ceiling	Drywall	Good	2050.053.051793	9	0.000	Negative
	Tread	Wood	Fair	2050.053.051793	16	0.000	Negative
	Baseboard	Wood	Fair	2050.053.051793	17	0.245	Negative
	Banister rail	Wood	Good	2050.053.051793	18	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2050.053.060993	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2050.053.060993	4	0.000	Negative
	Cab door	Wood	Fair	2050.053.060993	5	0.000	Negative
	Cab Shelf	Wood	Fair	2050.053.060993	7	0.100	Negative
	Cab End Panel	Wood	Fair	2050.053.060993	8	0.000	Negative
	Wall (upper)	Drywall	Good	2050.053.051793	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2050.053.051793	4	0.000	Negative
	Cab door	Wood	Good	2050.053.051793	5	0.113	Negative
	Cab Shelf	Wood	Fair	2050.053.051793	6	0.080	Negative
	Cab End Panel	Wood	Fair	2050.053.051793	7	0.408	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Poor	2050.053.060993	11	0.000	Negative
	Ceiling	Plaster	Fair	2050.053.060993	12	0.000	Negative
	Wall (upper)	Drywall	Good	2050.053.051793	10	0.000	Negative
	Ceiling	Drywall	Good	2050.053.051793	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Poor	2050.053.060993	13	0.000	Negative
	Ceiling	Plaster	Fair	2050.053.060993	14	0.000	Negative
	Wall (upper)	Drywall	Good	2050.053.051793	12	0.000	Negative
	Ceiling	Drywall	Good	2050.053.051793	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2050.053.060993	15	0.000	Negative
	Ceiling	Plaster	Good	2050.053.060993	16	0.000	Negative
	Wall (upper)	Drywall	Good	2050.053.051793	14	0.000	Negative
	Ceiling	Drywall	Good	2050.053.051793	15	0.000	Negative
APT #2051							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2051.053.061093	1	0.000	Negative.
	Ceiling	Concrete/Block		Good 2051.053.061093	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2051.053.061093	11	0.000	Negative
	Ceiling	Plaster	Good	2051.053.061093	12	0.000	Negative
	Tread	Wood	Fair	2051.053.061093	19	0.000	Negative
	Baseboard	Wood	Good	2051.053.061093	20	0.000	Negative
	Banister rail	Wood	Good	2051.053.061093	21	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
KITCHEN							
	Wall (upper)	Plaster	Good	2051.053.061093	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2051.053.061093	5	0.000	Negative
	Cab door	Wood	Good	2051.053.061093	7	0.200	Negative
	Cab Shelf	Wood	Good	2051.053.061093	9	0.000	Negative
	Cab End Panel	Wood	Good	2051.053.061093	10	0.400	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2051.053.061093	13	0.000	Negative
	Ceiling	Plaster	Good	2051.053.061093	14	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2051.053.061093	15	0.000	Negative
	Ceiling	Plaster	Good	2051.053.061093	16	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2051.053.061093	17	0.000	Negative
	Door trim	Plaster	Good	2051.053.061093	18	0.000	Negative
APT #2052							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2052.053.060993	1	0.200	Negative
	Ceiling	Concrete/Block		Good 2052.053.060993	3	0.000	Negative
	Wall (upper)	Drywall	Good	2052.053.051793	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2052.053.051793	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2052.053.060993	7	0.100	Negative
	Ceiling	Plaster	Good	2052.053.060993	8	0.000	Negative
	Tread	Wood	Fair	2052.053.060993	15	0.300	Negative
	Baseboard	Wood	Fair	2052.053.060993	16	0.200	Negative
	Banister rail	Wood	Good	2052.053.060993	17	0.100	Negative
	Wall (upper)	Drywall	Good	2052.053.051793	8	0.106	Negative
	Ceiling	Drywall	Good	2052.053.051793	9	0.000	Negative
	Tread	Wood	Fair	2052.053.051793	16	0.000	Negative
	Baseboard	Wood	Fair	2052.053.051793	17	0.357	Negative
	Banister rail	Wood	Good	2052.053.051793	18	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2052.053.060993	4	0.000	Negative
	Cab door	Wood	Good	2052.053.060993	5	0.000	Negative
	Cab Shelf	Wood	Good	2052.053.060993	6	0.000	Negative
	Wall (upper)	Wood	Good	2052.053.051793	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2052.053.051793	4	0.000	Negative
	Cab door	Wood	Fair	2052.053.051793	5	0.142	Negative
	Cab Shelf	Wood	Fair	2052.053.051793	6	0.355	Negative
	Cab End Panel	Wood	Fair	2052.053.051793	7	0.337	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2052.053.060993	9	0.000	Negative
	Ceiling	Plaster	Good	2052.053.060993	10	0.000	Negative
	Wall (upper)	Drywall	Good	2052.053.051793	10	0.000	Negative
	Ceiling	Drywall	Good	2052.053.051793	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2052.053.060993	11	0.000	Negative
	Ceiling	Plaster	Good	2052.053.060993	12	0.000	Negative
	Wall (upper)	Drywall	Good	2052.053.051793	12	0.000	Negative
	Ceiling	Drywall	Good	2052.053.051793	13	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
BATHROOM #1							
	Wall (upper)	Plaster	Good	2052.053.060993	13	0.000	Negative
	Ceiling	Plaster	Good	2052.053.060993	14	0.000	Negative
	Wall (upper)	Drywall	Good	2052.053.051793	14	0.000	Negative
	Ceiling	Drywall	Good	2052.053.051793	15	0.000	Negative
APT #2054							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2054.053.052093	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2054.053.052093	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2054.053.052093	8	0.000	Negative
	Ceiling	Plaster	Good	2054.053.052093	9	0.000	Negative
	Tread	Wood	Fair	2054.053.052093	16	0.000	Negative
	Baseboard	Wood	Fair	2054.053.052093	17	0.000	Negative
	Banister rail	Wood	Fair	2054.053.052093	18	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2054.053.052093	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2054.053.052093	4	0.000	Negative
	Cab door	Wood	Good	2054.053.052093	5	0.000	Negative
	Cab Shelf	Wood	Fair	2054.053.052093	6	0.397	Negative
	Cab End Panel	Wood	Fair	2054.053.052093	7	0.384	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2054.053.052093	10	0.000	Negative
	Ceiling	Plaster	Good	2054.053.052093	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2054.053.052093	12	0.000	Negative
	Ceiling	Plaster	Good	2054.053.052093	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2054.053.052093	14	0.000	Negative
	Ceiling	Plaster	Good	2054.053.052093	15	0.000	Negative
APT #2056							
LIVING ROOM							
	Wall (upper)	Drywall	Good	2056.053.051793	1	0.249	Negative
	Ceiling	Concrete/Block		Good 2056.053.051793	2	0.000	Negative
HALLWAY							
	Wall (upper)	Drywall	Good	2056.053.051793	8	0.000	Negative
	Ceiling	Drywall	Good	2056.053.051793	9	0.000	Negative
	Tread	Wood	Fair	2056.053.051793	16	0.000	Negative
	Baseboard	Wood	Fair	2056.053.051793	17	0.681	Negative
	Banister rail	Wood	Fair	2056.053.051793	18	0.000	Negative
KITCHEN							
	Wall (upper)	Drywall	Good	2056.053.051793	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2056.053.051793	4	0.000	Negative
	Cab door	Wood	Fair	2056.053.051793	5	0.198	Negative
	Cab Shelf	Wood	Fair	2056.053.051793	6	0.251	Negative
	Cab End Panel	Wood	Fair	2056.053.051793	7	0.586	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
BEDROOM #1							
	Wall (upper)	Drywall	Good	2056.053.051793	10	0.000	Negative
	Ceiling	Drywall	Good	2056.053.051793	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Drywall	Good	2056.053.051793	12	0.000	Negative
	Ceiling	Drywall	Good	2056.053.051793	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Drywall	Good	2056.053.051793	14	0.000	Negative
	Ceiling	Drywall	Good	2056.053.051793	15	0.000	Negative
APT #2058							
LIVING ROOM							
	Wall (upper)	Drywall	Good	2058.053.051793	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2058.053.051793	2	0.000	Negative
HALLWAY							
	Wall (upper)	Drywall	Good	2058.053.051793	8	0.000	Negative
	Ceiling	Drywall	Good	2058.053.051793	9	0.000	Negative
	Tread	Wood	Fair	2058.053.051793	16	0.000	Negative
	Baseboard	Wood	Good	2058.053.051793	17	0.587	Negative
	Banister rail	Wood	Good	2058.053.051793	18	0.000	Negative
KITCHEN							
	Cab End Panel	Wood	Fair	2058.053.051793	7	0.370	Negative
	Wall (upper)	Drywall	Good	2058.053.051793	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2058.053.051793	4	0.000	Negative
	Cab door	Wood	Good	2058.053.051793	5	0.085	Negative
	Cab Shelf	Wood	Fair	2058.053.051793	6	0.000	Negative
BEDROOM #1							
	Wall (upper)	Drywall	Good	2058.053.051793	10	0.000	Negative
	Ceiling	Drywall	Good	2058.053.051793	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Drywall	Good	2058.053.051793	12	0.000	Negative
	Ceiling	Drywall	Good	2058.053.051793	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Drywall	Good	2058.053.051793	14	0.096	Negative
	Ceiling	Drywall	Good	2058.053.051793	15	0.000	Negative
APT #2060							
LIVING ROOM							
	Wall (upper)	Drywall	Good	2060.053.051493	20	0.000	Negative
	Ceiling	Concrete/Block		Good 2060.053.051493	21	0.000	Negative
	Wall (upper)	Plaster	Good	2060.053.052593	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2060.053.052593	2	0.248	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
HALLWAY							
	Wall (upper)	Drywall	Good	2060.053.051493	27	0.000	Negative
	Ceiling	Drywall	Good	2060.053.051493	28	0.000	Negative
	Tread	Wood	Fair	2060.053.051493	35	0.000	Negative
	Baseboard	Wood	Fair	2060.053.051493	36	0.113	Negative
	Banister rail	Wood	Fair	2060.053.051493	37	0.000	Negative
	Wall (upper)	Plaster	Good	2060.053.052593	9	0.094	Negative
	Ceiling	Plaster	Good	2060.053.052593	10	0.000	Negative
	Tread	Wood	Fair	2060.053.052593	17	0.000	Negative
	Baseboard	Wood	Fair	2060.053.052593	19	0.290	Negative
	Banister rail	Wood	Fair	2060.053.052593	20	0.000	Negative
KITCHEN							
	Wall (upper)	Drywall	Good	2060.053.051493	22	0.000	Negative
	Ceiling	Concrete/Block		Good 2060.053.051493	23	0.000	Negative
	Cab door	Wood	Good	2060.053.051493	24	0.357	Negative
	Cab Shelf	Wood	Good	2060.053.051493	25	0.120	Negative
	Cab End Panel	Wood	Fair	2060.053.051493	26	0.032	Negative
	Wall (upper)	Plaster	Good	2060.053.052593	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2060.053.052593	4	0.000	Negative
	Cab door	Wood	Good	2060.053.052593	5	0.185	Negative
	Cab Shelf	Wood	Good	2060.053.052593	6	0.069	Negative
	Cab End Panel	Wood	Good	2060.053.052593	8	0.348	Negative
BEDROOM #1							
	Wall (upper)	Drywall	Good	2060.053.051493	29	0.000	Negative
	Ceiling	Drywall	Good	2060.053.051493	30	0.000	Negative
	Wall (upper)	Plaster	Fair	2060.053.052593	11	0.000	Negative
	Ceiling	Plaster	Good	2060.053.052593	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Drywall	Good	2060.053.051493	31	0.000	Negative
	Ceiling	Drywall	Good	2060.053.051493	32	0.000	Negative
	Wall (upper)	Plaster	Good	2060.053.052593	13	0.000	Negative
	Ceiling	Plaster	Good	2060.053.052593	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Drywall	Good	2060.053.051493	33	0.000	Negative
	Ceiling	Drywall	Good	2060.053.051493	34	0.000	Negative
	Wall (upper)	Plaster	Good	2060.053.052593	15	0.000	Negative
	Ceiling	Plaster	Good	2060.053.052593	16	0.075	Negative
APT #2061 LIVING ROOM							
	Wall (upper)	Plaster	Good	2061.053.061193	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2061.053.061193	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2061.053.061193	10	0.000	Negative
	Ceiling	Plaster	Fair	2061.053.061193	11	0.000	Negative
	Tread	Wood	Fair	2061.053.061193	18	0.000	Negative
	Baseboard	Wood	Fair	2061.053.061193	20	0.100	Negative
	Banister rail	Wood	Fair	2061.053.061193	22	0.200	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
KITCHEN							
	Wall (upper)	Plaster	Good	2061.053.061193	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2061.053.061193	4	0.000	Negative
	Cab door	Wood	Fair	2061.053.061193	6	0.100	Negative
	Cab Shelf	Wood	Fair	2061.053.061193	8	0.000	Negative
	Cab End Panel	Wood	Poor	2061.053.061193	9	0.700	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Fair	2061.053.061193	12	0.000	Negative
	Ceiling	Plaster	Good	2061.053.061193	13	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2061.053.061193	14	0.100	Negative
	Ceiling	Plaster	Good	2061.053.061193	15	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Fair	2061.053.061193	16	0.000	Negative
	Ceiling	Plaster	Good	2061.053.061193	17	0.000	Negative
APT #2062							
LIVING ROOM							
	Wall (upper)	Drywall	Good	2062.053.051493	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2062.053.051493	2	0.000	Negative
	Wall (upper)	Plaster	Good	2062.053.052593	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2062.053.052593	2	0.000	Negative
	Wall (upper)	Plaster	Good	2062.053.052593	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2062.053.052593	4	0.000	Negative
	Cab door	Wood	Good	2062.053.052593	5	0.166	Negative
	Cab End Panel	Wood	Good	2062.053.052593	7	0.212	Negative
HALLWAY							
	Wall (upper)	Drywall	Good	2062.053.051493	8	0.000	Negative
	Ceiling	Drywall	Good	2062.053.051493	9	0.000	Negative
	Tread	Wood	Good	2062.053.051493	16	0.000	Negative
	Baseboard	Wood	Fair	2062.053.051493	17	0.923	Inconclusive
	Banister rail	Wood	Fair	2062.053.051493	18	0.000	Negative
	Wall (upper)	Plaster	Good	2062.053.052593	8	0.000	Negative
	Ceiling	Plaster	Good	2062.053.052593	9	0.000	Negative
	Tread	Wood	Fair	2062.053.052593	16	0.000	Negative
	Baseboard	Wood	Fair	2062.053.052593	17	0.367	Negative
	Banister rail	Wood	Fair	2062.053.052593	18	0.000	Negative
KITCHEN							
	Wall (upper)	Drywall	Good	2062.053.051493	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2062.053.051493	4	0.000	Negative
	Cab door	Wood	Fair	2062.053.051493	5	0.130	Negative
	Cab Shelf	Wood	Fair	2062.053.051493	6	0.066	Negative
	Cab End Panel	Wood	Fair	2062.053.051493	7	0.115	Negative
	Cab Shelf	Wood	Fair	2062.053.052593	6	0.149	Negative
BEDROOM #1							
	Wall (upper)	Drywall	Good	2062.053.051493	10	0.000	Negative
	Ceiling	Drywall	Fair	2062.053.051493	11	0.000	Negative
	Wall (upper)	Plaster	Good	2062.053.052593	10	0.000	Negative
	Ceiling	Plaster	Good	2062.053.052593	11	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
BEDROOM #2							
	Wall (upper)	Drywall	Good	2062.053.051493	12	0.000	Negative
	Ceiling	Drywall	Good	2062.053.051493	13	0.000	Negative
	Wall (upper)	Plaster	Good	2062.053.052593	12	0.000	Negative
	Ceiling	Plaster	Good	2062.053.052593	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Drywall	Good	2062.053.051493	14	0.000	Negative
	Ceiling	Drywall	Good	2062.053.051493	15	0.000	Negative
	Wall (upper)	Plaster	Good	2062.053.052593	14	0.000	Negative
	Ceiling	Plaster	Good	2062.053.052593	15	0.000	Negative
APT #2063							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2063.053.061193	2	0.000	Negative
	Ceiling	Concrete/Block		Good 2063.053.061193	3	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2063.053.061193	10	0.000	Negative
	Ceiling	Plaster	Fair	2063.053.061193	11	0.000	Negative
	Tread	Wood	Poor	2063.053.061193	19	0.000	Negative
	Baseboard	Wood	Good	2063.053.061193	20	0.000	Negative
	Banister rail	Wood	Good	2063.053.061193	21	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2063.053.061193	4	0.000	Negative
	Ceiling	Concrete/Block		Good 2063.053.061193	5	0.000	Negative
	Cab door	Wood	Fair	2063.053.061193	6	0.000	Negative
	Cab Shelf	Wood	Fair	2063.053.061193	8	0.100	Negative
	Cab End Panel	Wood	Fair	2063.053.061193	9	0.400	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2063.053.061193	12	0.000	Negative
	Ceiling	Plaster	Good	2063.053.061193	14	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2063.053.061193	15	0.000	Negative
	Ceiling	Plaster	Good	2063.053.061193	16	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2063.053.061193	17	0.000	Negative
	Ceiling	Plaster	Good	2063.053.061193	18	0.000	Negative
APT #2064							
LIVING ROOM							
	Wall (upper)	Drywall	Good	2064.053.051493	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2064.053.051493	2	0.000	Negative
	Wall (upper)	Plaster	Good	2064.053.052593	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2064.053.052593	2	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
HALLWAY							
	Wall (upper)	Drywall	Good	2064.053.051493	8	0.000	Negative
	Ceiling	Drywall	Good	2064.053.051493	9	0.000	Negative
	Tread	Wood	Fair	2064.053.051493	16	0.000	Negative
	Baseboard	Wood	Fair	2064.053.051493	17	0.393	Negative
	Banister rail	Wood	Good	2064.053.051493	18	0.000	Negative
	Wall (upper)	Plaster	Good	2064.053.052593	8	0.000	Negative
	Ceiling	Plaster	Good	2064.053.052593	9	0.000	Negative
	Tread	Wood	Fair	2064.053.052593	16	0.328	Negative
	Baseboard	Wood	Fair	2064.053.052593	18	0.202	Negative
	Banister rail	Wood	Fair	2064.053.052593	19	0.000	Negative
KITCHEN							
	Wall (upper)	Drywall	Good	2064.053.051493	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2064.053.051493	4	0.000	Negative
	Cab door	Wood	Good	2064.053.051493	5	0.049	Negative
	Cab Shelf	Wood	Good	2064.053.051493	6	0.155	Negative
	Cab End Panel	Wood	Fair	2064.053.051493	7	0.721	Negative
	Wall (upper)	Plaster	Good	2064.053.052593	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2064.053.052593	4	0.000	Negative
	Cab door	Wood	Good	2064.053.052593	5	0.349	Negative
	Cab Shelf	Wood	Fair	2064.053.052593	6	0.281	Negative
	Cab End Panel	Wood	Fair	2064.053.052593	7	0.129	Negative
BEDROOM #1							
	Ceiling	Drywall	Good	2064.053.051493	11	0.000	Negative
	Wall (upper)	Drywall	Good	2064.053.051493	10	0.000	Negative
	Wall (upper)	Plaster	Good	2064.053.052593	10	0.042	Negative
	Ceiling	Plaster	Good	2064.053.052593	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Drywall	Good	2064.053.051493	12	0.000	Negative
	Ceiling	Drywall	Good	2064.053.051493	13	0.000	Negative
	Wall (upper)	Plaster	Good	2064.053.052593	12	0.000	Negative
	Ceiling	Plaster	Good	2064.053.052593	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Drywall	Fair	2064.053.051493	14	0.000	Negative
	Ceiling	Drywall	Good	2064.053.051493	15	0.000	Negative
	Wall (upper)	Plaster	Good	2064.053.052593	14	0.000	Negative
	Ceiling	Plaster	Good	2064.053.052593	15	0.000	Negative
APT #2065							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2065.053.061493	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2065.053.061493	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2065.053.061493	8	0.000	Negative
	Ceiling	Plaster	Good	2065.053.061493	9	0.000	Negative
	Tread	Wood	Good	2065.053.061493	16	0.000	Negative
	Baseboard	Wood	Good	2065.053.061493	18	0.300	Negative
	Banister rail	Wood	Good	2065.053.061493	19	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
KITCHEN							
	Wall (upper)	Plaster	Good	2065.053.061493	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2065.053.061493	4	0.000	Negative
	Cab door	Wood	Good	2065.053.061493	5	0.000	Negative
	Cab Shelf	Wood	Good	2065.053.061493	6	0.000	Negative
	Cab End Panel	Wood	Fair	2065.053.061493	7	0.500	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2065.053.061493	10	0.000	Negative
	Ceiling	Plaster	Good	2065.053.061493	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2065.053.061493	12	0.000	Negative
	Ceiling	Plaster	Good	2065.053.061493	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2065.053.061493	14	0.000	Negative
	Ceiling	Plaster	Good	2065.053.061493	15	0.000	Negative
APT #2066							
LIVING ROOM							
	Wall (upper)	Drywall	Good	2066.053.051493	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2066.053.051493	2	0.000	Negative
	Wall (upper)	Plaster	Good	2066.053.052593	1	0.195	Negative
	Ceiling	Concrete/Block		Good 2066.053.052593	2	0.000	Negative
	Wall (upper)	Plaster	Good	2066.053.052593	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2066.053.052593	2	0.000	Negative
HALLWAY							
	Wall (upper)	Drywall	Good	2066.053.051493	8	0.000	Negative
	Ceiling	Drywall	Good	2066.053.051493	9	0.000	Negative
	Tread	Wood	Good	2066.053.051493	16	0.000	Negative
	Baseboard	Wood	Good	2066.053.051493	17	0.211	Negative
	Banister rail	Wood	Good	2066.053.051493	18	0.000	Negative
	Wall (upper)	Plaster	Fair	2066.053.052593	9	0.000	Negative
	Ceiling	Plaster	Good	2066.053.052593	10	0.000	Negative
	Tread	Wood	Fair	2066.053.052593	17	0.000	Negative
	Baseboard	Wood	Fair	2066.053.052593	19	0.262	Negative
	Banister rail	Wood	Fair	2066.053.052593	20	0.000	Negative
	Wall (upper)	Plaster	Good	2066.053.052593	8	0.000	Negative
	Ceiling	Plaster	Good	2066.053.052593	9	0.000	Negative
	Tread	Wood	Fair	2066.053.052593	16	0.114	Negative
	Baseboard	Wood	Fair	2066.053.052593	18	0.703	Negative
	Banister rail	Wood	Fair	2066.053.052593	19	0.240	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
KITCHEN							
	Wall (upper)	Drywall	Good	2066.053.051493	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2066.053.051493	4	0.000	Negative
	Cab door	Wood	Fair	2066.053.051493	5	0.426	Negative
	Cab Shelf	Wood	Good	2066.053.051493	6	0.035	Negative
	Cab End Panel	Wood	Fair	2066.053.051493	7	0.433	Negative
	Wall (upper)	Plaster	Good	2066.053.052593	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2066.053.052593	4	0.000	Negative
	Cab door	Wood	Good	2066.053.052593	5	0.235	Negative
	Cab Shelf	Wood	Fair	2066.053.052593	6	0.202	Negative
	Cab End Panel	Wood	Fair	2066.053.052593	7	0.334	Negative
	Wall (upper)	Plaster	Good	2066.053.052593	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2066.053.052593	4	0.000	Negative
	Cab door	Wood	Good	2066.053.052593	5	0.000	Negative
	Cab Shelf	Wood	Fair	2066.053.052593	6	0.000	Negative
	Cab End Panel	Wood	Fair	2066.053.052593	7	0.000	Negative
BEDROOM #1							
	Wall (upper)	Drywall	Good	2066.053.051493	10	0.000	Negative
	Ceiling	Drywall	Good	2066.053.051493	11	0.000	Negative
	Wall (upper)	Plaster	Fair	2066.053.052593	11	0.000	Negative
	Ceiling	Plaster	Good	2066.053.052593	12	0.000	Negative
	Wall (upper)	Plaster	Good	2066.053.052593	10	0.000	Negative
	Ceiling	Plaster	Good	2066.053.052593	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Drywall	Good	2066.053.051493	12	0.000	Negative
	Ceiling	Drywall	Good	2066.053.051493	13	0.000	Negative
	Wall (upper)	Plaster	Good	2066.053.052593	13	0.000	Negative
	Ceiling	Plaster	Good	2066.053.052593	14	0.000	Negative
	Wall (upper)	Plaster	Good	2066.053.052593	12	0.000	Negative
	Ceiling	Plaster	Good	2066.053.052593	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Drywall	Good	2066.053.051493	14	0.000	Negative
	Ceiling	Drywall	Good	2066.053.051493	15	0.000	Negative
	Wall (upper)	Plaster	Good	2066.053.052593	15	0.000	Negative
	Ceiling	Plaster	Good	2066.053.052593	16	0.000	Negative
	Wall (upper)	Plaster	Good	2066.053.052593	14	0.000	Negative
	Ceiling	Plaster	Good	2066.053.052593	15	0.000	Negative
APT #2067							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2067.053.061493	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2067.053.061493	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2067.053.061493	8	0.000	Negative
	Ceiling	Plaster	Good	2067.053.061493	10	0.000	Negative
	Tread	Wood	Good	2067.053.061493	17	0.000	Negative
	Baseboard	Wood	Good	2067.053.061493	19	0.300	Negative
	Banister rail	Wood	Good	2067.053.061493	20	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
KITCHEN							
	Cab End Panel	Wood	Good	2067.053.061493	7	0.000	Negative
	Wall (upper)	Plaster	Good	2067.053.061493	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2067.053.061493	4	0.000	Negative
	Cab door	Wood	Good	2067.053.061493	5	0.000	Negative
	Cab Shelf	Wood	Good	2067.053.061493	6	0.000	Negative
	Ceiling	Plaster	Good	2067.053.061493	16	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2067.053.061493	11	0.000	Negative
	Ceiling	Plaster	Good	2067.053.061493	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2067.053.061493	13	0.000	Negative
	Ceiling	Plaster	Good	2067.053.061493	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2067.053.061493	15	0.000	Negative
APT #2068							
LIVING ROOM							
	Wall (upper)	Drywall	Good	2068.053.051393	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2068.053.051393	2	0.000	Negative
HALLWAY							
	Wall (upper)	Drywall	Good	2068.053.051393	8	0.000	Negative
	Ceiling	Drywall	Good	2068.053.051393	9	0.517	Negative
	Tread	Wood	Poor	2068.053.051393	10	0.000	Negative
	Baseboard	Wood	Fair	2068.053.051393	11	0.463	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2068.053.051393	3	0.000	Negative
	Ceiling	Other	Good	2068.053.051393	4	0.000	Negative
	Cab door	Wood	Good	2068.053.051393	5	0.171	Negative
	Cab Shelf	Wood	Good	2068.053.051393	6	0.000	Negative
	Cab End Panel	Wood	Good	2068.053.051393	7	0.306	Negative
BEDROOM #1							
	Wall (upper)	Drywall	Good	2068.053.051393	12	0.000	Negative
	Ceiling	Drywall	Good	2068.053.051393	13	0.000	Negative
BEDROOM #2							
	Wall (upper)	Drywall	Good	2068.053.051393	14	0.000	Negative
	Ceiling	Drywall	Good	2068.053.051393	15	0.191	Negative
BATHROOM #1							
	Wall (upper)	Drywall	Good	2068.053.051393	16	0.000	Negative
	Ceiling	Drywall	Good	2068.053.051393	17	0.000	Negative
APT #2069							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2069.053.061193	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2069.053.061193	2	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
HALLWAY							
	Wall (upper)	Plaster	Good	2069.053.061193	8	0.000	Negative
	Ceiling	Plaster	Good	2069.053.061193	9	0.000	Negative
	Tread	Wood	Poor	2069.053.061193	16	0.000	Negative
	Baseboard	Wood	Good	2069.053.061193	17	0.100	Negative
	Banister rail	Wood	Good	2069.053.061193	18	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2069.053.061193	3	0.000	Negative
	Ceiling	Concrete/Block	Good	2069.053.061193	4	0.000	Negative
	Cab door	Wood	Good	2069.053.061193	5	0.000	Negative
	Cab Shelf	Wood	Fair	2069.053.061193	6	0.100	Negative
	Cab End Panel	Wood	Fair	2069.053.061193	7	0.300	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2069.053.061193	10	0.000	Negative
	Ceiling	Plaster	Good	2069.053.061193	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2069.053.061193	12	0.000	Negative
	Ceiling	Plaster	Good	2069.053.061193	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2069.053.061193	14	0.100	Negative
	Ceiling	Plaster	Good	2069.053.061193	15	0.100	Negative
APT #2070							
LIVING ROOM							
	Wall (upper)	Drywall	Good	2070.053.051393	1	0.000	Negative
	Ceiling	Concrete/Block	Good	2070.053.051393	2	0.000	Negative
	Wall (upper)	Plaster	Good	2070.053.052493	1	0.000	Negative
	Ceiling	Concrete/Block	Good	2070.053.052493	2	0.000	Negative
HALLWAY							
	Wall (upper)	Drywall	Good	2070.053.051393	8	0.000	Negative
	Ceiling	Drywall	Good	2070.053.051393	9	0.000	Negative
	Wall (upper)	Plaster	Good	2070.053.052493	9	0.000	Negative
	Ceiling	Plaster	Good	2070.053.052493	10	0.000	Negative
	Tread	Wood	Good	2070.053.052493	18	0.000	Negative
	Baseboard	Wood	Good	2070.053.052493	19	0.358	Negative
	Banister rail	Wood	Good	2070.053.052493	20	0.000	Negative
KITCHEN							
	Wall (upper)	Drywall	Good	2070.053.051393	3	0.000	Negative
	Ceiling	Concrete/Block	Good	2070.053.051393	4	0.000	Negative
	Cab door	Wood	Good	2070.053.051393	5	0.346	Negative
	Cab Shelf	Wood	Good	2070.053.051393	6	0.195	Negative
	Cab End Panel	Wood	Good	2070.053.051393	7	0.631	Negative
	Wall (upper)	Plaster	Good	2070.053.052493	3	0.000	Negative
	Ceiling	Concrete/Block	Good	2070.053.052493	4	0.000	Negative
	Cab door	Wood	Good	2070.053.052493	6	0.140	Negative
	Cab Shelf	Wood	Good	2070.053.052493	7	0.119	Negative
	Cab End Panel	Wood	Good	2070.053.052493	8	0.433	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
BEDROOM #1							
	Wall (upper)	Drywall	Good	2070.053.051393	10	0.000	Negative
	Ceiling	Plaster	Good	2070.053.051393	11	0.000	Negative
	Wall (upper)	Plaster	Good	2070.053.052493	11	0.000	Negative
	Ceiling	Plaster	Good	2070.053.052493	13	0.000	Negative
BEDROOM #2							
	Wall (upper)	Drywall	Good	2070.053.051393	12	0.000	Negative
	Ceiling	Plaster	Good	2070.053.051393	13	0.000	Negative
	Wall (upper)	Plaster	Good	2070.053.052493	14	0.000	Negative
	Ceiling	Plaster	Good	2070.053.052493	15	0.000	Negative
BATHROOM #1							
	Wall (upper)	Drywall	Good	2070.053.051393	14	0.000	Negative
	Ceiling	Drywall	Good	2070.053.051393	15	0.000	Negative
	Wall (upper)	Plaster	Good	2070.053.052493	16	0.000	Negative
	Ceiling	Plaster	Good	2070.053.052493	17	0.000	Negative
APT #2071							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2071.053.061493	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2071.053.061493	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2071.053.061493	8	0.000	Negative
	Ceiling	Plaster	Good	2071.053.061493	9	0.000	Negative
	Tread	Wood	Good	2071.053.061493	17	0.000	Negative
	Baseboard	Wood	Good	2071.053.061493	18	0.000	Negative
	Banister rail	Wood	Good	2071.053.061493	19	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2071.053.061493	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2071.053.061493	4	0.000	Negative
	Cab door	Wood	Good	2071.053.061493	5	0.000	Negative
	Cab Shelf	Wood	Good	2071.053.061493	6	0.000	Negative
	Cab End Panel	Wood	Good	2071.053.061493	7	0.300	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2071.053.061493	10	0.000	Negative
	Ceiling	Plaster	Good	2071.053.061493	11	0.200	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2071.053.061493	12	0.000	Negative
	Ceiling	Plaster	Good	2071.053.061493	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Fair	2071.053.061493	14	0.000	Negative
	Ceiling	Plaster	Good	2071.053.061493	15	0.000	Negative
APT #2072							
LIVING ROOM							
	Wall (upper)	Drywall	Good	2072.053.051393	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2072.053.051393	2	0.000	Negative
	Wall (upper)	Plaster	Good	2072.053.502493	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2072.053.502493	2	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
HALLWAY							
	Wall (upper)	Drywall	Good	2072.053.051393	8	0.000	Negative
	Ceiling	Drywall	Good	2072.053.051393	9	0.000	Negative
	Tread	Wood	Poor	2072.053.051393	10	0.000	Negative
	Baseboard	Wood	Poor	2072.053.051393	11	1.117	Inconclusive
	Wall (upper)	Plaster	Good	2072.053.502493	9	0.000	Negative
	Ceiling	Plaster	Good	2072.053.502493	10	0.000	Negative
	Tread	Wood	Good	2072.053.502493	18	0.000	Negative
	Baseboard	Wood	Good	2072.053.502493	19	0.041	Negative
	Banister rail	Wood	Good	2072.053.502493	20	0.000	Negative
KITCHEN							
	Wall (upper)	Drywall	Fair	2072.053.051393	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2072.053.051393	4	0.000	Negative
	Cab door	Wood	Fair	2072.053.051393	5	0.000	Negative
	Cab Shelf	Wood	Fair	2072.053.051393	6	0.189	Negative
	Cab End Panel	Wood	Fair	2072.053.051393	7	0.172	Negative
	Cab door	Wood	Good	2072.053.502493	6	0.000	Negative
	Wall (upper)	Plaster	Good	2072.053.502493	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2072.053.502493	4	0.000	Negative
	Cab Shelf	Wood	Good	2072.053.502493	7	0.355	Negative
	Cab End Panel	Wood	Good	2072.053.502493	8	0.322	Negative
BEDROOM #1							
	Wall (upper)	Drywall	Good	2072.053.051393	12	0.000	Negative
	Ceiling	Drywall	Good	2072.053.051393	13	0.000	Negative
	Wall (upper)	Plaster	Good	2072.053.502493	11	0.000	Negative
	Ceiling	Plaster	Good	2072.053.502493	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Drywall	Good	2072.053.051393	14	0.000	Negative
	Ceiling	Drywall	Poor	2072.053.051393	15	0.000	Negative
	Wall (upper)	Plaster	Good	2072.053.502493	13	0.000	Negative
	Ceiling	Plaster	Good	2072.053.502493	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Drywall	Good	2072.053.051393	16	0.000	Negative
	Ceiling	Drywall	Good	2072.053.051393	17	0.000	Negative
	Wall (upper)	Plaster	Good	2072.053.502493	15	0.000	Negative
	Ceiling	Plaster	Good	2072.053.502493	17	0.000	Negative
APT #2073							
LIVING ROOM							
	Wall (upper)	Plaster	Poor	2073.053.061493	1	0.000	Negative
	Ceiling	Concrete/Block		Poor 2073.053.061493	2	0.100	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2073.053.061493	10	0.000	Negative
	Ceiling	Plaster	Good	2073.053.061493	11	0.000	Negative
	Tread	Wood	Fair	2073.053.061493	18	0.000	Negative
	Baseboard	Wood	Fair	2073.053.061493	20	0.100	Negative
	Banister rail	Wood	Fair	2073.053.061493	21	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
KITCHEN							
	Wall (upper)	Plaster	Poor	2073.053.061493	3	0.000	Negative
	Ceiling	Concrete/Block		Poor 2073.053.061493	4	0.000	Negative
	Cab door	Wood	Poor	2073.053.061493	6	0.000	Negative
	Cab Shelf	Wood	Poor	2073.053.061493	7	0.000	Negative
	Cab End Panel	Wood	Poor	2073.053.061493	9	0.400	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Fair	2073.053.061493	12	0.000	Negative
	Ceiling	Plaster	Fair	2073.053.061493	13	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2073.053.061493	14	0.000	Negative
	Ceiling	Plaster	Good	2073.053.061493	15	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2073.053.061493	16	0.000	Negative
	Ceiling	Plaster	Good	2073.053.061493	17	0.000	Negative
APT #2074							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2074.053.052493	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2074.053.052493	2	0.344	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2074.053.052493	9	0.000	Negative
	Ceiling	Plaster	Good	2074.053.052493	10	0.000	Negative
	Tread	Wood	Good	2074.053.052493	17	0.000	Negative
	Baseboard	Wood	Fair	2074.053.052493	18	0.051	Negative
	Banister rail	Wood	Fair	2074.053.052493	19	0.221	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2074.053.052493	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2074.053.052493	4	0.000	Negative
	Cab door	Wood	Good	2074.053.052493	6	0.259	Negative
	Cab Shelf	Wood	Good	2074.053.052493	7	0.000	Negative
	Cab End Panel	Wood	Good	2074.053.052493	8	0.312	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2074.053.052493	11	0.000	Negative
	Ceiling	Plaster	Good	2074.053.052493	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2074.053.052493	13	0.000	Negative
	Ceiling	Plaster	Good	2074.053.052493	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Fair	2074.053.052493	15	0.000	Negative
	Ceiling	Plaster	Fair	2074.053.052493	16	0.000	Negative
APT #2075							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2075.053.061493	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2075.053.061493	2	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
HALLWAY							
	Wall (upper)	Plaster	Fair	2075.053.061493	9	0.000	Negative
	Ceiling	Plaster	Fair	2075.053.061493	10	0.000	Negative
	Tread	Wood	Good	2075.053.061493	18	0.000	Negative
	Baseboard	Wood	Good	2075.053.061493	19	0.000	Negative
	Banister rail	Wood	Good	2075.053.061493	20	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2075.053.061493	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2075.053.061493	4	0.000	Negative
	Cab door	Wood	Good	2075.053.061493	6	0.200	Negative
	Cab Shelf	Wood	Good	2075.053.061493	7	0.000	Negative
	Cab End Panel	Wood	Good	2075.053.061493	8	0.100	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2075.053.061493	11	0.000	Negative
	Ceiling	Plaster	Good	2075.053.061493	12	0.100	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2075.053.061493	13	0.000	Negative
	Ceiling	Plaster	Good	2075.053.061493	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Fair	2075.053.061493	16	0.000	Negative
	Ceiling	Plaster	Good	2075.053.061493	17	0.000	Negative
APT #2076							
LIVING ROOM							
	Wall (upper)	Drywall	Good	2076.053.051393	1	0.000	Negative
	Ceiling	Drywall	Good	2076.053.051393	2	0.000	Negative
	Wall (upper)	Plaster	Good	2076.053.052593	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2076.053.052593	2	0.000	Negative
HALLWAY							
	Wall (upper)	Drywall	Fair	2076.053.051393	8	0.000	Negative
	Ceiling	Drywall	Good	2076.053.051393	9	0.000	Negative
	Wall (upper)	Plaster	Good	2076.053.052593	8	0.000	Negative
	Ceiling	Plaster	Good	2076.053.052593	9	0.000	Negative
	Tread	Wood	Fair	2076.053.052593	14	0.000	Negative
	Baseboard	Wood	Fair	2076.053.052593	15	0.101	Negative
	Banister rail	Wood	Fair	2076.053.052593	16	0.000	Negative
KITCHEN							
	Wall (upper)	Drywall	Fair	2076.053.051393	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2076.053.051393	4	0.000	Negative
	Cab door	Wood	Fair	2076.053.051393	5	0.045	Negative
	Cab Shelf	Wood	Fair	2076.053.051393	6	0.165	Negative
	Cab End Panel	Wood	Poor	2076.053.051393	7	0.313	Negative
	Wall (upper)	Plaster	Good	2076.053.052593	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2076.053.052593	4	0.306	Negative
	Cab door	Wood	Fair	2076.053.052593	5	0.000	Negative
	Cab Shelf	Wood	Fair	2076.053.052593	6	0.000	Negative
	Cab End Panel	Wood	Fair	2076.053.052593	7	0.364	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
BEDROOM #1							
	Wall (upper)	Drywall	Fair	2076.053.051393	10	0.000	Negative
	Ceiling	Drywall	Good	2076.053.051393	11	0.000	Negative
	Wall (upper)	Plaster	Good	2076.053.052593	17	0.002	Negative
	Ceiling	Plaster	Good	2076.053.052593	18	0.000	Negative
BEDROOM #2							
	Wall (upper)	Drywall	Fair	2076.053.051393	12	0.000	Negative
	Ceiling	Drywall	Good	2076.053.051393	13	0.000	Negative
	Wall (upper)	Plaster	Good	2076.053.052593	10	0.000	Negative
	Ceiling	Plaster	Good	2076.053.052593	11	0.000	Negative
BATHROOM #1							
	Wall (upper)	Drywall	Good	2076.053.051393	14	0.000	Negative
	Ceiling	Drywall	Good	2076.053.051393	15	0.000	Negative
	Wall (upper)	Plaster	Good	2076.053.052593	12	0.000	Negative
	Ceiling	Plaster	Good	2076.053.052593	13	0.000	Negative
APT #2077							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2077.053.061193	1	0.100	Negative
	Ceiling	Concrete/Block		Good 2077.053.061193	3	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2077.053.061193	9	0.000	Negative
	Ceiling	Plaster	Good	2077.053.061193	10	0.000	Negative
	Tread	Wood	Poor	2077.053.061193	17	0.000	Negative
	Baseboard	Wood	Fair	2077.053.061193	19	1.000	Inconclusive
	Banister rail	Wood	Good	2077.053.061193	20	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2077.053.061193	4	0.000	Negative
	Ceiling	Concrete/Block		Good 2077.053.061193	5	0.000	Negative
	Cab door	Wood	Good	2077.053.061193	6	0.200	Negative
	Cab Shelf	Wood	Fair	2077.053.061193	7	0.100	Negative
	Cab End Panel	Wood	Fair	2077.053.061193	8	0.300	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2077.053.061193	11	0.000	Negative
	Ceiling	Plaster	Good	2077.053.061193	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2077.053.061193	13	0.000	Negative
	Ceiling	Plaster	Good	2077.053.061193	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2077.053.061193	15	0.000	Negative
	Ceiling	Plaster	Good	2077.053.061193	16	0.000	Negative
APT #2078							
LIVING ROOM							
	Wall (upper)	Drywall	Good	2078.053.051393	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2078.053.051393	2	0.000	Negative
	Wall (upper)	Plaster	Good	2078.053.052593	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2078.053.052593	2	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
HALLWAY							
	Wall (upper)	Drywall	Good	2078.053.051393	8	0.000	Negative
	Ceiling	Drywall	Good	2078.053.051393	9	0.618	Negative
	Tread	Wood	Fair	2078.053.051493	1	0.000	Negative
	Baseboard	Wood	Fair	2078.053.051493	2	0.634	Negative
	Banister rail	Wood	Good	2078.053.051493	3	0.000	Negative
	Wall (upper)	Plaster	Good	2078.053.052593	9	0.004	Negative
	Ceiling	Plaster	Good	2078.053.052593	10	0.000	Negative
	Tread	Wood	Good	2078.053.052593	17	0.217	Negative
	Baseboard	Wood	Good	2078.053.052593	19	0.091	Negative
	Banister rail	Wood	Good	2078.053.052593	20	0.000	Negative
KITCHEN							
	Wall (upper)	Drywall	Good	2078.053.051393	3	0.000	Negative
	Ceiling	Concrete/Block	Good	2078.053.051393	4	0.000	Negative
	Cab door	Wood	Good	2078.053.051393	5	0.018	Negative
	Cab Shelf	Wood	Good	2078.053.051393	6	0.071	Negative
	Cab End Panel	Wood	Good	2078.053.051393	7	0.445	Negative
	Wall (upper)	Plaster	Good	2078.053.052593	3	0.000	Negative
	Ceiling	Concrete/Block	Good	2078.053.052593	4	0.127	Negative
	Cab door	Wood	Good	2078.053.052593	5	0.115	Negative
	Cab Shelf	Wood	Good	2078.053.052593	6	0.202	Negative
	Cab End Panel	Wood	Fair	2078.053.052593	8	0.368	Negative
BEDROOM #1							
	Wall (upper)	Drywall	Good	2078.053.051493	4	0.000	Negative
	Ceiling	Drywall	Good	2078.053.051493	5	0.000	Negative
	Wall (upper)	Plaster	Good	2078.053.052593	11	0.000	Negative
	Ceiling	Plaster	Good	2078.053.052593	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Drywall	Good	2078.053.051493	6	0.000	Negative
	Ceiling	Drywall	Good	2078.053.051493	7	0.000	Negative
	Wall (upper)	Plaster	Good	2078.053.052593	13	0.000	Negative
	Ceiling	Plaster	Good	2078.053.052593	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Drywall	Good	2078.053.051493	8	0.000	Negative
	Ceiling	Drywall	Good	2078.053.051493	9	0.000	Negative
	Wall (upper)	Plaster	Good	2078.053.052593	15	0.000	Negative
	Ceiling	Plaster	Good	2078.053.052593	16	0.194	Negative
APT #2079							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2079.053.061493	1	0.000	Negative
	Ceiling	Concrete/Block	Good	2079.053.061493	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2079.053.061493	8	0.000	Negative
	Ceiling	Plaster	Good	2079.053.061493	9	0.000	Negative
	Tread	Wood	Fair	2079.053.061493	16	0.000	Negative
	Baseboard	Wood	Good	2079.053.061493	18	0.000	Negative
	Banister rail	Wood	Good	2079.053.061493	19	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
KITCHEN							
	Wall (upper)	Plaster	Fair	2079.053.061493	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2079.053.061493	4	0.000	Negative
	Cab door	Wood	Fair	2079.053.061493	5	0.100	Negative
	Cab Shelf	Wood	Fair	2079.053.061493	6	0.000	Negative
	Cab End Panel	Wood	Fair	2079.053.061493	7	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Fair	2079.053.061493	10	0.000	Negative
	Ceiling	Plaster	Good	2079.053.061493	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Fair	2079.053.061493	12	0.000	Negative
	Ceiling	Plaster	Good	2079.053.061493	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2079.053.061493	14	0.000	Negative
	Ceiling	Plaster	Good	2079.053.061493	15	0.000	Negative
APT #2080							
LIVING ROOM							
	Wall (upper)	Drywall	Good	2080.053.051393	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2080.053.051393	2	0.000	Negative
	Wall (upper)	Wood	Good	2080.053.060893	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2080.053.060893	2	0.000	Negative
HALLWAY							
	Wall (upper)	Drywall	Fair	2080.053.051393	8	0.000	Negative
	Ceiling	Concrete/Block		Good 2080.053.051393	9	0.000	Negative
	Wall (upper)	Plaster	Good	2080.053.060893	9	0.100	Negative
	Ceiling	Plaster	Poor	2080.053.060893	10	0.000	Negative
	Tread	Wood	Fair	2080.053.060893	17	0.000	Negative
	Baseboard	Wood	Fair	2080.053.060893	18	0.200	Negative
	Banister rail	Wood	Good	2080.053.060893	19	0.000	Negative
KITCHEN							
	Wall (upper)	Drywall	Good	2080.053.051393	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2080.053.051393	4	0.000	Negative
	Cab door	Wood	Good	2080.053.051393	5	0.000	Negative
	Cab Shelf	Wood	Poor	2080.053.051393	6	0.000	Negative
	Cab End Panel	Wood	Fair	2080.053.051393	7	0.213	Negative
	Cab Shelf	Wood	Good	2080.053.060893	7	0.200	Negative
	Wall (upper)	Plaster	Good	2080.053.060893	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2080.053.060893	4	0.000	Negative
	Cab door	Wood	Good	2080.053.060893	6	0.100	Negative
	Cab End Panel	Wood	Fair	2080.053.060893	8	0.400	Negative
BEDROOM #1							
	Wall (upper)	Drywall	Good	2080.053.051393	10	0.000	Negative
	Ceiling	Drywall	Good	2080.053.051393	11	0.000	Negative
	Wall (upper)	Plaster	Good	2080.053.060893	11	0.000	Negative
	Ceiling	Plaster	Good	2080.053.060893	12	0.100	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
BEDROOM #2							
	Wall (upper)	Drywall	Good	2080.053.051393	12	0.000	Negative
	Ceiling	Drywall	Good	2080.053.051393	13	0.000	Negative
	Wall (upper)	Plaster	Fair	2080.053.060893	13	0.000	Negative
	Ceiling	Plaster	Good	2080.053.060893	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Drywall	Good	2080.053.051393	14	0.000	Negative
	Ceiling	Drywall	Good	2080.053.051393	15	0.000	Negative
	Wall (upper)	Plaster	Good	2080.053.060893	15	0.000	Negative
	Ceiling	Plaster	Good	2080.053.060893	16	0.000	Negative
APT #2081							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2081.053.061193	1	0.000	Negative
	Ceiling	Concrete/Block	Good	2081.053.061193	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2081.053.061193	8	0.000	Negative
	Ceiling	Plaster	Good	2081.053.061193	9	0.000	Negative
	Tread	Wood	Fair	2081.053.061193	16	0.000	Negative
	Baseboard	Wood	Good	2081.053.061193	17	0.000	Negative
	Banister rail	Wood	Good	2081.053.061193	18	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2081.053.061193	3	0.000	Negative
	Ceiling	Concrete/Block	Good	2081.053.061193	4	0.000	Negative
	Cab door	Wood	Good	2081.053.061193	5	0.100	Negative
	Cab Shelf	Wood	Fair	2081.053.061193	6	0.000	Negative
	Cab End Panel	Wood	Fair	2081.053.061193	7	0.500	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2081.053.061193	10	0.000	Negative
	Ceiling	Plaster	Good	2081.053.061193	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2081.053.061193	12	0.000	Negative
	Ceiling	Plaster	Good	2081.053.061193	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2081.053.061193	14	0.000	Negative
	Ceiling	Plaster	Good	2081.053.061193	15	0.000	Negative
APT #2082							
LIVING ROOM							
	Wall (upper)	Drywall	Fair	2082.053.051293	1	0.000	Negative
	Ceiling	Concrete/Block	Good	2082.053.051293	2	0.000	Negative
	Wall (upper)	Plaster	Fair	2082.053.052593	1	0.000	Negative
	Ceiling	Concrete/Block	Fair	2082.053.052593	2	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
HALLWAY							
	Wall (upper)	Drywall	Fair	2082.053.051293	8	0.000	Negative
	Ceiling	Drywall	Fair	2082.053.051293	9	0.000	Negative
	Wall (upper)	Plaster	Fair	2082.053.052593	9	0.000	Negative
	Ceiling	Plaster	Good	2082.053.052593	10	0.000	Negative
	Tread	Wood	Good	2082.053.052593	17	0.000	Negative
	Baseboard	Wood	Good	2082.053.052593	18	0.091	Negative
	Banister rail	Wood	Good	2082.053.52593	20	0.150	Negative
KITCHEN							
	Wall (upper)	Drywall	Fair	2082.053.051293	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2082.053.051293	4	0.000	Negative
	Cab door	Wood	Good	2082.053.051293	5	0.000	Negative
	Cab Shelf	Wood	Fair	2082.053.051293	6	0.000	Negative
	Cab End Panel	Wood	Fair	2082.053.051293	7	0.543	Negative
	Wall (upper)	Plaster	Good	2082.053.052593	3	0.195	Negative
	Ceiling	Concrete/Block		Good 2082.053.052593	4	0.000	Negative
	Cab door	Wood	Fair	2082.053.052593	5	0.020	Negative
	Cab Shelf	Wood	Fair	2082.053.052593	6	0.046	Negative
	Cab End Panel	Wood	Fair	2082.053.052593	8	0.000	Negative
BEDROOM #1							
	Wall (upper)	Drywall	Fair	2082.053.051293	10	0.000	Negative
	Ceiling	Drywall	Good	2082.053.051293	11	0.000	Negative
	Wall (upper)	Plaster	Good	2082.053.052593	11	0.000	Negative
	Ceiling	Plaster	Good	2082.053.052593	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Drywall	Fair	2082.053.051293	12	0.000	Negative
	Ceiling	Drywall	Good	2082.053.051293	13	0.000	Negative
	Wall (upper)	Plaster	Good	2082.053.052593	13	0.000	Negative
	Ceiling	Plaster	Good	2082.053.052593	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Drywall	Fair	2082.053.051293	14	0.000	Negative
	Ceiling	Drywall	Good	2082.053.051293	15	0.000	Negative
	Wall (upper)	Plaster	Good	2082.053.052593	15	0.000	Negative
	Ceiling	Plaster	Good	2082.053.052593	16	0.000	Negative
APT #2083							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2083.053.061493	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2083.053.061493	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2083.053.061493	8	0.000	Negative
	Ceiling	Plaster	Good	2083.053.061493	9	0.000	Negative
	Tread	Wood	Good	2083.053.061493	16	0.100	Negative
	Baseboard	Wood	Good	2083.053.061493	18	0.000	Negative
	Banister rail	Wood	Good	2083.053.061493	19	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
KITCHEN							
	Wall (upper)	Plaster	Good	2083.053.061493	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2083.053.061493	4	0.000	Negative
	Cab door	Wood	Good	2083.053.061493	5	0.200	Negative
	Cab Shelf	Wood	Fair	2083.053.061493	6	0.000	Negative
	Cab End Panel	Wood	Fair	2083.053.061493	7	0.100	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2083.053.061493	10	0.000	Negative
	Ceiling	Plaster	Good	2083.053.061493	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2083.053.061493	12	0.000	Negative
	Ceiling	Plaster	Good	2083.053.061493	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2083.053.061493	14	0.000	Negative
	Ceiling	Plaster	Good	2083.053.061493	15	0.000	Negative
APT #2084							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2084.053.051293	1	0.000	Negative
	Ceiling	Plaster	Good	2084.053.051293	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2084.053.051293	8	0.000	Negative
	Ceiling	Plaster	Good	2084.053.051293	11	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2084.053.051293	3	0.000	Negative
	Ceiling	Plaster	Good	2084.053.051293	4	0.000	Negative
	Cab door	Wood	Good	2084.053.051293	5	0.149	Negative
	Cab Shelf	Wood	Good	2084.053.051293	6	0.170	Negative
	Cab End Panel	Wood	Good	2084.053.051293	7	0.388	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2084.053.051293	11	0.000	Negative
	Ceiling	Plaster	Good	2084.053.051293	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2084.053.051293	13	0.000	Negative
	Ceiling	Plaster	Good	2084.053.051293	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2084.053.051293	15	0.000	Negative
	Ceiling	Plaster	Good	2084.053.051293	16	0.000	Negative
APT #2086							
LIVING ROOM							
	Wall (upper)	Drywall	Good	2086.053.051293	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2086.053.051293	2	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
HALLWAY							
	Wall (upper)	Drywall	Good	2086.053.051293	8	0.000	Negative
	Ceiling	Drywall	Poor	2086.053.051293	9	0.000	Negative
KITCHEN							
	Wall (upper)	Drywall	Fair	2086.053.051293	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2086.053.051293	4	0.000	Negative
	Cab door	Wood	Fair	2086.053.051293	5	0.000	Negative
	Cab Shelf	Wood	Fair	2086.053.051293	6	0.315	Negative
	Cab End Panel	Wood	Fair	2086.053.051293	7	0.276	Negative
BEDROOM #1							
	Wall (upper)	Drywall	Good	2086.053.051293	10	0.000	Negative
	Ceiling	Drywall	Good	2086.053.051293	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Drywall	Good	2086.053.051293	12	0.000	Negative
	Ceiling	Drywall	Good	2086.053.051293	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Drywall	Fair	2086.053.051293	14	0.000	Negative
	Ceiling	Drywall	Good	2086.053.051293	15	0.000	Negative
APT #2088							
LIVING ROOM							
	Wall (upper)	Drywall	Good	2088.053.051293	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2088.053.051293	2	0.000	Negative
HALLWAY							
	Wall (upper)	Drywall	Poor	2088.053.051293	8	0.000	Negative
	Ceiling	Drywall	Fair	2088.053.051293	9	0.000	Negative
KITCHEN							
	Wall (upper)	Drywall	Good	2088.053.051293	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2088.053.051293	4	0.000	Negative
	Cab door	Wood	Good	2088.053.051293	5	0.017	Negative
	Cab Shelf	Wood	Good	2088.053.051293	6	0.384	Negative
	Cab End Panel	Wood	Good	2088.053.051293	7	0.785	Negative
BEDROOM #1							
	Wall (upper)	Drywall	Poor	2088.053.051293	10	0.000	Negative
	Ceiling	Drywall	Good	2088.053.051293	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Drywall	Good	2088.053.051293	12	0.000	Negative
	Ceiling	Drywall	Good	2088.053.051293	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Drywall	Good	2088.053.051293	14	0.001	Negative
	Ceiling	Drywall	Good	2088.053.051293	15	0.017	Negative
APT #2090							
LIVING ROOM							
	Wall (upper)	Drywall	Good	2090.053.051293	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2090.053.051293	2	0.000	Negative
HALLWAY							
	Wall (upper)	Drywall	Fair	2090.053.051293	8	0.000	Negative
	Ceiling	Drywall	Good	2090.053.051293	9	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
KITCHEN							
	Wall (upper)	Drywall	Good	2090.053.051293	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2090.053.051293	4	0.000	Negative
	Cab door	Wood	Fair	2090.053.051293	5	0.000	Negative
	Cab Shelf	Wood	Poor	2090.053.051293	6	0.399	Negative
	Cab End Panel	Wood	Fair	2090.053.051293	7	0.690	Negative
BEDROOM #1							
	Wall (upper)	Drywall	Fair	2090.053.051293	11	0.000	Negative
	Ceiling	Drywall	Good	2090.053.051293	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Drywall	Good	2090.053.051293	13	0.000	Negative
	Ceiling	Drywall	Good	2090.053.051293	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Drywall	Good	2090.053.051293	15	0.000	Negative
	Ceiling	Drywall	Good	2090.053.051293	16	0.000	Negative
APT #2092							
LIVING ROOM							
	Wall (upper)	Drywall	Poor	2092.053.051193	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2092.053.051193	2	0.000	Negative
HALLWAY							
	Wall (upper)	Drywall	Fair	2092.053.051193	8	0.000	Negative
	Ceiling	Drywall	Good	2092.053.051193	9	0.000	Negative
KITCHEN							
	Wall (upper)	Drywall	Poor	2092.053.051193	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2092.053.051193	4	0.000	Negative
	Cab door	Wood	Good	2092.053.051193	5	0.375	Negative
	Cab Shelf	Wood	Good	2092.053.051193	6	0.385	Negative
	Cab End Panel	Wood	Good	2092.053.051193	7	0.256	Negative
BEDROOM #1							
	Wall (upper)	Drywall	Fair	2092.053.051193	10	0.000	Negative
	Ceiling	Drywall	Good	2092.053.051193	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Drywall	Fair	2092.053.051193	12	0.000	Negative
	Ceiling	Drywall	Good	2092.053.051193	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Drywall	Good	2092.053.051193	14	0.000	Negative
	Ceiling	Drywall	Good	2092.053.051193	15	0.000	Negative
APT #2094							
LIVING ROOM							
	Wall (upper)	Drywall	Good	2094.053.051193	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2094.053.051193	2	0.000	Negative
HALLWAY							
	Wall (upper)	Drywall	Good	2094.053.051193	8	0.000	Negative
	Ceiling	Drywall	Good	2094.053.051193	9	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
KITCHEN							
	Wall (upper)	Drywall	Fair	2094.053.051193	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2094.053.051193	4	0.000	Negative
	Cab door	Wood	Fair	2094.053.051193	5	0.196	Negative
	Cab Shelf	Wood	Good	2094.053.051193	6	0.478	Negative
	Cab End Panel	Wood	Fair	2094.053.051193	7	0.000	Negative
BEDROOM #1							
	Wall (upper)	Drywall	Good	2094.053.051193	10	0.000	Negative
	Ceiling	Drywall	Good	2094.053.051193	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Drywall	Good	2094.053.051193	12	0.000	Negative
	Ceiling	Drywall	Good	2094.053.051193	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Drywall	Good	2094.053.051193	14	0.000	Negative
	Ceiling	Drywall	Good	2094.053.051193	15	0.000	Negative
APT #2096							
LIVING ROOM							
	Wall (upper)	Drywall	Fair	2096.053.051193	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2096.053.051193	2	0.000	Negative
HALLWAY							
	Wall (upper)	Drywall	Good	2096.053.051193	8	0.000	Negative
	Ceiling	Drywall	Good	2096.053.051193	9	0.000	Negative
KITCHEN							
	Wall (upper)	Drywall	Fair	2096.053.051193	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2096.053.051193	4	0.000	Negative
	Cab door	Wood	Good	2096.053.051193	5	0.111	Negative
	Cab Shelf	Wood	Good	2096.053.051193	6	0.000	Negative
	Cab End Panel	Wood	Fair	2096.053.051193	7	0.536	Negative
BEDROOM #1							
	Wall (upper)	Drywall	Fair	2096.053.051193	10	0.000	Negative
	Ceiling	Drywall	Good	2096.053.051193	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Drywall	Good	2096.053.051193	12	0.000	Negative
	Ceiling	Drywall	Good	2096.053.051193	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Drywall	Good	2096.053.051193	14	0.000	Negative
	Ceiling	Drywall	Good	2096.053.051193	15	0.000	Negative
APT #2098							
LIVING ROOM							
	Wall (upper)	Drywall	Good	2098.053.051193	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2098.053.051193	2	0.000	Negative
HALLWAY							
	Wall (upper)	Drywall	Fair	2098.053.051193	8	0.000	Negative
	Ceiling	Drywall	Good	2098.053.051193	9	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
KITCHEN							
	Wall (upper)	Drywall	Fair	2098.053.051193	3	0.000	Negative
	Ceiling	Concrete/Block		Fair 2098.053.051193	4	0.000	Negative
	Cab door	Wood	Good	2098.053.051193	5	0.423	Negative
	Cab Shelf	Wood	Poor	2098.053.051193	6	0.291	Negative
	Cab End Panel	Wood	Poor	2098.053.051193	7	0.648	Negative
BEDROOM #1							
	Wall (upper)	Drywall	Poor	2098.053.051193	10	0.000	Negative
	Ceiling	Drywall	Fair	2098.053.051193	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Drywall	Fair	2098.053.051193	12	0.000	Negative
	Ceiling	Drywall	Good	2098.053.051193	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Drywall	Good	2098.053.051193	14	0.000	Negative
	Ceiling	Drywall	Good	2098.053.051193	15	0.000	Negative
APT #2100							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2100.053.062293	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2100.053.062293	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2100.053.062293	10	0.000	Negative
	Ceiling	Plaster	Good	2100.053.062293	11	0.000	Negative
	Tread	Wood	Good	2100.053.062293	18	0.000	Negative
	Baseboard	Wood	Good	2100.053.062293	20	0.500	Negative
	Banister rail	Wood	Good	2100.053.062293	21	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2100.053.062293	4	0.300	Negative
	Ceiling	Concrete/Block		Good 2100.053.062293	5	0.100	Negative
	Cab door	Wood	Good	2100.053.062293	6	0.000	Negative
	Cab Shelf	Wood	Good	2100.053.062293	7	0.100	Negative
	Cab End Panel	Wood	Good	2100.053.062293	9	0.100	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2100.053.062293	12	0.000	Negative
	Ceiling	Plaster	Good	2100.053.062293	13	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2100.053.062293	14	0.000	Negative
	Ceiling	Plaster	Good	2100.053.062293	15	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2100.053.062293	16	0.000	Negative
	Ceiling	Plaster	Good	2100.053.062293	17	0.000	Negative
APT #2101							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2101.053.061693	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2101.053.061693	2	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
HALLWAY							
	Wall (upper)	Plaster	Good	2101.053.061693	8	0.000	Negative
	Ceiling	Plaster	Poor	2101.053.061693	9	0.000	Negative
	Tread	Wood	Fair	2101.053.061693	17	0.000	Negative
	Baseboard	Wood	Fair	2101.053.061693	19	1.800	Positive
	Banister rail	Wood	Fair	2101.053.061693	20	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Fair	2101.053.061693	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2101.053.061693	4	0.000	Negative
	Cab door	Wood	Fair	2101.053.061693	5	0.000	Negative
	Cab Shelf	Wood	Fair	2101.053.061693	6	0.000	Negative
	Cab End Panel	Wood	Fair	2101.053.061693	7	0.300	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Fair	2101.053.061693	10	0.000	Negative
	Ceiling	Plaster	Poor	2101.053.061693	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2101.053.061693	12	0.000	Negative
	Ceiling	Plaster	Good	2101.053.061693	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Fair	2101.053.061693	14	0.000	Negative
	Ceiling	Plaster	Good	2101.053.061693	16	0.000	Negative
APT #2102							
LIVING ROOM							
	Wall (upper)	Plaster	Fair	2102.053.062293	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2102.053.062293	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2102.053.062293	9	0.000	Negative
	Ceiling	Plaster	Good	2102.053.062293	10	0.000	Negative
	Tread	Wood	Poor	2102.053.062293	17	0.000	Negative
	Baseboard	Wood	Fair	2102.053.062293	19	0.400	Negative
	Banister rail	Wood	Fair	2102.053.062293	20	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Fair	2102.053.062293	4	0.600	Negative
	Ceiling	Concrete/Block		Good 2102.053.062293	5	0.000	Negative
	Cab door	Wood	Fair	2102.053.062293	6	0.000	Negative
	Cab Shelf	Wood	Fair	2102.053.062293	7	0.000	Negative
	Cab End Panel	Wood	Fair	2102.053.062293	8	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Fair	2102.053.062293	11	0.000	Negative
	Ceiling	Plaster	Good	2102.053.062293	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Fair	2102.053.062293	13	0.000	Negative
	Ceiling	Plaster	Fair	2102.053.062293	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Fair	2102.053.062293	15	0.000	Negative
	Ceiling	Plaster	Good	2102.053.062293	16	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
APT #2103							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2103.053.061693	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2103.053.061693	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2103.053.061693	8	0.000	Negative
	Ceiling	Plaster	Good	2103.053.061693	9	0.000	Negative
	Tread	Wood	Fair	2103.053.061693	16	0.000	Negative
	Baseboard	Wood	Good	2103.053.061693	18	2.100	Positive
	Banister rail	Wood	Good	2103.053.061693	19	0.000	Negative
KITCHEN							
	Cab Shelf	Wood	Fair	2103.053.061693	6	0.000	Negative
	Wall (upper)	Plaster	Good	2103.053.061693	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2103.053.061693	4	0.000	Negative
	Cab door	Wood	Good	2103.053.061693	5	0.000	Negative
	Cab End Panel	Wood	Fair	2103.053.061693	7	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2103.053.061693	10	0.000	Negative
	Ceiling	Plaster	Good	2103.053.061693	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2103.053.061693	12	0.000	Negative
	Ceiling	Plaster	Good	2103.053.061693	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2103.053.061693	14	0.000	Negative
	Ceiling	Plaster	Good	2103.053.061693	15	0.000	Negative
APT #2104							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2104.053.062293	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2104.053.062293	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2104.053.062293	10	0.000	Negative
	Ceiling	Concrete/Block		Good 2104.053.062293	11	0.000	Negative
	Tread	Wood	Good	2104.053.062293	18	0.000	Negative
	Baseboard	Wood	Good	2104.053.062293	19	0.400	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2104.053.062293	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2104.053.062293	5	0.000	Negative
	Cab door	Wood	Good	2104.053.062293	6	0.000	Negative
	Cab Shelf	Wood	Good	2104.053.062293	7	0.100	Negative
	Cab End Panel	Wood	Good	2104.053.062293	9	0.300	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Fair	2104.053.062293	12	0.000	Negative
	Ceiling	Plaster	Good	2104.053.062293	13	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
BEDROOM #2							
	Wall (upper)	Plaster	Good	2104.053.062293	14	0.000	Negative
	Ceiling	Plaster	Good	2104.053.062293	15	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Poor	2104.053.062293	16	0.000	Negative
	Ceiling	Plaster	Good	2104.053.062293	17	0.000	Negative
APT #2105							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2105.023.062493	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2105.023.062493	3	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2105.023.062493	10	0.000	Negative
	Ceiling	Plaster	Good	2105.023.062493	11	0.000	Negative
	Tread	Wood	Good	2105.023.062493	18	0.000	Negative
	Baseboard	Wood	Good	2105.023.062493	20	2.000	Positive
	Banister rail	Wood	Good	2105.023.062493	21	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2105.023.062493	4	0.000	Negative
	Ceiling	Concrete/Block		Good 2105.023.062493	5	0.000	Negative
	Cab door	Wood	Good	2105.023.062493	6	0.000	Negative
	Cab Shelf	Wood	Good	2105.023.062493	7	0.000	Negative
	Cab End Panel	Wood	Good	2105.023.062493	9	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2105.023.062493	12	0.000	Negative
	Ceiling	Plaster	Good	2105.023.062493	13	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2105.023.062493	14	0.000	Negative
	Ceiling	Plaster	Good	2105.023.062493	15	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2105.023.062493	16	0.000	Negative
	Ceiling	Plaster	Good	2105.023.062493	17	0.000	Negative
APT #2106							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2106.053.062193	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2106.053.062193	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2106.053.062193	9	0.000	Negative
	Ceiling	Plaster	Good	2106.053.062193	10	0.000	Negative
	Tread	Wood	Good	2106.053.062193	17	0.000	Negative
	Baseboard	Wood	Good	2106.053.062193	18	0.200	Negative
	Banister rail	Wood	Good	2106.053.062193	19	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
KITCHEN							
	Ceiling	Concrete/Block		Good 2106.053.062193	5	0.000	Negative
	Wall (upper)	Plaster	Good	2106.053.062193	4	0.700	Negative
	Cab door	Wood	Good	2106.053.062193	6	0.000	Negative
	Cab Shelf	Wood	Fair	2106.053.062193	7	0.000	Negative
	Cab End Panel	Wood	Fair	2106.053.062193	8	0.100	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2106.053.062193	11	0.000	Negative
	Ceiling	Plaster	Good	2106.053.062193	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2106.053.062193	13	0.000	Negative
	Ceiling	Plaster	Good	2106.053.062193	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2106.053.062193	15	0.000	Negative
	Ceiling	Plaster	Good	2106.053.062193	16	0.000	Negative
APT #2107							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2107.053.061693	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2107.053.061693	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2107.053.061693	9	0.000	Negative
	Ceiling	Plaster	Good	2107.053.061693	10	0.000	Negative
	Tread	Wood	Fair	2107.053.061693	17	0.000	Negative
	Baseboard	Wood	Good	2107.053.061693	19	2.400	Positive
	Banister rail	Wood	Good	2107.053.061693	20	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2107.053.061693	4	0.000	Negative
	Ceiling	Concrete/Block		Good 2107.053.061693	5	0.000	Negative
	Cab door	Wood	Good	2107.053.061693	6	0.000	Negative
	Cab Shelf	Wood	Good	2107.053.061693	7	0.000	Negative
	Cab End Panel	Wood	Good	2107.053.061693	8	0.200	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2107.053.061693	11	0.000	Negative
	Ceiling	Plaster	Good	2107.053.061693	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2107.053.061693	13	0.000	Negative
	Ceiling	Plaster	Good	2107.053.061693	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2107.053.061693	15	0.000	Negative
	Ceiling	Plaster	Good	2107.053.061693	16	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
APT #2108							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2108.053.062193	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2108.053.062193	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2108.053.062193	10	0.000	Negative
	Ceiling	Plaster	Good	2108.053.062193	11	0.000	Negative
	Tread	Wood	Poor	2108.053.062193	18	0.000	Negative
	Baseboard	Wood	Poor	2108.053.062193	20	0.300	Negative
	Banister rail	Wood	Poor	2108.053.062193	21	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Fair	2108.053.062193	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2108.053.062193	4	0.000	Negative
	Cab door	Wood	Fair	2108.053.062193	6	0.200	Negative
	Cab Shelf	Wood	Poor	2108.053.062193	7	0.000	Negative
	Cab End Panel	Wood	Poor	2108.053.062193	9	0.600	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Fair	2108.053.062193	12	0.000	Negative
	Ceiling	Plaster	Good	2108.053.062193	13	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Fair	2108.053.062193	14	0.000	Negative
	Ceiling	Plaster	Good	2108.053.062193	15	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Poor	2108.053.062193	16	0.000	Negative
	Ceiling	Plaster	Good	2108.053.062193	17	0.000	Negative
APT #2109							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2109.053.061693	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2109.053.061693	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2109.053.061693	9	0.000	Negative
	Ceiling	Plaster	Good	2109.053.061693	10	0.000	Negative
	Tread	Wood	Fair	2109.053.061693	17	0.000	Negative
	Baseboard	Wood	Good	2109.053.061693	18	2.100	Positive
	Banister rail	Wood	Good	2109.053.061693	19	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2109.053.061693	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2109.053.061693	4	0.100	Negative
	Cab door	Wood	Good	2109.053.061693	6	0.000	Negative
	Cab Shelf	Wood	Fair	2109.053.061693	7	0.000	Negative
	Cab End Panel	Wood	Fair	2109.053.061693	8	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
BEDROOM #1							
	Wall (upper)	Plaster	Good	2109.053.061693	11	0.000	Negative
	Ceiling	Plaster	Good	2109.053.061693	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2109.053.061693	13	0.000	Negative
	Ceiling	Plaster	Good	2109.053.061693	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2109.053.061693	15	0.000	Negative
	Ceiling	Plaster	Good	2109.053.061693	16	0.000	Negative
APT #2110							
LIVING ROOM							
	Wall (upper)	Drywall	Good	2110.053.051293	8	0.000	Negative
	Ceiling	Concrete/Block		Good 2110.053.051293	9	0.000	Negative
	Wall (upper)	Plaster	Good	2110.053.062293	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2110.053.062293	2	0.000	Negative
HALLWAY							
	Wall (upper)	Drywall	Good	2110.053.051293	6	0.000	Negative
	Ceiling	Drywall	Good	2110.053.051293	7	0.000	Negative
	Wall (upper)	Plaster	Good	2110.053.062293	9	0.000	Negative
	Ceiling	Plaster	Good	2110.053.062293	10	0.000	Negative
	Tread	Wood	Good	2110.053.062293	17	0.000	Negative
	Baseboard	Wood	Good	2110.053.062293	19	0.200	Negative
	Banister rail	Wood	Good	2110.053.062293	20	0.000	Negative
KITCHEN							
	Wall (upper)	Drywall	Good	2110.053.051293	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2110.053.051293	2	0.000	Negative
	Cab door	Wood	Good	2110.053.051293	3	0.246	Negative
	Cab Shelf	Wood	Good	2110.053.051293	4	0.312	Negative
	Cab End Panel	Wood	Good	2110.053.051293	5	0.953	Inconclusive
	Wall (upper)	Plaster	Good	2110.053.062293	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2110.053.062293	4	0.000	Negative
	Cab door	Wood	Good	2110.053.062293	5	0.000	Negative
	Cab Shelf	Wood	Fair	2110.053.062293	6	0.000	Negative
	Cab End Panel	Wood	Fair	2110.053.062293	8	0.300	Negative
BEDROOM #1							
	Wall (upper)	Drywall	Good	2110.053.051293	10	0.000	Negative
	Ceiling	Drywall	Good	2110.053.051293	11	0.000	Negative
	Wall (upper)	Plaster	Fair	2110.053.062293	11	0.000	Negative
	Ceiling	Plaster	Good	2110.053.062293	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Drywall	Good	2110.053.051293	12	0.000	Negative
	Ceiling	Drywall	Good	2110.053.051293	13	0.000	Negative
	Wall (upper)	Plaster	Good	2110.053.062293	13	0.000	Negative
	Ceiling	Plaster	Good	2110.053.062293	14	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
BATHROOM #1							
	Wall (upper)	Drywall	Good	2110.053.051293	14	0.000	Negative
	Ceiling	Drywall	Good	2110.053.051293	15	0.000	Negative
	Wall (upper)	Plaster	Good	2110.053.062293	15	0.000	Negative
	Ceiling	Plaster	Good	2110.053.062293	16	0.100	Negative
APT #2111							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2111.053.061693	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2111.053.061693	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2111.053.061693	9	0.000	Negative
	Ceiling	Plaster	Fair	2111.053.061693	10	0.000	Negative
	Tread	Wood	Poor	2111.053.061693	18	0.000	Negative
	Baseboard	Wood	Poor	2111.053.061693	19	1.700	Positive
	Banister rail	Wood	Fair	2111.053.061693	20	0.200	Negative
KITCHEN							
	Wall (upper)	Plaster	Fair	2111.053.061693	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2111.053.061693	5	0.000	Negative
	Cab door	Wood	Fair	2111.053.061693	6	0.200	Negative
	Cab Shelf	Wood	Fair	2111.053.061693	7	0.000	Negative
	Cab End Panel	Wood	Fair	2111.053.061693	8	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2111.053.061693	11	0.000	Negative
	Ceiling	Plaster	Good	2111.053.061693	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2111.053.061693	13	0.000	Negative
	Ceiling	Plaster	Good	2111.053.061693	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2111.053.061693	15	0.000	Negative
	Ceiling	Plaster	Good	2111.053.061693	17	0.000	Negative
APT #2112							
LIVING ROOM							
	Wall (upper)	Drywall	Good	2112.053.05193	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2112.053.05193	2	0.000	Negative
	Wall (upper)	Plaster	Fair	2112.053.062293	1	0.000	Negative
	Ceiling	Concrete/Block		Fair 2112.053.062293	2	0.000	Negative
HALLWAY							
	Wall (upper)	Drywall	Good	2112.053.05193	8	0.000	Negative
	Ceiling	Concrete/Block		Fair 2112.053.05193	9	0.000	Negative
	Wall (upper)	Plaster	Good	2112.053.062293	8	0.000	Negative
	Ceiling	Plaster	Good	2112.053.062293	9	0.000	Negative
	Tread	Wood	Good	2112.053.062293	16	0.000	Negative
	Baseboard	Wood	Good	2112.053.062293	18	0.300	Negative
	Banister rail	Wood	Good	2112.053.062293	19	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
KITCHEN							
	Wall (upper)	Drywall	Good	2112.053.05193	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2112.053.05193	4	0.000	Negative
	Cab door	Wood	Good	2112.053.05193	5	0.000	Negative
	Cab Shelf	Wood	Good	2112.053.05193	6	0.579	Negative
	Cab End Panel	Wood	Good	2112.053.05193	7	0.000	Negative
	Ceiling	Concrete/Block		Good 2112.053.062293	4	0.000	Negative
	Wall (upper)	Plaster	Good	2112.053.062293	3	0.000	Negative
	Cab door	Wood	Good	2112.053.062293	5	0.000	Negative
	Cab Shelf	Wood	Good	2112.053.062293	6	0.000	Negative
	Cab End Panel	Wood	Good	2112.053.062293	7	0.000	Negative
BEDROOM #1							
	Ceiling	Drywall	Good	2112.053.05193	11	0.000	Negative
	Wall (upper)	Drywall	Good	2112.053.05193	10	0.000	Negative
	Wall (upper)	Plaster	Good	2112.053.062293	10	0.000	Negative
	Ceiling	Plaster	Good	2112.053.062293	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Drywall	Good	2112.053.05193	12	0.000	Negative
	Ceiling	Drywall	Good	2112.053.05193	13	0.000	Negative
	Wall (upper)	Plaster	Good	2112.053.062293	12	0.000	Negative
	Ceiling	Plaster	Good	2112.053.062293	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Drywall	Good	2112.053.05193	14	0.000	Negative
	Ceiling	Drywall	Good	2112.053.05193	15	0.080	Negative
	Wall (upper)	Plaster	Good	2112.053.062293	14	0.000	Negative
	Ceiling	Plaster	Good	2112.053.062293	15	0.200	Negative
APT #2113							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2113.053.061793	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2113.053.061793	2	0.100	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2113.053.061793	10	0.000	Negative
	Ceiling	Plaster	Good	2113.053.061793	11	0.000	Negative
	Tread	Wood	Fair	2113.053.061793	18	0.000	Negative
	Baseboard	Wood	Fair	2113.053.061793	19	2.300	Positive
	Banister rail	Wood	Fair	2113.053.061793	20	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Fair	2113.053.061793	4	0.500	Negative
	Ceiling	Concrete/Block		Fair 2113.053.061793	5	0.000	Negative
	Cab door	Wood	Fair	2113.053.061793	6	0.000	Negative
	Cab Shelf	Wood	Fair	2113.053.061793	7	0.000	Negative
	Cab End Panel	Wood	Fair	2113.053.061793	9	0.300	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2113.053.061793	12	0.000	Negative
	Ceiling	Concrete/Block		Good 2113.053.061793	13	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
BEDROOM #2							
	Wall (upper)	Plaster	Good	2113.053.061793	14	0.000	Negative
	Ceiling	Plaster	Good	2113.053.061793	15	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Fair	2113.053.061793	16	0.000	Negative
	Ceiling	Plaster	Good	2113.053.061793	17	0.000	Negative
APT #2114							
LIVING ROOM							
	Wall (upper)	Drywall	Good	2114.053.051193	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2114.053.051193	2	0.000	Negative
	Wall (upper)	Plaster	Good	2114.053.062193	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2114.053.062193	2	0.000	Negative
HALLWAY							
	Wall (upper)	Drywall	Good	2114.053.051193	8	0.000	Negative
	Ceiling	Drywall	Good	2114.053.051193	9	0.000	Negative
	Wall (upper)	Plaster	Good	2114.053.062193	10	0.000	Negative
	Ceiling	Concrete/Block		Good 2114.053.062193	11	0.000	Negative
	Tread	Wood	Good	2114.053.062193	18	0.000	Negative
	Baseboard	Wood	Good	2114.053.062193	20	0.100	Negative
	Banister rail	Wood	Good	2114.053.062193	22	0.000	Negative
KITCHEN							
	Wall (upper)	Drywall	Good	2114.053.051193	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2114.053.051193	4	0.000	Negative
	Cab door	Wood	Good	2114.053.051193	5	0.125	Negative
	Cab Shelf	Wood	Good	2114.053.051193	6	0.551	Negative
	Cab End Panel	Wood	Good	2114.053.051193	7	0.502	Negative
	Wall (upper)	Plaster	Good	2114.053.062193	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2114.053.062193	4	0.100	Negative
	Cab door	Wood	Good	2114.053.062193	6	0.100	Negative
	Cab Shelf	Wood	Good	2114.053.062193	7	0.100	Negative
	Cab End Panel	Wood	Good	2114.053.062193	9	0.400	Negative
BEDROOM #1							
	Wall (upper)	Drywall	Good	2114.053.051193	10	0.000	Negative
	Ceiling	Drywall	Good	2114.053.051193	11	0.000	Negative
	Wall (upper)	Plaster	Good	2114.053.062193	12	0.000	Negative
	Ceiling	Plaster	Good	2114.053.062193	13	0.000	Negative
BEDROOM #2							
	Wall (upper)	Drywall	Good	2114.053.051193	12	0.000	Negative
	Ceiling	Drywall	Good	2114.053.051193	13	0.000	Negative
	Wall (upper)	Plaster	Good	2114.053.062193	14	0.000	Negative
	Ceiling	Plaster	Good	2114.053.062193	15	0.000	Negative
BATHROOM #1							
	Wall (upper)	Drywall	Good	2114.053.051193	14	0.000	Negative
	Ceiling	Drywall	Good	2114.053.051193	15	0.000	Negative
	Wall (upper)	Plaster	Good	2114.053.062193	16	0.000	Negative
	Ceiling	Plaster	Good	2114.053.062193	17	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
APT #2115							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2115.053.061693	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2115.053.061693	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2115.053.061693	9	0.000	Negative
	Ceiling	Plaster	Good	2115.053.061693	10	0.000	Negative
	Tread	Wood	Fair	2115.053.061693	17	0.000	Negative
	Baseboard	Wood	Good	2115.053.061693	18	1.800	Positive
	Banister rail	Wood	Good	2115.053.061693	19	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2115.053.061693	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2115.053.061693	4	0.000	Negative
	Cab door	Wood	Good	2115.053.061693	6	0.000	Negative
	Cab Shelf	Wood	Fair	2115.053.061693	7	0.000	Negative
	Cab End Panel	Wood	Fair	2115.053.061693	8	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2115.053.061693	11	0.000	Negative
	Ceiling	Plaster	Good	2115.053.061693	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2115.053.061693	13	0.000	Negative
	Ceiling	Plaster	Good	2115.053.061693	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2115.053.061693	15	0.000	Negative
	Ceiling	Plaster	Good	2115.053.061693	16	0.000	Negative
APT #2116							
LIVING ROOM							
	Wall (upper)	Drywall	Good	2116.053.051093	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2116.053.051093	2	0.000	Negative
	Wall (upper)	Plaster	Good	2116.023.062993	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2116.023.062993	2	0.000	Negative
HALLWAY							
	Wall (upper)	Drywall	Good	2116.053.051093	8	0.000	Negative
	Ceiling	Drywall	Good	2116.053.051093	9	0.000	Negative
	Wall (upper)	Plaster	Good	2116.023.062993	8	0.000	Negative
	Ceiling	Plaster	Good	2116.023.062993	9	0.000	Negative
	Tread	Wood	Fair	2116.023.062993	16	0.000	Negative
	Baseboard	Wood	Good	2116.023.062993	18	0.300	Negative
	Banister rail	Wood	Good	2116.023.062993	20	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
KITCHEN							
	Wall (upper)	Drywall	Good	2116.053.051093	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2116.053.051093	4	0.000	Negative
	Cab door	Wood	Good	2116.053.051093	5	0.317	Negative
	Cab Shelf	Wood	Good	2116.053.051093	6	0.527	Negative
	Cab End Panel	Wood	Good	2116.053.051093	7	0.787	Negative
	Wall (upper)	Plaster	Good	2116.023.062993	3	0.200	Negative
	Ceiling	Concrete/Block		Good 2116.023.062993	4	0.000	Negative
	Cab door	Wood	Good	2116.023.062993	5	0.000	Negative
	Cab Shelf	Wood	Good	2116.023.062993	6	0.100	Negative
	Cab End Panel	Wood	Good	2116.023.062993	7	0.000	Negative
BEDROOM #1							
	Wall (upper)	Drywall	Good	2116.053.051093	10	0.000	Negative
	Ceiling	Concrete/Block		Good 2116.053.051093	11	0.243	Negative
	Wall (upper)	Plaster	Good	2116.023.062993	10	0.000	Negative
	Ceiling	Plaster	Good	2116.023.062993	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Drywall	Good	2116.053.051093	12	0.000	Negative
	Ceiling	Concrete/Block		Good 2116.053.051093	13	0.000	Negative
	Wall (upper)	Plaster	Good	2116.023.062993	12	0.200	Negative
	Ceiling	Plaster	Good	2116.023.062993	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Drywall	Good	2116.053.051093	14	0.000	Negative
	Ceiling	Drywall	Good	2116.053.051093	15	0.287	Negative
	Wall (upper)	Plaster	Good	2116.023.062993	14	0.000	Negative
	Ceiling	Plaster	Good	2116.023.062993	15	0.000	Negative
APT #2117 LIVING ROOM							
	Wall (upper)	Plaster	Good	2117.053.061793	1	0.100	Negative
	Ceiling	Concrete/Block		Good 2117.053.061793	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2117.053.061793	8	0.200	Negative
	Ceiling	Plaster	Good	2117.053.061793	9	0.000	Negative
	Tread	Wood	Good	2117.053.061793	16	0.000	Negative
	Baseboard	Wood	Good	2117.053.061793	17	1.800	Positive
	Banister rail	Wood	Good	2117.053.061793	18	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2117.053.061793	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2117.053.061793	4	0.000	Negative
	Cab door	Wood	Good	2117.053.061793	5	0.000	Negative
	Cab Shelf	Wood	Good	2117.053.061793	6	0.000	Negative
	Cab End Panel	Wood	Good	2117.053.061793	7	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2117.053.061793	10	0.000	Negative
	Ceiling	Plaster	Good	2117.053.061793	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2117.053.061793	12	0.000	Negative
	Ceiling	Plaster	Good	2117.053.061793	13	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
BATHROOM #1							
	Wall (upper)	Plaster	Good	2117.053.061793	14	0.000	Negative
	Ceiling	Plaster	Good	2117.053.061793	15	0.000	Negative
APT #2118							
LIVING ROOM							
	Wall (upper)	Drywall	Good	2118.053.051093	1	0.000	Negative
	Ceiling	Plaster	Good	2118.053.051093	2	0.000	Negative
	Wall (upper)	Plaster	Good	2118.053.061793	1	0.000	Negative
	Ceiling	Concrete/Block	Good	2118.053.061793	2	0.000	Negative
HALLWAY							
	Wall (upper)	Drywall	Good	2118.053.051093	8	0.000	Negative
	Ceiling	Drywall	Good	2118.053.051093	9	0.000	Negative
	Wall (upper)	Plaster	Good	2118.053.061793	7	0.000	Negative
	Ceiling	Plaster	Good	2118.053.061793	8	0.200	Negative
	Tread	Wood	Poor	2118.053.061793	15	0.000	Negative
	Baseboard	Wood	Good	2118.053.061793	16	0.600	Negative
	Banister rail	Wood	Good	2118.053.061793	17	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2118.053.051093	3	0.000	Negative
	Ceiling	Plaster	Good	2118.053.051093	4	0.000	Negative
	Cab door	Wood	Fair	2118.053.051093	5	0.337	Negative
	Cab Shelf	Wood	Fair	2118.053.051093	6	0.773	Negative
	Cab End Panel	Wood	Fair	2118.053.051093	7	0.354	Negative
	Cab door	Wood	Good	2118.053.061793	3	0.100	Negative
	Cab Shelf	Wood	Fair	2118.053.061793	4	0.100	Negative
	Cab End Panel	Wood	Fair	2118.053.061793	6	0.400	Negative
	Wall (upper)	Plaster	Good	2118.053.061793	18	0.000	Negative
	Ceiling	Concrete/Block	Good	2118.053.061793	19	0.000	Negative
BEDROOM #1							
	Wall (upper)	Drywall	Good	2118.053.051093	10	0.000	Negative
	Ceiling	Drywall	Good	2118.053.051093	11	0.000	Negative
	Wall (upper)	Plaster	Good	2118.053.061793	9	0.000	Negative
	Ceiling	Plaster	Good	2118.053.061793	10	0.000	Negative
BEDROOM #2							
	Wall (upper)	Drywall	Good	2118.053.051093	12	0.000	Negative
	Ceiling	Drywall	Good	2118.053.051093	13	0.000	Negative
	Wall (upper)	Plaster	Good	2118.053.061793	11	0.000	Negative
	Ceiling	Plaster	Good	2118.053.061793	12	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2118.053.051093	14	0.000	Negative
	Ceiling	Drywall	Good	2118.053.051093	15	0.000	Negative
	Wall (upper)	Plaster	Good	2118.053.061793	13	0.000	Negative
	Ceiling	Plaster	Good	2118.053.061793	14	0.000	Negative
APT #2119							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2119.053.061793	1	0.000	Negative
	Ceiling	Concrete/Block	Good	2119.053.061793	2	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
HALLWAY							
	Wall (upper)	Plaster	Good	2119.053.061793	8	0.000	Negative
	Ceiling	Plaster	Good	2119.053.061793	9	0.000	Negative
	Tread	Wood	Fair	2119.053.061793	16	0.000	Negative
	Baseboard	Wood	Fair	2119.053.061793	17	1.900	Positive
	Banister rail	Wood	Fair	2119.053.061793	18	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2119.053.061793	3	0.000	Negative
	Ceiling	Concrete/Block	Good	2119.053.061793	4	0.000	Negative
	Cab door	Wood	Good	2119.053.061793	5	0.000	Negative
	Cab Shelf	Wood	Fair	2119.053.061793	6	0.000	Negative
	Cab End Panel	Wood	Fair	2119.053.061793	7	0.100	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Fair	2119.053.061793	10	0.000	Negative
	Ceiling	Plaster	Good	2119.053.061793	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2119.053.061793	12	0.000	Negative
	Ceiling	Plaster	Good	2119.053.061793	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2119.053.061793	14	0.000	Negative
	Ceiling	Other	Good	2119.053.061793	15	0.000	Negative
APT #2120							
LIVING ROOM							
	Wall (upper)	Drywall	Good	2120.053.051093	1	0.000	Negative
	Ceiling	Plaster	Good	2120.053.051093	2	0.000	Negative
	Wall (upper)	Plaster	Good	2120.053.061793	1	0.000	Negative
	Ceiling	Concrete/Block	Good	2120.053.061793	2	0.000	Negative
HALLWAY							
	Wall (upper)	Drywall	Good	2120.053.051093	8	0.000	Negative
	Ceiling	Drywall	Good	2120.053.051093	9	0.000	Negative
	Wall (upper)	Plaster	Good	2120.053.061793	8	0.000	Negative
	Ceiling	Plaster	Good	2120.053.061793	9	0.000	Negative
	Tread	Wood	Fair	2120.053.061793	14	0.000	Negative
	Baseboard	Wood	Good	2120.053.061793	15	0.100	Negative
	Banister rail	Wood	Fair	2120.053.061793	16	0.000	Negative
KITCHEN							
	Wall (upper)	Drywall	Fair	2120.053.051093	3	0.000	Negative
	Ceiling	Plaster	Good	2120.053.051093	4	0.000	Negative
	Cab door	Wood	Fair	2120.053.051093	5	0.000	Negative
	Cab Shelf	Wood	Good	2120.053.051093	6	0.334	Negative
	Cab End Panel	Wood	Fair	2120.053.051093	7	1.455	Positive
	Wall (upper)	Plaster	Good	2120.053.061793	3	0.000	Negative
	Ceiling	Concrete/Block	Good	2120.053.061793	4	0.000	Negative
	Cab door	Wood	Good	2120.053.061793	5	0.000	Negative
	Cab Shelf	Wood	Good	2120.053.061793	6	0.200	Negative
	Cab End Panel	Wood	Good	2120.053.061793	7	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
BEDROOM #1							
	Wall (upper)	Drywall	Good	2120.053.051093	10	0.000	Negative
	Ceiling	Plaster	Good	2120.053.051093	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Drywall	Good	2120.053.051093	12	0.000	Negative
	Ceiling	Drywall	Good	2120.053.051093	13	0.000	Negative
	Wall (upper)	Plaster	Good	2120.053.061793	10	0.000	Negative
	Ceiling	Plaster	Good	2120.053.061793	11	0.000	Negative
BATHROOM #1							
	Wall (upper)	Drywall	Good	2120.053.051093	14	0.000	Negative
	Ceiling	Drywall	Good	2120.053.051093	15	0.000	Negative
	Wall (upper)	Plaster	Good	2120.053.061793	12	0.000	Negative
	Ceiling	Plaster	Good	2120.053.061793	13	0.000	Negative
APT #2122							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2122.053.062293	1	0.000	Negative
	Ceiling	Concrete/Block	Good	2122.053.062293	3	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2122.053.062293	10	0.000	Negative
	Ceiling	Plaster	Good	2122.053.062293	11	0.000	Negative
	Tread	Wood	Good	2122.053.062293	19	0.200	Negative
	Baseboard	Wood	Good	2122.053.062293	21	0.600	Negative
	Banister rail	Wood	Good	2122.053.062293	22	0.100	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2122.053.062293	4	0.000	Negative
	Ceiling	Concrete/Block	Good	2122.053.062293	5	0.000	Negative
	Cab door	Wood	Good	2122.053.062293	6	0.000	Negative
	Cab Shelf	Wood	Good	2122.053.062293	7	0.000	Negative
	Cab End Panel	Wood	Good	2122.053.062293	8	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2122.053.062293	12	0.000	Negative
	Ceiling	Plaster	Good	2122.053.062293	13	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2122.053.062293	14	0.000	Negative
	Ceiling	Plaster	Good	2122.053.062293	15	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2122.053.062293	16	0.000	Negative
	Ceiling	Plaster	Good	2122.053.062293	17	0.000	Negative
APT #2123							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2123.053.061793	1	0.000	Negative
	Ceiling	Concrete/Block	Good	2123.053.061793	2	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
HALLWAY							
	Wall (upper)	Plaster	Good	2123.053.061793	9	0.000	Negative
	Ceiling	Concrete/Block		Good 2123.053.061793	10	0.000	Negative
	Tread	Wood	Fair	2123.053.061793	17	0.200	Negative
	Baseboard	Wood	Good	2123.053.061793	18	2.800	Positive
	Banister rail	Wood	Good	2123.053.061793	19	0.000	Negative
KITCHEN							
	Cab Shelf	Wood	Fair	2123.053.061793	7	0.000	Negative
	Wall (upper)	Plaster	Good	2123.053.061793	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2123.053.061793	4	0.000	Negative
	Cab door	Wood	Good	2123.053.061793	5	0.100	Negative
	Cab End Panel	Wood	Fair	2123.053.061793	8	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2123.053.061793	11	0.000	Negative
	Ceiling	Plaster	Good	2123.053.061793	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2123.053.061793	13	0.000	Negative
	Ceiling	Plaster	Good	2123.053.061793	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2123.053.061793	15	0.000	Negative
	Ceiling	Plaster	Good	2123.053.061793	16	0.000	Negative
APT #2124							
LIVING ROOM							
	Wall (upper)	Drywall	Good	2124.053.05109	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2124.053.05109	2	0.000	Negative
HALLWAY							
	Wall (upper)	Drywall	Good	2124.053.05109	8	0.000	Negative
	Ceiling	Drywall	Good	2124.053.05109	9	0.000	Negative
KITCHEN							
	Wall (upper)	Drywall	Good	2124.053.05109	3	0.000	Negative
	Ceiling	Drywall	Good	2124.053.05109	4	0.000	Negative
	Cab door	Wood	Good	2124.053.05109	5	0.233	Negative
	Cab Shelf	Wood	Good	2124.053.05109	6	0.222	Negative
	Cab End Panel	Wood	Good	2124.053.05109	7	0.441	Negative
BEDROOM #1							
	Wall (upper)	Drywall	Good	2124.053.05109	10	0.000	Negative
	Ceiling	Drywall	Good	2124.053.05109	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Drywall	Good	2124.053.05109	13	0.000	Negative
	Ceiling	Drywall	Good	2124.053.05109	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Drywall	Good	2124.053.05109	15	0.000	Negative
	Ceiling	Drywall	Good	2124.053.05109	16	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Nap Reading* mg/cm^2	XRF Results
APT #2126							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2126.053.05103	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2126.053.05103	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2126.053.05103	8	0.000	Negative
	Ceiling	Concrete/Block		Good 2126.053.05103	9	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2126.053.05103	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2126.053.05103	4	0.000	Negative
	Cab door	Wood	Good	2126.053.05103	5	0.100	Negative
	Cab Shelf	Wood	Good	2126.053.05103	6	0.151	Negative
	Cab End Panel	Wood	Good	2126.053.05103	7	0.194	Negative
BEDROOM #1							
	Ceiling	Plaster	Good	2126.053.05103	11	0.000	Negative
	Wall (upper)	Plaster	Good	2126.053.05103	10	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2126.053.05103	12	0.000	Negative
	Ceiling	Plaster	Good	2126.053.05103	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2126.053.05103	14	0.000	Negative
	Ceiling	Plaster	Good	2126.053.05103	15	0.000	Negative
APT #2128							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2128.053.051093	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2128.053.051093	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2128.053.051093	8	0.000	Negative
	Ceiling	Concrete/Block		Good 2128.053.051093	9	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2128.053.051093	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2128.053.051093	4	0.000	Negative
	Cab door	Wood	Good	2128.053.051093	5	0.088	Negative
	Cab Shelf	Wood	Good	2128.053.051093	6	0.026	Negative
	Cab End Panel	Wood	Good	2128.053.051093	7	0.351	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2128.053.051093	10	0.000	Negative
	Ceiling	Plaster	Good	2128.053.051093	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2128.053.051093	12	0.000	Negative
	Ceiling	Plaster	Good	2128.053.051093	13	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
BATHROOM #1							
	Wall (upper)	Plaster	Good	2128.053.051093	14	0.000	Negative
	Ceiling	Plaster	Good	2128.053.051093	15	0.000	Negative
APT #2130							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2130.080.060793	1	0.800	Negative
	Ceiling	Concrete/Block		Good 2130.080.060793	2	-0.600	Negative
	Wall (upper)	Plaster	Good	2130.023.062493	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2130.023.062493	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2130.080.060793	8	0.000	Negative
	Ceiling	Concrete/Block		Good 2130.080.060793	9	-0.300	Negative
	Tread	Wood	Poor	2130.080.060793	16	0.000	Negative
	Baseboard	Wood	Good	2130.080.060793	17	0.300	Negative
	Banister rail	Wood	Good	2130.080.060793	18	-0.400	Negative
	Wall (upper)	Plaster	Good	2130.023.062493	8	0.000	Negative
	Ceiling	Plaster	Good	2130.023.062493	9	0.000	Negative
	Tread	Wood	Good	2130.023.062493	16	0.000	Negative
	Baseboard	Wood	Good	2130.023.062493	18	0.000	Negative
	Banister rail	Wood	Good	2130.023.062493	19	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2130.080.060793	3	0.200	Negative
	Ceiling	Concrete/Block		Good 2130.080.060793	4	0.000	Negative
	Cab door	Wood	Good	2130.080.060793	5	-0.100	Negative
	Cab Shelf	Wood	Good	2130.080.060793	6	0.100	Negative
	Cab End Panel	Wood	Good	2130.080.060793	7	0.100	Negative
	Wall (upper)	Plaster	Good	2130.023.062493	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2130.023.062493	4	0.000	Negative
	Cab door	Wood	Good	2130.023.062493	5	0.200	Negative
	Cab Shelf	Wood	Good	2130.023.062493	6	0.000	Negative
	Cab End Panel	Wood	Good	2130.023.062493	7	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2130.080.060793	10	-0.300	Negative
	Ceiling	Plaster	Good	2130.080.060793	11	0.400	Negative
	Wall (upper)	Plaster	Good	2130.023.062493	10	0.000	Negative
	Ceiling	Plaster	Good	2130.023.062493	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2130.080.060793	12	-0.500	Negative
	Ceiling	Plaster	Good	2130.080.060793	13	0.100	Negative
	Wall (upper)	Plaster	Good	2130.023.062493	12	0.000	Negative
	Ceiling	Plaster	Good	2130.023.062493	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2130.080.060793	14	0.000	Negative
	Ceiling	Plaster	Good	2130.080.060793	15	-0.200	Negative
	Wall (upper)	Plaster	Good	2130.023.062493	14	0.000	Negative
	Ceiling	Plaster	Good	2130.023.062493	15	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
APT #2131							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2131.053.061593	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2131.053.061593	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2131.053.061593	9	0.000	Negative
	Ceiling	Concrete/Block		Good 2131.053.061593	10	0.000	Negative
	Tread	Wood	Fair	2131.053.061593	17	0.000	Negative
	Baseboard	Wood	Fair	2131.053.061593	18	0.100	Negative
	Banister rail	Wood	Fair	2131.053.061593	19	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2131.053.061593	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2131.053.061593	4	0.000	Negative
	Cab door	Wood	Good	2131.053.061593	6	0.300	Negative
	Cab Shelf	Wood	Fair	2131.053.061593	7	0.000	Negative
	Cab End Panel	Wood	Fair	2131.053.061593	8	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2131.053.061593	11	0.000	Negative
	Ceiling	Plaster	Good	2131.053.061593	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2131.053.061593	13	0.000	Negative
	Ceiling	Plaster	Good	2131.053.061593	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2131.053.061593	15	0.000	Negative
	Ceiling	Plaster	Good	2131.053.061593	16	0.000	Negative
APT #2132							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2132.080.060793	1	-0.500	Negative
	Ceiling	Concrete/Block		Good 2132.080.060793	2	-0.500	Negative
	Wall (upper)	Plaster	Good	2132.023.062393	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2132.023.062393	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2132.080.060793	7	-0.100	Negative
	Ceiling	Plaster	Good	2132.080.060793	8	-0.100	Negative
	Tread	Wood	Poor	2132.080.060793	16	0.700	Negative
	Baseboard	Wood	Good	2132.080.060793	17	-0.300	Negative
	Wall (upper)	Plaster	Good	2132.023.062393	8	0.000	Negative
	Ceiling	Plaster	Good	2132.023.062393	9	0.000	Negative
	Tread	Wood	Fair	2132.023.062393	17	0.000	Negative
	Baseboard	Wood	Good	2132.023.062393	18	0.000	Negative
	Banister rail	Wood	Good	2132.023.062393	19	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
KITCHEN							
	Wall (upper)	Plaster	Good	2132.080.060793	3	-0.400	Negative
	Ceiling	Concrete/Block		Good 2132.080.060793	4	0.500	Negative
	Cab door	Wood	Good	2132.080.060793	5	-0.200	Negative
	Cab Shelf	Wood	Fair	2132.080.060793	6	0.100	Negative
	Wall (upper)	Plaster	Good	2132.023.062393	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2132.023.062393	4	0.000	Negative
	Cab door	Wood	Good	2132.023.062393	5	0.000	Negative
	Cab Shelf	Wood	Good	2132.023.062393	6	0.200	Negative
	Cab End Panel	Wood	Good	2132.023.062393	7	0.200	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2132.080.060793	9	-0.200	Negative
	Wall (upper)	Plaster	Good	2132.080.060793	10	-0.200	Negative
	Ceiling	Plaster	Good	2132.080.060793	11	0.100	Negative
	Wall (upper)	Plaster	Good	2132.080.060793	9	0.200	Negative
	Wall (upper)	Plaster	Good	2132.023.062393	10	0.000	Negative
	Ceiling	Plaster	Good	2132.023.062393	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2132.080.060793	12	0.100	Negative
	Ceiling	Plaster	Good	2132.080.060793	13	-0.600	Negative
	Wall (upper)	Plaster	Good	2132.023.062393	12	0.000	Negative
	Ceiling	Plaster	Good	2132.023.062393	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2132.080.060793	14	0.100	Negative
	Ceiling	Plaster	Good	2132.080.060793	15	-0.200	Negative
	Wall (upper)	Plaster	Good	2132.023.062393	14	0.000	Negative
	Ceiling	Plaster	Good	2132.023.062393	15	0.000	Negative
APT #2133							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2133.053.061593	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2133.053.061593	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2133.053.061593	10	0.200	Negative
	Ceiling	Plaster	Good	2133.053.061593	11	0.000	Negative
	Tread	Wood	Fair	2133.053.061593	18	0.000	Negative
	Baseboard	Wood	Good	2133.053.061593	19	0.000	Negative
	Banister rail	Wood	Good	2133.053.061593	20	0.200	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2133.053.061593	4	0.000	Negative
	Ceiling	Concrete/Block		Good 2133.053.061593	5	0.000	Negative
	Cab door	Wood	Good	2133.053.061593	6	0.100	Negative
	Cab Shelf	Wood	Fair	2133.053.061593	8	0.000	Negative
	Cab End Panel	Wood	Fair	2133.053.061593	9	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Poor	2133.053.061593	12	0.000	Negative
	Ceiling	Plaster	Good	2133.053.061593	13	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
BEDROOM #2							
	Wall (upper)	Plaster	Good	2133.053.061593	14	0.000	Negative
	Ceiling	Plaster	Good	2133.053.061593	15	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2133.053.061593	16	0.000	Negative
	Ceiling	Plaster	Good	2133.053.061593	17	0.000	Negative
APT #2134							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2134.080.060793	1	-0.400	Negative
	Ceiling	Concrete/Block		Good 2134.080.060793	2	-0.700	Negative
	Wall (upper)	Plaster	Good	2134.023.062393	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2134.023.062393	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2134.080.060793	7	-0.200	Negative
	Ceiling	Plaster	Good	2134.080.060793	8	-0.400	Negative
	Tread	Wood	Poor	2134.080.060793	15	-0.300	Negative
	Baseboard	Wood	Good	2134.080.060793	16	0.200	Negative
	Banister rail	Wood	Good	2134.080.060793	17	-0.200	Negative
	Wall (upper)	Plaster	Good	2134.023.062393	8	0.000	Negative
	Ceiling	Plaster	Good	2134.023.062393	9	0.000	Negative
	Tread	Wood	Fair	2134.023.062393	16	0.000	Negative
	Baseboard	Wood	Good	2134.023.062393	18	0.000	Negative
	Banister rail	Wood	Good	2134.023.062393	19	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2134.080.060793	3	-0.200	Negative
	Ceiling	Concrete/Block		Good 2134.080.060793	4	0.200	Negative
	Cab door	Wood	Good	2134.080.060793	5	-0.200	Negative
	Cab Shelf	Wood	Poor	2134.080.060793	6	0.000	Negative
	Wall (upper)	Plaster	Good	2134.023.062393	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2134.023.062393	4	0.000	Negative
	Cab door	Wood	Good	2134.023.062393	5	0.000	Negative
	Cab Shelf	Wood	Good	2134.023.062393	6	0.000	Negative
	Cab End Panel	Wood	Good	2134.023.062393	7	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2134.080.060793	9	-0.400	Negative
	Ceiling	Plaster	Good	2134.080.060793	10	-0.300	Negative
	Wall (upper)	Plaster	Good	2134.023.062393	10	0.000	Negative
	Ceiling	Plaster	Good	2134.023.062393	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2134.080.060793	11	0.000	Negative
	Ceiling	Plaster	Good	2134.080.060793	12	-0.400	Negative
	Wall (upper)	Plaster	Good	2134.023.062393	12	0.000	Negative
	Ceiling	Plaster	Good	2134.023.062393	13	0.000	Negative
BATHROOM #1							
		Brick	Fair	2134.080.060793		0.000	Negative
	Ceiling	Plaster	Good	2134.080.060793	14	0.000	Negative
	Wall (upper)	Plaster	Good	2134.023.062393	14	0.000	Negative
	Ceiling	Plaster	Good	2134.023.062393	15	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
APT #2135							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2135.053.061593	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2135.053.061593	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Fair	2135.053.061593	8	0.000	Negative
	Ceiling	Plaster	Fair	2135.053.061593	9	0.000	Negative
	Tread	Wood	Good	2135.053.061593	16	0.200	Negative
	Baseboard	Wood	Good	2135.053.061593	18	0.000	Negative
	Banister rail	Wood	Good	2135.053.061593	19	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2135.053.061593	3	0.000	Negative
	Ceiling	Concrete/Block		Fair 2135.053.061593	4	0.000	Negative
	Cab door	Wood	Fair	2135.053.061593	5	0.000	Negative
	Cab Shelf	Wood	Fair	2135.053.061593	6	0.000	Negative
	Cab End Panel	Wood	Fair	2135.053.061593	7	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2135.053.061593	10	0.000	Negative
	Ceiling	Plaster	Good	2135.053.061593	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2135.053.061593	12	0.000	Negative
	Ceiling	Plaster	Good	2135.053.061593	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2135.053.061593	14	0.000	Negative
	Ceiling	Plaster	Good	2135.053.061593	15	0.000	Negative
APT #2137							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2137.053.061593	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2137.053.061593	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2137.053.061593	8	0.000	Negative
	Ceiling	Plaster	Good	2137.053.061593	9	0.000	Negative
	Tread	Wood	Poor	2137.053.061593	16	0.000	Negative
	Baseboard	Wood	Fair	2137.053.061593	17	0.000	Negative
	Banister rail	Wood	Good	2137.053.061593	18	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2137.053.061593	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2137.053.061593	4	0.000	Negative
	Cab door	Wood	Good	2137.053.061593	5	0.000	Negative
	Cab Shelf	Wood	Fair	2137.053.061593	6	0.000	Negative
	Cab End Panel	Wood	Fair	2137.053.061593	7	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2137.053.061593	10	0.000	Negative
	Ceiling	Plaster	Good	2137.053.061593	11	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
BEDROOM #2							
	Wall (upper)	Plaster	Good	2137.053.061593	12	0.100	Negative
	Ceiling	Plaster	Good	2137.053.061593	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2137.053.061593	14	0.000	Negative
	Ceiling	Plaster	Good	2137.053.061593	15	0.000	Negative
APT #2138							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2138.023.062393	1	0.000	Negative
	Ceiling	Concrete/Block	Good	2138.023.062393	3	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2138.023.062393	9	0.200	Negative
	Ceiling	Plaster	Good	2138.023.062393	10	0.000	Negative
	Tread	Wood	Good	2138.023.062393	17	0.000	Negative
	Baseboard	Wood	Good	2138.023.062393	19	0.300	Negative
	Banister rail	Wood	Good	2138.023.062393	20	0.100	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2138.023.062393	4	0.000	Negative
	Ceiling	Concrete/Block	Good	2138.023.062393	5	0.000	Negative
	Cab door	Wood	Good	2138.023.062393	6	0.100	Negative
	Cab Shelf	Wood	Good	2138.023.062393	7	0.000	Negative
	Cab End Panel	Wood	Good	2138.023.062393	8	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2138.023.062393	11	0.000	Negative
	Ceiling	Plaster	Good	2138.023.062393	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2138.023.062393	13	0.000	Negative
	Ceiling	Plaster	Good	2138.023.062393	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2138.023.062393	15	0.000	Negative
	Ceiling	Plaster	Good	2138.023.062393	16	0.000	Negative
APT #2139							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2139.053.061593	1	0.000	Negative
	Ceiling	Concrete/Block	Good	2139.053.061593	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2139.053.061593	9	0.000	Negative
	Ceiling	Plaster	Good	2139.053.061593	10	0.000	Negative
	Tread	Wood	Good	2139.053.061593	17	0.000	Negative
	Baseboard	Wood	Good	2139.053.061593	2	0.300	Negative
	Banister rail	Wood	Good	2139.053.061593	3	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
KITCHEN							
	Wall (upper)	Plaster	Good	2139.053.061593	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2139.053.061593	4	0.000	Negative
	Cab door	Wood	Fair	2139.053.061593	5	0.000	Negative
	Cab Shelf	Wood	Fair	2139.053.061593	7	0.100	Negative
	Cab End Panel	Wood	Fair	2139.053.061593	8	0.200	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2139.053.061593	11	0.000	Negative
	Ceiling	Plaster	Good	2139.053.061593	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2139.053.061593	13	0.200	Negative
	Ceiling	Plaster	Good	2139.053.061593	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2139.053.061593	15	0.000	Negative
	Ceiling	Plaster	Good	2139.053.061593	16	0.100	Negative
APT #2140							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2140.023.062393	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2140.023.062393	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2140.023.062393	8	0.000	Negative
	Ceiling	Plaster	Good	2140.023.062393	9	0.000	Negative
	Tread	Wood	Good	2140.023.062393	16	0.000	Negative
	Baseboard	Wood	Good	2140.023.062393	17	0.000	Negative
	Banister rail	Wood	Good	2140.023.062393	18	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2140.023.062393	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2140.023.062393	4	0.000	Negative
	Cab door	Wood	Good	2140.023.062393	5	0.000	Negative
	Cab Shelf	Wood	Good	2140.023.062393	6	0.100	Negative
	Cab End Panel	Wood	Good	2140.023.062393	7	0.200	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2140.023.062393	10	0.000	Negative
	Ceiling	Plaster	Good	2140.023.062393	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2140.023.062393	12	0.000	Negative
	Ceiling	Plaster	Good	2140.023.062393	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2140.023.062393	14	0.000	Negative
	Ceiling	Plaster	Good	2140.023.062393	15	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
APT #2141							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2141.053.061593	1	0.000	Negative
	Ceiling	Concrete/Block		Fair 2141.053.061593	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2141.053.061593	8	0.000	Negative
	Ceiling	Plaster	Good	2141.053.061593	9	0.000	Negative
	Tread	Wood	Good	2141.053.061593	16	0.000	Negative
	Baseboard	Wood	Good	2141.053.061593	18	2.100	Positive
	Banister rail	Wood	Good	2141.053.061593	19	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2141.053.061593	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2141.053.061593	4	0.000	Negative
	Cab door	Wood	Good	2141.053.061593	5	0.000	Negative
	Cab End Panel	Wood	Good	2141.053.061593	6	0.000	Negative
	Cab Shelf	Wood	Good	2141.053.061593	7	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2141.053.061593	10	0.000	Negative
	Ceiling	Plaster	Good	2141.053.061593	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2141.053.061593	12	0.000	Negative
	Ceiling	Plaster	Good	2141.053.061593	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2141.053.061593	14	0.000	Negative
	Ceiling	Plaster	Good	2141.053.061593	15	0.000	Negative
APT #2142							
LIVING ROOM							
	Wall (upper)	Wood	Good	2142.023.062393	1	0.000	Negative
	Ceiling	Wood	Good	2142.023.062393	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2142.023.062393	8	0.000	Negative
	Ceiling	Plaster	Good	2142.023.062393	9	0.000	Negative
	Tread	Wood	Good	2142.023.062393	16	0.000	Negative
	Baseboard	Wood	Good	2142.023.062393	17	0.000	Negative
	Banister rail	Wood	Good	2142.023.062393	18	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2142.023.062393	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2142.023.062393	4	0.000	Negative
	Cab door	Wood	Good	2142.023.062393	5	0.200	Negative
	Cab Shelf	Wood	Good	2142.023.062393	6	0.000	Negative
	Cab End Panel	Wood	Good	2142.023.062393	7	0.100	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2142.023.062393	10	0.000	Negative
	Ceiling	Plaster	Good	2142.023.062393	11	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
BEDROOM #2							
	Wall (upper)	Plaster	Good	2142.023.062393	12	0.000	Negative
	Ceiling	Plaster	Good	2142.023.062393	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2142.023.062393	14	0.000	Negative
	Ceiling	Plaster	Good	2142.023.062393	15	0.000	Negative
APT #2143							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2143.053.061593	1	0.000	Negative
	Ceiling	Concrete/Block	Good	2143.053.061593	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Fair	2143.053.061593	8	0.000	Negative
	Ceiling	Plaster	Good	2143.053.061593	9	0.000	Negative
	Tread	Wood	Fair	2143.053.061593	16	0.000	Negative
	Baseboard	Wood	Good	2143.053.061593	17	0.200	Negative
	Banister rail	Wood	Good	2143.053.061593	18	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2143.053.061593	3	0.100	Negative
	Ceiling	Concrete/Block	Good	2143.053.061593	4	0.000	Negative
	Cab door	Wood	Good	2143.053.061593	5	0.000	Negative
	Cab Shelf	Wood	Good	2143.053.061593	6	0.000	Negative
	Cab End Panel	Wood	Poor	2143.053.061593	7	0.100	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2143.053.061593	10	0.000	Negative
	Ceiling	Plaster	Good	2143.053.061593	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2143.053.061593	12	0.000	Negative
	Ceiling	Plaster	Good	2143.053.061593	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2143.053.061593	14	0.000	Negative
	Ceiling	Plaster	Good	2143.053.061593	15	0.000	Negative
APT #2144							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2144.023.062393	1	0.000	Negative
	Ceiling	Concrete/Block	Good	2144.023.062393	3	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2144.023.062393	11	0.000	Negative
	Ceiling	Plaster	Good	2144.023.062393	12	0.000	Negative
	Tread	Wood	Good	2144.023.062393	20	0.000	Negative
	Baseboard	Wood	Good	2144.023.062393	22	0.100	Negative
	Banister rail	Wood	Good	2144.023.062393	23	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
KITCHEN							
	Wall (upper)	Plaster	Good	2144.023.062393	4	0.000	Negative
	Ceiling	Concrete/Block		Good 2144.023.062393	5	0.200	Negative
	Cab door	Wood	Good	2144.023.062393	7	0.000	Negative
	Cab Shelf	Wood	Good	2144.023.062393	8	0.700	Negative
	Cab End Panel	Wood	Good	2144.023.062393	10	0.400	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2144.023.062393	13	0.000	Negative
	Ceiling	Plaster	Good	2144.023.062393	14	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2144.023.062393	16	1.200	Inconclusive
	Ceiling	Plaster	Good	2144.023.062393	17	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2144.023.062393	18	0.000	Negative
	Ceiling	Plaster	Good	2144.023.062393	19	0.000	Negative
APT #2145							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2145.053.061593	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2145.053.061593	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2145.053.061593	8	0.000	Negative
	Ceiling	Plaster	Good	2145.053.061593	9	0.200	Negative
	Tread	Wood	Good	2145.053.061593	16	0.000	Negative
	Baseboard	Wood	Good	2145.053.061593	18	0.100	Negative
	Banister rail	Wood	Good	2145.053.061593	19	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2145.053.061593	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2145.053.061593	4	0.000	Negative
	Cab door	Wood	Good	2145.053.061593	5	0.000	Negative
	Cab Shelf	Wood	Good	2145.053.061593	6	0.000	Negative
	Cab End Panel	Wood	Good	2145.053.061593	7	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2145.053.061593	10	0.000	Negative
	Ceiling	Plaster	Good	2145.053.061593	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Poor	2145.053.061593	12	0.000	Negative
	Ceiling	Plaster	Good	2145.053.061593	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2145.053.061593	14	0.000	Negative
	Ceiling	Plaster	Good	2145.053.061593	15	0.000	Negative
APT #2146							
UNKNOWN ROOM		Brick	Fair	2146.023.0		0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
LIVING ROOM							
	Wall (upper)	Plaster	Good	2146.023.062393	1	0.000	Negative
	Ceiling	Concrete/Block	Good	2146.023.062393	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2146.023.062393	8	0.000	Negative
	Ceiling	Plaster	Good	2146.023.062393	9	0.000	Negative
	Tread	Wood	Good	2146.023.062393	17	0.000	Negative
	Banister rail	Wood	Good	2146.023.062393	20	0.000	Negative
KITCHEN							
	Cab End Panel	Wood	Good	2146.023.062393	7	0.000	Negative
	Wall (upper)	Plaster	Good	2146.023.062393	3	0.000	Negative
	Ceiling	Concrete/Block	Good	2146.023.062393	4	0.000	Negative
	Cab door	Wood	Good	2146.023.062393	5	0.000	Negative
	Cab Shelf	Wood	Good	2146.023.062393	6	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2146.023.062393	10	0.000	Negative
	Ceiling	Plaster	Good	2146.023.062393	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2146.023.062393	12	0.000	Negative
	Ceiling	Plaster	Good	2146.023.062393	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2146.023.062393	14	0.000 -	Negative
	Ceiling	Plaster	Good	2146.023.062393	16	0.000	Negative
APT #2147							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2147.053.061593	1	0.000	Negative
	Ceiling	Concrete/Block	Good	2147.053.061593	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2147.053.061593	9	0.000	Negative
	Ceiling	Plaster	Good	2147.053.061593	10	0.000	Negative
	Tread	Wood	Fair	2147.053.061593	17	0.000	Negative
	Baseboard	Wood	Good	2147.053.061593	18	0.000	Negative
	Banister rail	Wood	Good	2147.053.061593	19	0.100	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2147.053.061593	3	0.200	Negative
	Ceiling	Concrete/Block	Good	2147.053.061593	4	0.000	Negative
	Cab door	Wood	Good	2147.053.061593	5	0.000	Negative
	Cab Shelf	Wood	Fair	2147.053.061593	6	0.200	Negative
	Cab End Panel	Wood	Good	2147.053.061593	8	0.400	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2147.053.061593	11	0.000	Negative
	Ceiling	Plaster	Good	2147.053.061593	12	0.200	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2147.053.061593	13	0.000	Negative
	Ceiling	Plaster	Good	2147.053.061593	14	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
BATHROOM #1							
	Wall (upper)	Plaster	Good	2147.053.061593	15	0.000	Negative
	Ceiling	Plaster	Good	2147.053.061593	16	0.000	Negative
APT #2148							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2148.023.062393	1	0.000	Negative
	Ceiling	Concrete/Block	Good	2148.023.062393	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2148.023.062393	8	0.000	Negative
	Ceiling	Plaster	Good	2148.023.062393	9	0.000	Negative
	Tread	Wood	Good	2148.023.062393	16	0.000	Negative
	Baseboard	Wood	Good	2148.023.062393	18	0.000	Negative
	Banister rail	Wood	Good	2148.023.062393	19	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2148.023.062393	3	0.000	Negative
	Ceiling	Concrete/Block	Good	2148.023.062393	4	0.000	Negative
	Cab door	Wood	Good	2148.023.062393	5	0.200	Negative
	Cab Shelf	Wood	Good	2148.023.062393	6	0.000	Negative
	Cab End Panel	Wood	Good	2148.023.062393	7	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2148.023.062393	10	0.000	Negative
	Ceiling	Plaster	Good	2148.023.062393	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2148.023.062393	12	0.000	Negative
	Ceiling	Plaster	Good	2148.023.062393	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2148.023.062393	14	0.000	Negative
	Ceiling	Plaster	Good	2148.023.062393	15	0.000	Negative
APT #2149							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2149.053.061593	1	0.000	Negative
	Ceiling	Concrete/Block	Good	2149.053.061593	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2149.053.061593	8	0.000	Negative
	Ceiling	Plaster	Good	2149.053.061593	9	0.000	Negative
	Tread	Wood	Good	2149.053.061593	16	0.000	Negative
	Baseboard	Wood	Good	2149.053.061593	18	0.200	Negative
	Banister rail	Wood	Good	2149.053.061593	19	0.000	Negative
KITCHEN							
	Cab End Panel	Wood	Fair	2149.053.061593	7	0.800	Negative
	Wall (upper)	Plaster	Good	2149.053.061593	3	0.000	Negative
	Ceiling	Concrete/Block	Good	2149.053.061593	4	0.100	Negative
	Cab door	Wood	Fair	2149.053.061593	5	0.000	Negative
	Cab Shelf	Wood	Fair	2149.053.061593	6	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm²	XRF Results
BEDROOM #1							
	Wall (upper)	Plaster	Good	2149.053.061593	10	0.000	Negative
	Ceiling	Plaster	Good	2149.053.061593	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2149.053.061593	12	0.000	Negative
	Ceiling	Plaster	Good	2149.053.061593	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2149.053.061593	14	0.000	Negative
	Ceiling	Plaster	Good	2149.053.061593	15	0.000	Negative
APT #2150							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2150.023.062493	1	0.000	Negative
	Ceiling	Concrete/Block	Good	2150.023.062493	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Fair	2150.023.062493	8	0.000	Negative
	Ceiling	Plaster	Fair	2150.023.062493	9	0.000	Negative
	Tread	Wood	Fair	2150.023.062493	16	0.000	Negative
	Baseboard	Wood	Fair	2150.023.062493	17	0.200	Negative
	Banister rail	Wood	Fair	2150.023.062493	18	0.000	Negative
KITCHEN							
	Cab End Panel	Wood	Fair	2150.023.062493	7	0.000	Negative
	Wall (upper)	Plaster	Good	2150.023.062493	3	0.000	Negative
	Ceiling	Concrete/Block	Good	2150.023.062493	4	0.000	Negative
	Cab door	Wood	Good	2150.023.062493	5	0.000	Negative
	Cab Shelf	Wood	Fair	2150.023.062493	6	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Poor	2150.023.062493	10	0.000	Negative
	Ceiling	Plaster	Good	2150.023.062493	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2150.023.062493	12	0.000	Negative
	Ceiling	Plaster	Good	2150.023.062493	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2150.023.062493	14	0.000	Negative
	Ceiling	Plaster	Good	2150.023.062493	15	0.000	Negative
APT #2151							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2151.053.061493	1	0.000	Negative
	Ceiling	Concrete/Block	Good	2151.053.061493	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Fair	2151.053.061493	9	0.000	Negative
	Ceiling	Concrete/Block	Good	2151.053.061493	10	0.000	Negative
	Tread	Wood	Good	2151.053.061493	17	0.000	Negative
	Baseboard	Wood	Good	2151.053.061493	18	0.000	Negative
	Banister rail	Wood	Good	2151.053.061493	19	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Wap Reading* mg/cm^2	XRF Results
KITCHEN							
	Wall (upper)	Plaster	Good	2151.053.061493	4	0.100	Negative
	Ceiling	Concrete/Block		Good 2151.053.061493	5	0.000	Negative
	Cab door	Wood	Good	2151.053.061493	6	0.000	Negative
	Cab Shelf	Wood	Good	2151.053.061493	7	0.000	Negative
	Cab End Panel	Wood	Good	2151.053.061493	8	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2151.053.061493	11	0.000	Negative
	Ceiling	Plaster	Good	2151.053.061493	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2151.053.061493	13	0.000	Negative
	Ceiling	Plaster	Good	2151.053.061493	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2151.053.061493	15	0.000	Negative
	Ceiling	Plaster	Good	2151.053.061493	16	0.000	Negative
APT #2152							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2152.053.062293	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2152.053.062293	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2152.053.062293	9	0.000	Negative
	Ceiling	Plaster	Good	2152.053.062293	10	0.000	Negative
	Tread	Wood	Good	2152.053.062293	15	0.000	Negative
	Baseboard	Wood	Good	2152.053.062293	17	0.300	Negative
	Banister rail	Wood	Good	2152.053.062293	18	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2152.053.062293	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2152.053.062293	4	0.000	Negative
	Cab door	Wood	Good	2152.053.062293	6	0.000	Negative
	Cab Shelf	Wood	Good	2152.053.062293	7	0.200	Negative
	Cab End Panel	Wood	Good	2152.053.062293	8	0.000	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2152.053.062293	11	0.000	Negative
	Ceiling	Plaster	Good	2152.053.062293	12	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2152.053.062293	13	0.000	Negative
	Ceiling	Plaster	Good	2152.053.062293	14	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2152.053.062293	19	0.000	Negative
	Ceiling	Plaster	Good	2152.053.062293	20	0.000	Negative

Room /Area	Building Component	Background Substrate	Paint Cond.	Sample I.D. No.	Assay No.	Map Reading* mg/cm^2	XRF Results
APT #2153							
LIVING ROOM							
	Wall (upper)	Plaster	Good	2153.053.061493	1	0.000	Negative
	Ceiling	Concrete/Block		Good 2153.053.061493	2	0.000	Negative
HALLWAY							
	Wall (upper)	Plaster	Good	2153.053.061493	8	0.000	Negative
	Ceiling	Plaster	Good	2153.053.061493	9	0.000	Negative
	Wall (upper)	Wood	Good	2153.053.061493	16	0.000	Negative
	Baseboard	Wood	Fair	2153.053.061493	17	0.200	Negative
	Banister rail	Wood	Poor	2153.053.061493	18	0.000	Negative
KITCHEN							
	Wall (upper)	Plaster	Good	2153.053.061493	3	0.000	Negative
	Ceiling	Concrete/Block		Good 2153.053.061493	4	0.000	Negative
	Cab door	Wood	Good	2153.053.061493	5	0.000	Negative
	Cab Shelf	Wood	Fair	2153.053.061493	6	0.000	Negative
	Cab End Panel	Wood	Fair	2153.053.061493	7	0.300	Negative
BEDROOM #1							
	Wall (upper)	Plaster	Good	2153.053.061493	10	0.000	Negative
	Ceiling	Plaster	Good	2153.053.061493	11	0.000	Negative
BEDROOM #2							
	Wall (upper)	Plaster	Good	2153.053.061493	12	0.000	Negative
	Ceiling	Plaster	Good	2153.053.061493	13	0.000	Negative
BATHROOM #1							
	Wall (upper)	Plaster	Good	2153.053.061493	14	0.000	Negative
	Ceiling	Plaster	Good	2153.053.061493	15	0.000	Negative

APPENDICES

APPENDIX A

LABORATORY REPORTS

Health Science Associates

LABORATORY REPORT

HSA
Imperial Courts

Report No.: 933020
Project No.: 93LA1103
Invoice No.:

Date Received: 05-11-93
Date Completed: 05-11-93
Date Sent: 05-11-93

Sample Description : (1) - PAINT CHIP

Method of Digestion: Microwave (EPA 3051)

Method of Analysis : Inductively coupled argon plasma, atomic emission spectroscopy (EPA 6010)

Auto Sample No.	Submitter Sample No.	Test Description	Test Result	Units	Detection Limit
018048	IC.2120.510.PC-1	Lead	0.071	WT%	0.005 %

The Consumer Products Safety Commission standard level for lead-based paint is more than 0.06% Lead Metal by weight. The Housing and Urban Development (HUD) Guidelines suggest abatement when lead paint levels exceed 0.5% of lead in the dry film.

Remarks - Sample(s) and sampling data as provided by: HSA/RL

Analyst: ES Ref.: ME93-12

Reviewed by: Lauren P. Johnstone
Lauren P. Johnstone

AIHA Accreditation No.: 172
California ELAP No.: 1406
NVLAP Accreditation No.: 1384

Technical Approval: Susan Rosenberg
Laboratory Director

10771 Noel St., Los Alamitos, CA 90720 714/220-3922 FAX 714/220-2081

This report pertains only to the samples investigated and does not necessarily apply to other apparently identical or similar materials. This report is submitted for the exclusive use of the client to whom it is addressed. Any reproduction of this report or use of this Laboratory's name for advertising or publicity purposes without written authorization is prohibited.

Health Science Associates

LABORATORY REPORT

HSA
HACLA - IMPERIAL GARDENS

Report No.: 933091
Project No.: 93LA1103
Invoice No.:

Date Received: 05-13-93
Date Completed: 05-14-93
Date Sent: 05-17-93

Sample Description : (1) - PAINT CHIP

Method of Digestion: Microwave (EPA 3051)

Method of Analysis : Inductively coupled argon plasma, atomic emission spectroscopy (EPA 6010)

Auto Sample No.	Submitter Sample No.	Test Description	Test Result	Units	Detection Limit
018380	IG-2072-051393-PC1	Lead	0.023	WT%	0.005 %

The Consumer Products Safety Commission standard level for lead-based paint is more than 0.06% Lead Metal by weight. The Housing and Urban Development (HUD) Guidelines suggest abatement when lead paint levels exceed 0.5% of lead in the dry film.

Remarks - Sample(s) and sampling data as provided by: HSA/AD

Analyst: ES Ref.: ME93-12

Reviewed by: Lauren P. Johnstone

Technical Approval: Susan Rosenberg
Laboratory Director

AIHA Accreditation No.: 172
California ELAP No.: 1406
NVLAP Accreditation No.: 1384

10771 Noel St., Los Alamitos, CA 90720 714/220-3922 FAX 714/220-2081

This report pertains only to the samples investigated and does not necessarily apply to other apparently identical or similar materials. This report is submitted for the exclusive use of the client to whom it is addressed. Any reproduction of this report or use of this Laboratory's name for advertising or publicity purposes without written authorization is prohibited.

Health Science Associates

LABORATORY REPORT

HSA
HACLA - Imperial Gardens

Report No.: 933126
Project No.: 93LA1103
Invoice No.:

Date Received: 05-17-93
Date Completed: 05-18-93
Date Sent: 05-19-93

Sample Description : (1) - PAINT CHIP

Method of Digestion: Microwave (EPA 3051)

Method of Analysis : Inductively coupled argon plasma, atomic emission spectroscopy (EPA 6010)

Auto Sample No.	Submitter Sample No.	Test Description	Samping Location	Test Result	Units	Detection Limit
018642	IG-2062-051393-PC-1	Lead	STAIR SKIRT	0.077	WT%	0.005 %

The Consumer Products Safety Commission standard level for lead-based paint is more than 0.06% Lead Metal by weight. The Housing and Urban Development (HUD) Guidelines suggest abatement when lead paint levels exceed 0.5% of lead in the dry film.

Remarks - Sample(s) and sampling data as provided by: HSA/AD

Analyst: ES Ref.: ME93-12

Reviewed by: Lauren P. Johnstone
Lauren P. Johnstone

AIHA Accreditation No.: 172
California ELAP No.: 1406
NVLAP Accreditation No.: 1384

Technical Approval: Susan Rosenberg
Laboratory Director

10771 Noel St., Los Alamitos, CA 90720 714/220-3922 FAX 714/220-2081

This report pertains only to the samples investigated and does not necessarily apply to other apparently identical or similar materials. This report is submitted for the exclusive use of the client to whom it is addressed. Any reproduction of this report or use of this Laboratory's name for advertising or publicity purposes without written authorization is prohibited.

Health Science Associates

LABORATORY REPORT

HSA
HACLA - Imperial Courts

Report No.: 933218
Project No.: 93LA1103
Invoice No.:

Date Received: 05-21-93
Date Completed: 05-23-93
Date Sent: 05-24-93

Sample Description : (5) - PAINT CHIPS

Method of Digestion: Microwave (EPA 3051)

Method of Analysis : Inductively coupled argon plasma, atomic emission spectroscopy (EPA 6010)

Auto Sample No.	Submitter Sample No.	Test Description	Test Result	Units	Detection Limit
019062	11420-053-052093-07	Lead	0.19	WT%	0.005 %
019063	11428-053-052093-07	Lead	0.084	WT%	0.005 %
019064	2014-053-051893-16	Lead	0.16	WT%	0.005 %
019065	2012-053-051893-18	Lead	0.015	WT%	0.005 %
019066	11512-053-051993-07	Lead	0.29	WT%	0.005 %

The Consumer Products Safety Commission standard level for lead-based paint is more than 0.06% Lead Metal by weight. The Housing and Urban Development (HUD) Guidelines suggest abatement when lead paint levels exceed 0.5% of lead in the dry film.

Remarks - Sample(s) and sampling data as provided by: HSA/JMB

Analyst: KS Ref.: ME93-13

Reviewed by: Lauren P. Johnstone
Lauren P. Johnstone

Technical Approval: Susan Rosenberg
Laboratory Director

AIHA Accreditation No.: 172
California ELAP No.: 1406
NVLAP Accreditation No.: 1384

10771 Noel St., Los Alamitos, CA 90720 714/220-3922 FAX 714/220-2081

This report pertains only to the samples investigated and does not necessarily apply to other apparently identical or similar materials. This report is submitted for the exclusive use of the client to whom it is addressed. Any reproduction of this report or use of this Laboratory's name for advertising or publicity purposes without written authorization is prohibited.

Health Science Associates

LABORATORY REPORT

HSA
HACLA - Imperial Courts

Report No.: 933236
Project No.: 93LA1103
Invoice No.:

Date Received: 05-22-93
Date Completed: 05-23-93
Date Sent: 05-24-93

Sample Description : (1) - BULK PAINT

Method of Digestion: Microwave (EPA 3051)

Method of Analysis : Inductively coupled argon plasma, atomic emission spectroscopy (EPA 6010)

Auto Sample No.	Submitter Sample No.	Test Description	Test Result	Units	Detection Limit
019188	11412-053-052193 #7	Lead	1.1	WT%	0.005 %

The Consumer Products Safety Commission standard level for lead-based paint is more than 0.06% Lead Metal by weight. The Housing and Urban Development (HUD) Guidelines suggest abatement when lead paint levels exceed 0.5% of lead in the dry film.

Remarks - Sample(s) and sampling data as provided by: HSA/AD

Analyst: KS Ref.: ME93-13

Reviewed by: Lauren P. Johnstone
Lauren P. Johnstone

Technical Approval: Susan Rosenberg
Laboratory Director

AIHA Accreditation No.: 172
California ELAP No.: 1406
NVLAP Accreditation No.: 1384

10771 Noel St., Los Alamitos, CA 90720 714/220-3922 FAX 714/220-2081

This report pertains only to the samples investigated and does not necessarily apply to other apparently identical or similar materials. This report is submitted for the exclusive use of the client to whom it is addressed. Any reproduction of this report or use of this Laboratory's name for advertising or publicity purposes without written authorization is prohibited.

Health Science Associates

LABORATORY REPORT

HSA
HACLA - Imperial Courts

Report No.: 933493
Project No.: 93LA1103
Invoice No.:

Date Received: 06-10-93
Date Completed: 06-16-93
Date Sent: 06-18-93

Sample Description : (1) - PAINT CHIP

Method of Digestion: Microwave (EPA 3051)

Method of Analysis : Inductively coupled argon plasma, atomic emission spectroscopy (EPA 6010)

Auto Sample No.	Submitter Sample No.	Test Description	Samping Location	Test Result	Units	Detection Limit
020568	061093-ASSAY15/U.2048	Lead	WALL 2/BEDRM.2	0.098	WT%	0.005 %

The Consumer Products Safety Commission standard level for lead-based paint is more than 0.06% Lead Metal by weight. The Housing and Urban Development (HUD) Guidelines suggest abatement when lead paint levels exceed 0.5% of lead in the dry film.

Remarks - Sample(s) and sampling data as provided by: HSA/AD

Analyst: KS Ref.: ME93-16

Reviewed by: Ella Shuel
Ella Shuel

AIHA Accreditation No.: 172
California ELAP No.: 1406
NVLAP Accreditation No.: 1384

Technical Approval: Susan Rosenberg
Laboratory Director

10771 Noel St., Los Alamitos, CA 90720 714/220-3922 FAX 714/220-2081

This report pertains only to the samples investigated and does not necessarily apply to other apparently identical or similar materials. This report is submitted for the exclusive use of the client to whom it is addressed. Any reproduction of this report or use of this Laboratory's name for advertising or publicity purposes without written authorization is prohibited.

Health Science Associates

LABORATORY REPORT

HSA
HACLA - Imperial Courts

Report No.: 933513
Project No.: 93LA1103
Invoice No.:

Date Received: 06-14-93
Date Completed: 06-16-93
Date Sent: 06-18-93

Sample Description : (2) - PAINT CHIPS

Method of Digestion: Microwave (EPA 3051)

Method of Analysis : Inductively coupled argon plasma, atomic emission spectroscopy (EPA 6010)

Auto Sample No.	Submitter Sample No.	Test Description	Samping Location	Test Result	Units	Detection Limit
020716	UNIT 2077-ASSAY 19	Lead	BASE BOARD	0.058	WT%	0.005 %
020717	UNIT 2045-ASSAY 08	Lead	CABINET END PANEL	0.11	WT%	0.005 %

The Consumer Products Safety Commission standard level for lead-based paint is more than 0.06% Lead Metal by weight. The Housing and Urban Development (HUD) Guidelines suggest abatement when lead paint levels exceed 0.5% of lead in the dry film.

Remarks - Sample(s) and sampling data as provided by: HSA/AD

Analyst: ES Ref.: ME93-16

Reviewed by: Lauren P. Johnstone
Lauren P. Johnstone

Technical Approval: Susan Rosenberg
Laboratory Director

AIHA Accreditation No.: 172
California ELAP No.: 1406
NVLAP Accreditation No.: 1384

10771 Noel St., Los Alamitos, CA 90720 714/220-3922 FAX 714/220-2081

This report pertains only to the samples investigated and does not necessarily apply to other apparently identical or similar materials. This report is submitted for the exclusive use of the client to whom it is addressed. Any reproduction of this report or use of this Laboratory's name for advertising or publicity purposes without written authorization is prohibited.

Health Science Associates

LABORATORY REPORT

HSA
HACLA - Imperial Courts

Report No.: 933538
Project No.: 93LA1103
Invoice No.:

Date Received: 06-16-93
Date Completed: 06-17-93
Date Sent: 06-17-93

Sample Description : (1) - BULK CHIP

Method of Digestion: Microwave (EPA 3051)

Method of Analysis : Inductively coupled argon plasma, atomic emission spectroscopy (EPA 6010)

Auto Sample No.	Submitter Sample No.	Test Description	Sampling Location	Test Result	Units	Detection Limit
020932	2149053615\ASSAY 07	Lead	CAB. END PANEL	0.096	WT%	0.005 %

The Consumer Products Safety Commission standard level for lead-based paint is more than 0.06% Lead Metal by weight. The Housing and Urban Development (HUD) Guidelines suggest abatement when lead paint levels exceed 0.5% of lead in the dry film.

Remarks - Sample(s) and sampling data as provided by: HSA/AD

Analyst: KS Ref.: ME93-16

Reviewed by: Ella Shuel
Ella Shuel

Technical Approval: Susan Rosenberg
Laboratory Director

AIHA Accreditation No.: 172
California ELAP No.: 1406
NVLAP Accreditation No.: 1384

10771 Noel St., Los Alamitos, CA 90720 714/220-3922 FAX 714/220-2081

This report pertains only to the samples investigated and does not necessarily apply to other apparently identical or similar materials. This report is submitted for the exclusive use of the client to whom it is addressed. Any reproduction of this report or use of this Laboratory's name for advertising or publicity purposes without written authorization is prohibited.

Health Science Associates

LABORATORY REPORT

HSA
HACLA - Imperial Courts

Report No.: 933670
Project No.: 93LA1113
Invoice No.:

Date Received: 06-24-93
Date Completed: 06-30-93
Date Sent: 07-01-93

Sample Description : (1) - PAINT CHIP

Method of Digestion: Microwave (EPA 3051)

Method of Analysis : Inductively coupled argon plasma, atomic emission spectroscopy (EPA 6010)

Auto Sample No.	Submitter Sample No.	Test Description	Samping Location	Test Result	Units	Detection Limit
021622	062393-ASSAY 15/2144	Lead	WALL 1C/BEDRM. 2	0.093	WT%	0.005 %

The Consumer Products Safety Commission standard level for lead-based paint is more than 0.06% Lead Metal by weight. The Housing and Urban Development (HUD) Guidelines suggest abatement when lead paint levels exceed 0.5% of lead in the dry film.

Remarks - Sample(s) and sampling data as provided by: HSA/AD

Analyst: KS Ref.: ME93-17

Reviewed by: Ella Shuel
Ella Shuel

AIHA Accreditation No.: 172
California ELAP No.: 1406
NVLAP Accreditation No.: 1384

Technical Approval: Susan Rosenberg
Laboratory Director

10771 Noel St., Los Alamitos, CA 90720 714/220-3922 FAX 714/220-2081

This report pertains only to the samples investigated and does not necessarily apply to other apparently identical or similar materials. This report is submitted for the exclusive use of the client to whom it is addressed. Any reproduction of this report or use of this Laboratory's name for advertising or publicity purposes without written authorization is prohibited.

APPENDIX B

SAMPLE XRF TESTING FORMS

HEALTH SCIENCE ASSOCIATES
ON-SITE LEAD-BASED PAINT (LBP) TEST
MAP (XRF) SPECTRUM ANALYZER RECORD

CLIENT:_____ PROJ. NO.:_____ DOWNLOAD: _____

PROJECT:_____ APT NO.:_____ INSPECTOR:_____

ADDRESS:_____ CITY:_____ DATE:_____

ASSISTANT:_____ TIME IN:_____ TIME OUT:_____

MAP SPECTRUM ANALYZER
Testing Equipment Serial Numbers

Scanner S.N.:_____

Reference Sample S.N.:_____

DAILY CALIBRATION CHECK

Calibration Sample I.D. No.:	Time	Accept*
_____	____	____
_____	____	____

*REFER TO DAILY CALIBRATION CHECK FORM FOR DETAILS

GENERAL TESTING PROCEDURES

- The testing process for each unit begins at the exterior of the front door and ends at the exterior of the back door. The living room is typically the first room to be tested.
- Testing in each room and on each floor proceeds in a clockwise manner. Ground floor rooms are tested first.
- The determination of wall #1 in any room is as follows:
  The inspector walks into the room/area with his/her back to the door. Wall #1 is the wall directly behind the inspector. Testing and numbering proceeds clockwise.
- The determination of bedroom #1 on a floor is as follows:
  Ground Floor - enter front door, with back to door, the bedroom on the left is #1.
  Second Floor - stand at the top of the stairs with back to stairs, the bedroom behind and/or to the left is bedroom #1.
  Numbering of bedrooms and bathrooms proceeds clockwise.
- Circle test type and record K-Shell result in the appropriate MAP READING (mg/cm^2) column.

DATA CODING GUIDE

BACKGROUND SUBSTRATE:

B	-	Brick
C	-	Concrete/Block
D	-	Drywall
F	-	Formica
L	-	Linoleum/Vinyl Tile
M	-	Metal
O	-	Other
P	-	Plaster
S	-	Stucco
T	-	Tile (Ceramic)
W	-	Wood

PAINT CONDITION:

G - Good-Intact

F - Fair -Intact but worn; minor chips from normal wear and tear, but no adhesion or substrate problems.

P - Poor -Non-intact; severely worn or weathered, no longer adhering (peeling, flaking, cracking, etc.) or substrate deteriorating.

TEST TYPE: (K-Shell Precision)

S - Screen Mode (0.6 mg/cm^2 @ 15 seconds)

T - Test Mode (0.3 mg/cm^2 @ 60 seconds)

WALL LOCATIONS:

1-4 indicates wall number. 5 and 6 identifies ceiling and floor. Letter corresponds to the area of the wall tested.

R - Right

L - Left

C - Center

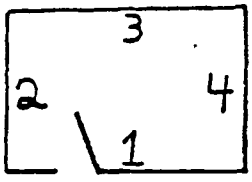

QUALITY CONTROL SIGNATURES

_____ _____

INSPECTOR DATE HSA REVIEWER DATE

DATA ENTERED:_____

INITIAL & DATE

REVISED
FEB 1993

BUILDING EXTERIOR

CLIENT/PROJECT: _____

APT./ROOM NO: _____

ROOM _____
(SECTION & CODE NO.)

I.D. NUMBER: _____

BUILDING COMPONENT	NO. CODE	WALL NO.	BACKGROUND SUBSTRATE	PAINT COND.	TEST TYPE	ASSAY NO.	MAP READING (mg/cm²)	TEST TYPE	ASSAY NO.	MAP READING (mg/cm²)
DOOR TRIM	50		B C D F I M O P S T W	G F P	S T			S T		
DOOR FRAME	51		B C D F I M O P S T W	G F P	S T			S T		
ENTRY DOOR	52		B C D F I M O P S T W	G F P	S T			S T		
SCREEN DOOR	53		B C D F I M O P S T W	G F P	S T			S T		
THRESHOLD	54		B C D F I M O P S T W	G F P	S T			S T		
			B C D F I M O P S T W	G F P	S T			S T		
WINDOW HEADER	60		B C D F I M O P S T W	G F P	S T			S T		
WINDOW TRIM	61		B C D F I M O P S T W	G F P	S T			S T		
WINDOW SILL	62		B C D F I M O P S T W	G F P	S T			S T		
WINDOW SASH	63		B C D F I M O P S T W	G F P	S T			S T		
WINDOW APRON	64		B C D F I M O P S T W	G F P	S T			S T		
			B C D F I M O P S T W	G F P	S T			S T		
WALL-UPPER	70		B C D F I M O P S T W	G F P	S T			S T		
CORD BOARD	71		B C D F I M O P S T W	G F P	S T			S T		
WALL-LOWER	72		B C D F I M O P S T W	G F P	S T			S T		
VENT COVER	73		B C D F I M O P S T W	G F P	S T			S T		
NER BOARD	74		B C D F I M O P S T W	G F P	S T			S T		
SIDE EXT. BOX	75		B C D F I M O P S T W	G F P	S T			S T		
			B C D F I M O P S T W	G F P	S T			S T		
FASCIA	81		B C D F I M O P S T W	G F P	S T			S T		
EAVES	82		B C D F I M O P S T W	G F P	S T			S T		
JOISTS	83		B C D F I M O P S T W	G F P	S T			S T		
CEILING	84		B C D F I M O P S T W	G F P	S T			S T		
SUPPORT POST	85		B C D F I M O P S T W	G F P	S T			S T		
FLOOR	86		B C D F I M O P S T W	G F P	S T			S T		
			B C D F I M O P S T W	G F P	S T			S T		
RAIL CAP	91		B C D F I M O P S T W	G F P	S T			S T		
BANISTER	92		B C D F I M O P S T W	G F P	S T			S T		
RAIL LOWER	93		B C D F I M O P S T W	G F P	S T			S T		
TREAD	94		B C D F I M O P S T W	G F P	S T			S T		
RISER	95		B C D F I M O P S T W	G F P	S T			S T		
			B C D F I M O P S T W	G F P	S T			S T		

OTES

BUILDING INTERIOR

CLIENT/PROJECT: _____

APT./ROOM NO: _____

ROOM _____
(SECTION & CODE NO.)

I.D. NUMBER: _____

BUILDING COMPONENT	NO. CODE	WALL NO.	BACKGROUND SUBSTRATE	PAINT COND.	TEST TYPE	ASSAY NO.	MAP READING (mg/cm²)	TEST TYPE	ASSAY NO.	MAP READING (mg/cm²)
DOOR TRIM	1		B C D F I M O P S T W	G F P	S T			S T		
DOOR JAMB	2		B C D F I M O P S T W	G F P	S T			S T		
DOOR	3		B C D F I M O P S T W	G F P	S T			S T		
WALL (UPPER)	4		B C D F I M O P S T W	G F P	S T			S T		
CHAIR RAIL	5		B C D F I M O P S T W	G F P	S T			S T		
WALL (LOWER)	6		B C D F I M O P S T W	G F P	S T			S T		
BASEBOARD	7		B C D F I M O P S T W	G F P	S T			S T		
WINDOW TRIM	8		B C D F I M O P S T W	G F P	S T			S T		
WINDOW SILL	9		B C D F I M O P S T W	G F P	S T			S T		
WINDOW SASH	10		B C D F I M O P S T W	G F P	S T			S T		
WINDOW APRON	18		B C D F I M O P S T W	G F P	S T			S T		
			B C D F I M O P S T W	G F P	S T			S T		
CEILING	11		B C D F I M O P S T W	G F P	S T			S T		
CROWN MOLD	12		B C D F I M O P S T W	G F P	S T			S T		
FLOOR	13		B C D F I M O P S T W	G F P	S T			S T		
HEATER	14		B C D F I M O P S T W	G F P	S T			S T		
CAB DOOR	15		B C D F I M O P S T W	G F P	S T			S T		
CAB DRAWER	16		B C D F I M O P S T W	G F P	S T			S T		
MED CABINET	17		B C D F I M O P S T W	G F P	S T			S T		
			B C D F I M O P S T W	G F P	S T			S T		
CLOSET TRIM	20		B C D F I M O P S T W	G F P	S T			S T		
CLOSET JAMB	21		B C D F I M O P S T W	G F P	S T			S T		
CLOSET DOOR	22		B C D F I M O P S T W	G F P	S T			S T		
CLOSET WALL	23		B C D F I M O P S T W	G F P	S T			S T		
CLOSET SHELF	24		B C D F I M O P S T W	G F P	S T			S T		
SHELF SUPPORT	25		B C D F I M O P S T W	G F P	S T			S T		
STAIR TREAD	30		B C D F I M O P S T W	G F P	S T			S T		
STAIR RISER	31		B C D F I M O P S T W	G F P	S T			S T		
BASEBOARD	32		B C D F I M O P S T W	G F P	S T			S T		
BANISTER	33		B C D F I M O P S T W	G F P	S T			S T		
NEWEL POST	34		B C D F I M O P S T W	G F P	S T			S T		
RAIL CAP	35		B C D F I M O P S T W	G F P	S T			S T		
			B C D F I M O P S T W	G F P	S T			S T		

NOTES

HEALTH SCIENCE ASSOCIATES
MAP (XRF) SPECTRUM ANALYZER
DAILY CALIBRATION CHECK

AGENCY: _____ INSPECTOR: _____
PROJECT: _____ DATE: _____

MAP SPECTRUM ANALYZER

HSA Equipment No: _____
Scanner S.N.: _____
Reference Sample S.N.: _____

Reference Sample Average:	K-Shell	L-Shell
	_____	_____

INITIAL CALIBRATION*

Sample I.D. Number: _____ Time: _____ Temperature: _____

Assay no.	K-Shell (mg/cm^2)	L-Shell (mg/cm^2)
1	_____	_____
2	_____	_____
3	_____	_____
4	_____	_____
5	_____	_____
Calibration Check Ave.	_____	_____

Acceptable** Yes No

FINAL CALIBRATION*

Sample I.D. Number: _____ Time: _____ Temperature: _____

Assay no.	K-Shell (mg/cm^2)	L-Shell (mg/cm^2)
1	_____	_____
2	_____	_____
3	_____	_____
4	_____	_____
5	_____	_____
Calibration Check Ave.	_____	_____

Acceptable** Yes No

* All Calibration Checks are run on Test Mode.
** Acceptance Criteria: ± 36% of the Reference value (Approx. ± 0.7 mg/cm^2)